

Lambda Series CNC System

Manufacturers' Manual

3rd Edition

(For PM85A/95A, NC65A/65B)

Weihong Electronic Technology Co., Ltd.

The copyright of this manual belongs to Weihong Electronic Technology Co., Ltd. (hereinafter referred to as Weihong Company). This manual and any image, table, data or other information contained in this manual may not be reproduced, transferred, or translated without any prior written permission of Weihong Company.

The information contained in this manual is constantly being updated. You can login to the official website of Weihong Company <http://en.weihong.com.cn> to download the latest PDF edition for free.

Third Edition, July, 2015

First Printing, July, 2015

136 pages

Preface

About this manual

This manual is intended for manufacturers. If you use the CNC system for the first time, you need to read through the manual. If you are experienced with the system, you can search for the desired info via the contents.

With 6 chapters, this manual can be divided into 3 parts, as follows:

- 1) Part 1: preface, introducing the precautions about transportation and storage, installation, wiring, debugging, usage, and so on. You need to read them carefully beforehand to ensure safe operations.
- 2) Part 2: product, including Chapter 1~4. Chapter 1 is product overview, Chapter 2 wiring, Chapter 3 and 4 installation and machine debugging.
- 3) Part 3: appendix, including Chapter 5 and 6. Chapter 5 lists parameter settings and wiring diagrams of various drivers while Chapter 6 states the software license agreement.

Applicable Product Models

This manual is applicable to Lambda series CNC system, including NC65A/65B host, PM85A/95A communication card and Lambda series controller. Refer to the table below for details:

Product Model	Remarks
NC65A/65B host	Integrating CPU, 60G SSD, 1G RAM, communication card and NcStudio motion control software, used together with Lambda 4S/5S series controller.
PM85A/95A communication card	Self-developed multi-axis communication card, used together with Lambda series controller.
Lambda series controller	High-performance integrated controller box, including 3L, 3S, 4S and 5S, used together with PM85A/95A communication card or NC65A/65B host.

Contact Us

You can contact us by the following info for technical support and pre-sales/after-sales service:

Company Name: Weihong Electronic Technology Co., Ltd.
Headquarters Address: No. 29, 2338 Duhui Rd., Minhang, Shanghai 201108
Tel: +86-21-33587550
Fax: +86-21-33587519
Website: <http://en.weihong.com.cn>
E-mail: sales@weihong.com.cn

Revision History

You can refer to the following table for the revision records of each edition.

Date	Edition	Revision Contents
2015.04.16	R2	Released for the first time.
2015.07.01	R3	Main revision contents as follows: 1) Update of <i>2.1 Lambda 3S/3L Series Controller</i> according to the latest software; 2) Update of <i>2.2 Lambda 4S/5S Series Controller</i> according to the latest software; 3) Update of <i>3.1.2 Driver Update</i> ; 4) Update of <i>3.2.1 Software Setup</i> ; 5) Other revisions.

Precautions

Precautions can be divided into caution and warning according to the degree of possible loss or injury in case of negligence or omission of precautions stipulated in this manual.



: general info, mainly for informing, such as supplementary instructions and conditions to enable a function. In case of negligence or omission of this kind of precautions, you may not activate a function. Note that in some circumstances, negligence or omission of even this kind of precautions could cause physical injury or machine damage.



: warning info requiring special attention. In case of negligence or omission of this kind of precautions, you may suffer physical injury, or even death, machine damage or other losses.



1) Precautions Related to Storage and Transportation

- The products should be transported properly in terms of the weight;
- An excess of specified quantity of stacking products is prohibited;
- Climbing, standing or placing heavy loads on the products is prohibited;
- Dragging or carrying the products via cables or devices connected to them is prohibited;

2) Precautions Related to Installation

- Only when this equipment installed in the qualified electricity cabinet can it be used. The construction of the cabinet must reach IP54 grade of protection;
- Paste sealing strips on the joint of the cabinet to seal all the cracks;
- Cable entry should be sealed while easy-to-open on the spot;
- A fan or heat exchanger should be adopted for the heat dissipation and air convection of the cabinet;
- If a fan is adopted, air strainer is a must in air inlet or air outlet;
- Dust or cutting fluids may have access to the CNC device via the tiny cracks and tuyere. Therefore it is necessary to pay attention to the surroundings and air flow direction of the air vent to make sure that the outflow gas is towards pollution source;
- 100 mm space should be preserved between the back of the CNC device and the cabinet wall for plugging cable connected with the device and the ventilation & heat dissipation in the cabinet;
- Space between this device and other equipments should also be preserved according to the requirements;
- The product should be installed firmly and without vibration. During installing, casting, knocking, striking, or loading on the product is forbidden;
- To reduce electromagnetic interference, power-supply components used should be above AC or DC 50V and the space between cable and CNC device should be preserved above 100mm;
- It will be better if CNC device is installed at a position facilitating debugging and maintenance.

TO BE CONTINUED

**CONTINUE****3) Precautions Related to Wiring**

- Only qualified people are allowed to participate in the wiring and checking;
- The CNC device should be grounded reliably and grounding resistance should be less than 4 ohm. Neutral line is absolutely not allowed to replace earth wire. Otherwise, it may result in malfunction of the device due to the interference;
- Wiring should be firm and steady, or misoperation may occur;
- Voltage values and positive & negative polarity of any connection plug should be in accordance with specifications set forth in the manual, or it may result in breakdowns such as short circuit and permanent damage to the device;
- To guard against electric shock or CNC device damage, fingers should keep dry before plugging or touching switch;
- The connecting wire should not be damaged and squeezed, or the leakage or short circuit may occur;
- It is prohibited to plug or open the chassis of CNC device when power on.

4) Precautions Related to Running & Debugging

- Parameters setting should be checked before running, since wrong setting may lead to accidental movements;
- Modification to parameters should be within the allowable range, or such breakdowns as unsteady running and machine damage will occur.

5) Precautions in Use

- Before power-on, please make sure that the switch is on blackout to avoid occasional start-up;
- Please check the electromagnetic compatibility during electrical design in order to avoid or reduce electromagnetic interference to the CNC device. A low pass filter should be employed to reduce electromagnetic interference if there are other electrical devices nearby;
- It is not allowed to frequently power on and power off. It is recommended to power up the machine again at least one (1) minute later after power failure or blackout.



1) Precautions Related to Product and Manual

- Matters related to restrictions and functions available stipulated in the manuals issued by the machine manufacturer are prior to those in this manual;
- This manual assumes all the optional functions are available, which you must confirm through manuals issued by the machine manufacturer;
- Please refer to manuals issued by the machine manufacturer for the instructions of machine tools;
- Functions, and software interfaces vary with the system and the version of software. Before using the system, you must confirm the specifications.

2) Precautions When Opening the Package

- Please make sure that the products are what you have ordered;
- Check if the products are damaged in transit;
- Check if the components and accessories are damaged or missing in terms of the detailed list;
- Please contact us promptly if product discrepancy, accessory missing or transit damage occurs.

Contents

1	Overview	- 1 -
1.1	NC65A/65B Host.....	- 1 -
1.2	PM85A/95A Communication Card.....	- 2 -
1.2.1	Structural Drawing of PM85A Communication Card	- 2 -
1.2.2	Structural Drawing of PM95A Communication Card	- 2 -
1.3	Lambda 3S/3L Series Controller.....	- 3 -
1.4	Lambda 4S/5S Series Controller	- 4 -
1.5	System Running Status Description	- 5 -
1.6	Configuration.....	- 6 -
1.6.1	Lambda 3S/3L Series CNC System	- 6 -
1.6.2	Lambda 4S/5S Series CNC System	- 6 -
1.7	Overall Wiring Diagram.....	- 7 -
2	Wiring.....	- 8 -
2.1	Lambda 3S/3L Series Controller.....	- 8 -
2.1.1	Definitions of Inputs	- 9 -
2.1.2	Definitions of Outputs	- 9 -
2.2	Lambda 4S/5S Series Controller	- 10 -
2.2.1	Engraving and Milling	- 10 -
2.2.2	Glass Cutting	- 14 -
2.2.3	Waterjet Cutting.....	- 22 -
2.2.4	Three Axes Laser Cutting.....	- 32 -
2.2.5	Dual Z Axes	- 34 -
2.2.6	Three Z Axes	- 36 -
2.3	Driver Interface	- 38 -
2.3.1	Lambda 3S/3L Series Controller	- 38 -
2.3.2	Lambda 4S/5S Series Controller.....	- 38 -
2.4	MPG Interface.....	- 39 -
2.5	Extended Terminal Board Interface	- 40 -
2.5.1	Cascade Connection	- 40 -
2.5.2	Non-cascade Connection	- 41 -
2.6	Signal Types.....	- 41 -
2.6.1	Binary Input Signal	- 41 -
2.6.2	Relay Output Signal	- 42 -
2.6.3	Servo Enable Signal.....	- 42 -
2.6.4	Encoder Signal	- 42 -

2.6.5	Command Pulse Signal.....	- 43 -
2.6.6	Analog Output Signal	- 43 -
3	Installation	- 44 -
3.1	PM85A/95A Communication Card.....	- 44 -
3.1.1	Installation Steps	- 44 -
3.1.2	Driver Update	- 44 -
3.1.3	Customization of Setup Installation Package.....	- 48 -
3.2	NC65A/65B Host.....	- 49 -
3.2.1	Software Setup.....	- 49 -
3.2.2	OS Backup and Restore.....	- 50 -
3.2.3	OS Backup and Restore via USB Flash Disk.....	- 53 -
4	Machine Tool Debugging	- 56 -
4.1	Debugging Steps.....	- 56 -
4.2	Pulse Test.....	- 60 -
4.2.1	Stepping Driver.....	- 60 -
4.2.2	Servo Driver.....	- 60 -
5	Appendix.....	- 62 -
5.1	Back to Machine Zero (Back to Reference Point)	- 62 -
5.1.1	Principle of Returning to Machine Origin (without Encoder Feedback)	- 63 -
5.1.2	Principle of Returning to Machine Origin (with Encoder Feedback)	- 65 -
5.2	Pulse Equivalent Adjustment	- 66 -
5.3	Electronic Gear Ratio.....	- 68 -
5.3.1	Electronic Gear.....	- 68 -
5.3.2	Electronic Gear Functions	- 68 -
5.3.3	Computing Method of Electric Gear Ratio.....	- 69 -
5.3.4	Samples of Electronic Gear Setting	- 70 -
5.4	Driver Parameters.....	- 72 -
5.4.1	Lambda 3S/3L Series	- 72 -
5.4.2	Lambda 4S/5S.....	- 81 -
5.5	Wiring Diagram of Controller and Driver	- 109 -
5.5.1	Lambda 3S/3L Series	- 109 -
5.5.2	Lambda 4S/5S Series	- 114 -
6	Software License Agreement	- 125 -

1 Overview

1.1 NC65A/65B Host

Independently developed and industrial-mainboard based, NC65A/65B integrated CNC system comprises Lambda 4S/5S series controller and NC65A/65B host integrating CPU, 60G SSD, 1G RAM, control card and NcStudio motion control software, having proven its daily use in glass edging, glass cutting, engraving & milling, and other cutting industries.

Running on PC-based OS platform, NC65A/65B, through strict EMC test, is with digital verification function and thus anti-virus, featuring high reliability, high cost performance and compact design.

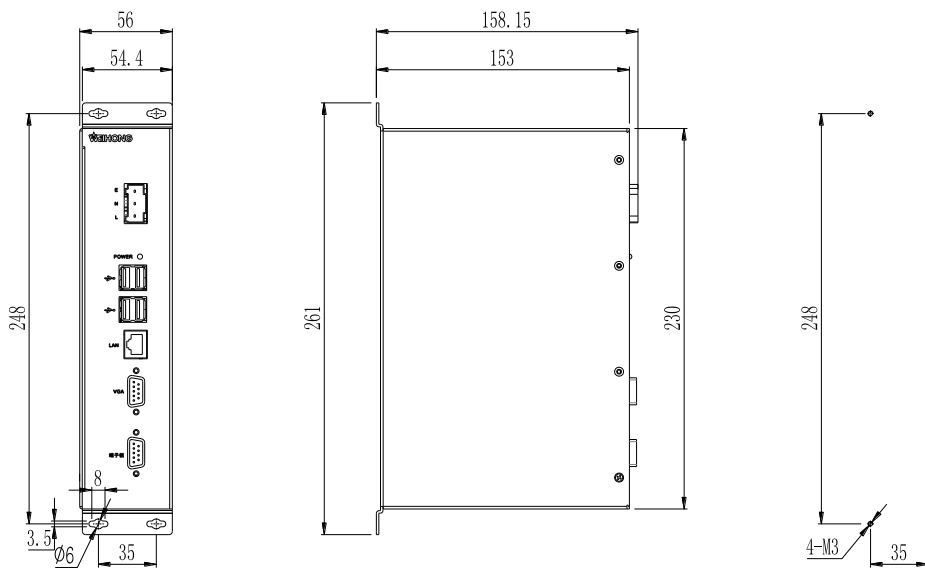


Fig. 1-1 Dimensional drawing of NC65A host

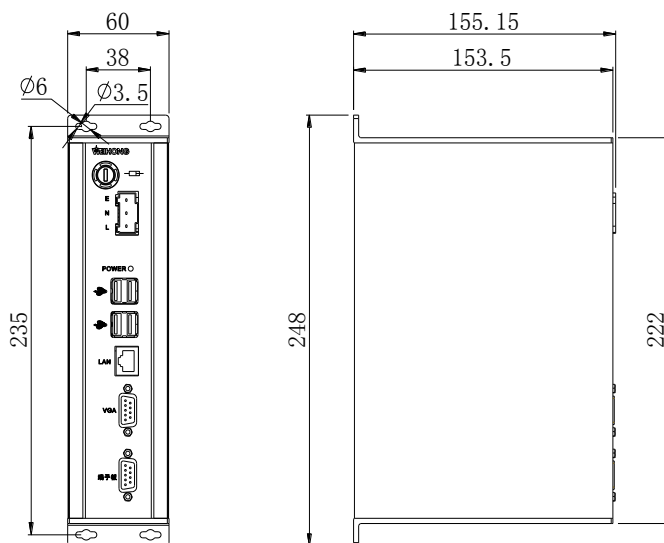


Fig. 1-2 Dimensional drawing of NC65B host

There are some external interfaces on the NC65A/65B host:

- L, N and E: live wire, neutral wire and earth wire respectively, for external connection with 220V power supply;
- USB: for external connection with USB device (e.g. USB flash drive);
- LAN: Ethernet port, 100Mbps;
- VGA: video output interface;
- 端子板: for external connection with Lambda 4S/5S series controller;
- Fuse: replaceable, only available in NC65B host.

1.2 PM85A/95A Communication Card

Independently developed by Weihong Electronic Technology Co., Ltd., PM85A/95A communication card, when used with NcStudio motion control software, has proven itself in daily use on routers, engraving and milling machines, drilling machines and cutting machines, available of comprehensive functions and convenient to use.

1.2.1 Structural Drawing of PM85A Communication Card

PM85A should be inserted into a PCI slot, and its dimension is 138.4mm * 59.7mm.

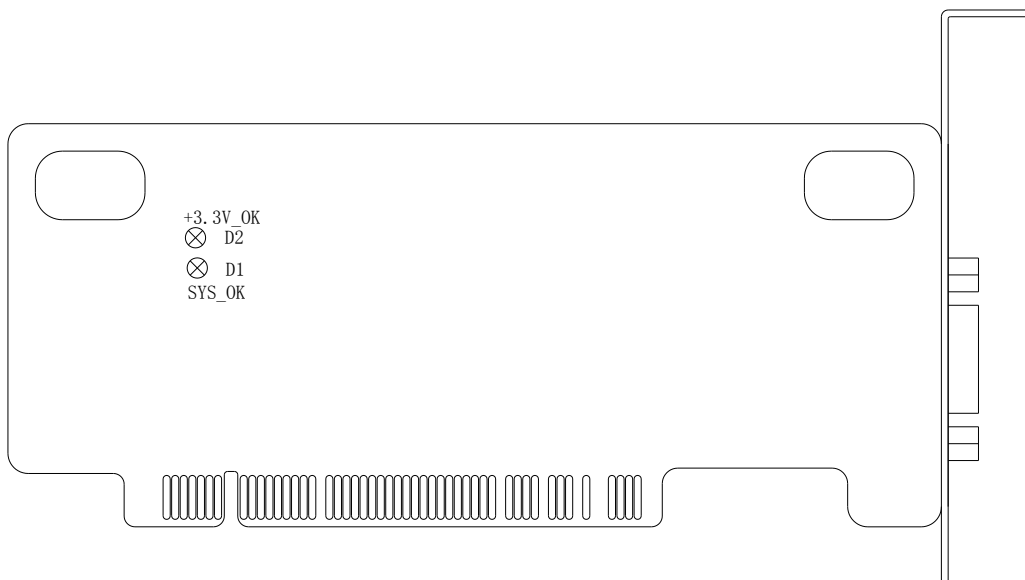


Fig. 1-3 Structural drawing of PM85A communication card

1.2.2 Structural Drawing of PM95A Communication Card

PM95A should be inserted into a PCI-E slot, and its dimension is 138mm * 60.5mm.

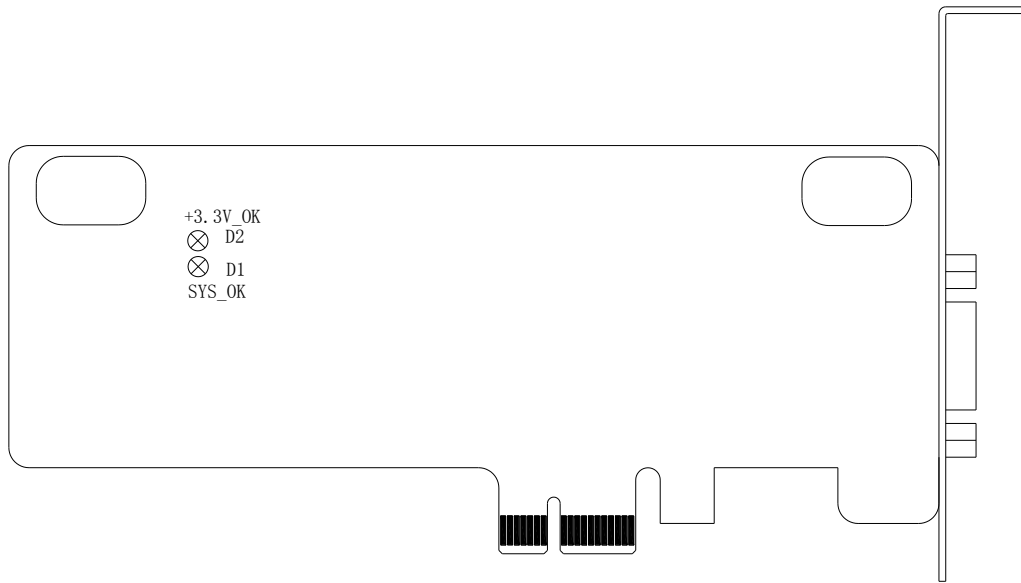


Fig. 1-4 Structural drawing of PM95A communication card



Both PM85A and PM95A have two indicator lamps—+3.3V_OK(D2) and SYS_OK (D1). The latter one is the system indicator lamp. See Section 1.5 for details. The former one is the power indicator lamp, on after the card is correctly inserted into the PC slot and the PC is started.

1.3 Lambda 3S/3L Series Controller

Independently developed by Weihong Electronic Technology Co., Ltd., Lambda 3S/3L series controller, used together with PM85A/95A communication card, is mainly applied to controlling routers, engraving and milling machines, drilling machines and cutting machines, available of comprehensive functions and convenient to use. Generally, Lambda 3S/3L controller is used together with stepping motor drivers.

The only difference between Lambda 3L and Lambda 3S is that Lambda 3S has a MPG interface. That is to say, Lambda 3L does not have a MPG interface. Their other functions are the same.

Lambda 3S/3L series controller includes the following features:

- Enclosed controller, oil-proof, dust-proof, and water-proof;
- Serial communication, high speed 485 interface, baud rate 10Mbps;
- Max. pulse output frequency: 1MHz;
- Fewer cables and easier wiring;

- On-line update of hardware, dismounting avoided;
- Hardware adaptable, software customizable;
- Hardware encryption and software encryption for safety concerns;
- Input polarity adjustable, inputs active high/ low.

See Fig. 1-5 for the dimensional drawing of Lambda 3S. The dimension of Lambda 3L is the same as that of Lambda 3S.

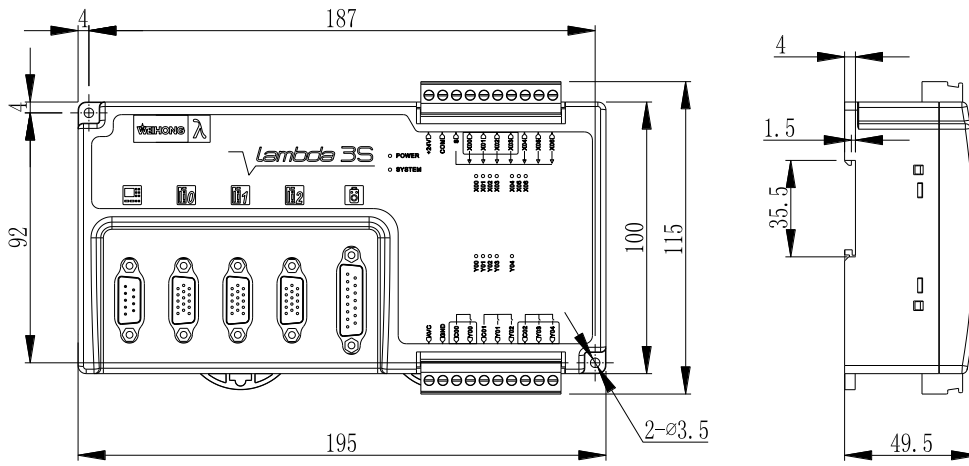


Fig. 1-5 Dimensional drawing of Lambda 3S

1.4 Lambda 4S/5S Series Controller

Fully enclosed, Lambda 4S/5S controller not only has better protection, but also improves appearance and quality. With a brand new hardware design scheme for the control board in the controller, Lambda 4S/5S is designed in an integrated way, extensively applied in engraving & milling, waterjet cutting, glass cutting and other industries.

Lambda 5S can support motion control of up to 5 axes, while Lambda 4S up to 4 axes.

Lambda 4S/5S series controller includes the following features:

- Enclosed controller, oil-proof, dust-proof, and water-proof;
- Input polarity adjustable, inputs active high/ low;
- Cascaded connection available for the extended terminal board;
- Serial communication, high speed 485 interface, baud rate 10Mbps;
- Max. pulse output frequency: 1MHz;

- Fewer cables and easier wiring;
- On-line update of hardware, dismounting avoided;
- Hardware adaptable, software customizable;
- Hardware encryption and software encryption for safety concerns;
- Encoder feedback available;
- 2 to 5 axes motion control.

See Fig. 1-6 for the dimensional drawing of Lambda 5S controller, whose dimension is the same as that of Lambda 4S controller.

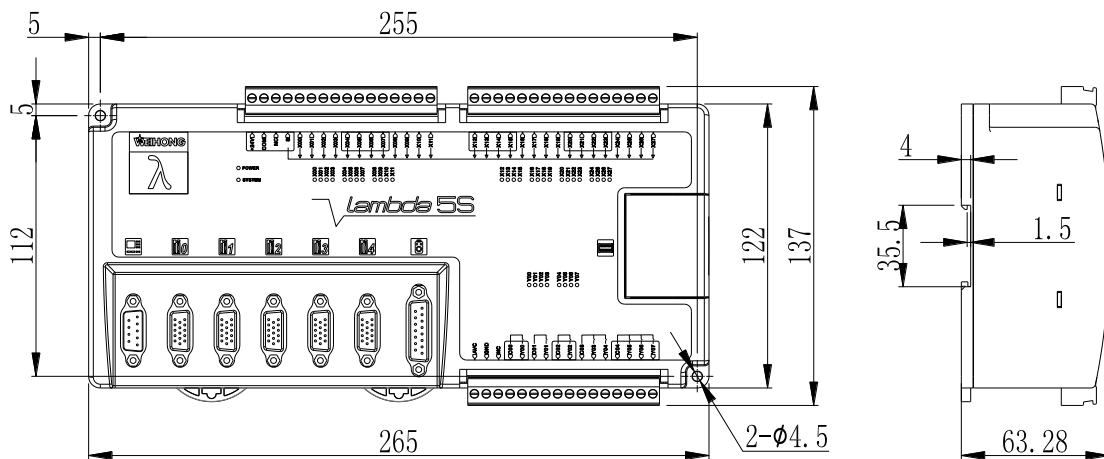


Fig. 1-6 Dimensional drawing of Lambda 5S controller

1.5 System Running Status Description

The system indicator lamp of PM85A/95A is SYS_OK, while that of Lambda series controller is SYSTEM. Their flash frequency is used to tell whether the system communication is normal, as follows:

- When the machine tool is in idle status, the flash frequency is 0.33Hz (flashing once every 3 seconds);
- When the communication is normal, the flash frequency is 2Hz (flashing twice every 1 second);
- When the system is abnormal, the flash frequency is 10Hz (flashing 10 times every 1 second);
- When hardware exception occurs, such as under voltage, hardware damage, pseudo soldering, and short circuit, the system indicator lamp is always on or off.

- For a Lambda 4S/5S series CNC system, when PC logical data or physical connection interrupted, the IO ports on the controller and the extended terminal board maintain their status.

1.6 Configuration

1.6.1 Lambda 3S/3L Series CNC System

- One communication card (PM85A or PM95A);
- One Lambda 3S/3L series controller;
- One DB9M/F cable (Cable length customizable);
- Cables (DB15) connected to stepping drivers (Configured according to actual situations);
- One NcStudio motion control software CD (Not required if software customized);
- One NK-MPG-06 handwheel (Optional).

1.6.2 Lambda 4S/5S Series CNC System

- One communication card (PM85A or PM95A) or one NC65A/65B or NK300BX host;
- One Lambda 4S/5S series controller;
- One NcStudio motion control software CD (Not required if software customized);
- One DB9M/F cable (Cable length customizable);
- One handwheel (Optional, including NK-MPG-06, aviation plug handwheel NK-MPG-09 and EHDW-DA5S-1M).



- 1) For the info related to Lambda 4S controller used together with NK300BX host, please refer to *NK300BX Integrated CNC System Manufacturers' Manual*.
- 2) The configuration specified in Section 1.6 is the standard one. Please make sure the configuration according to the delivery note.

1.7 Overall Wiring Diagram

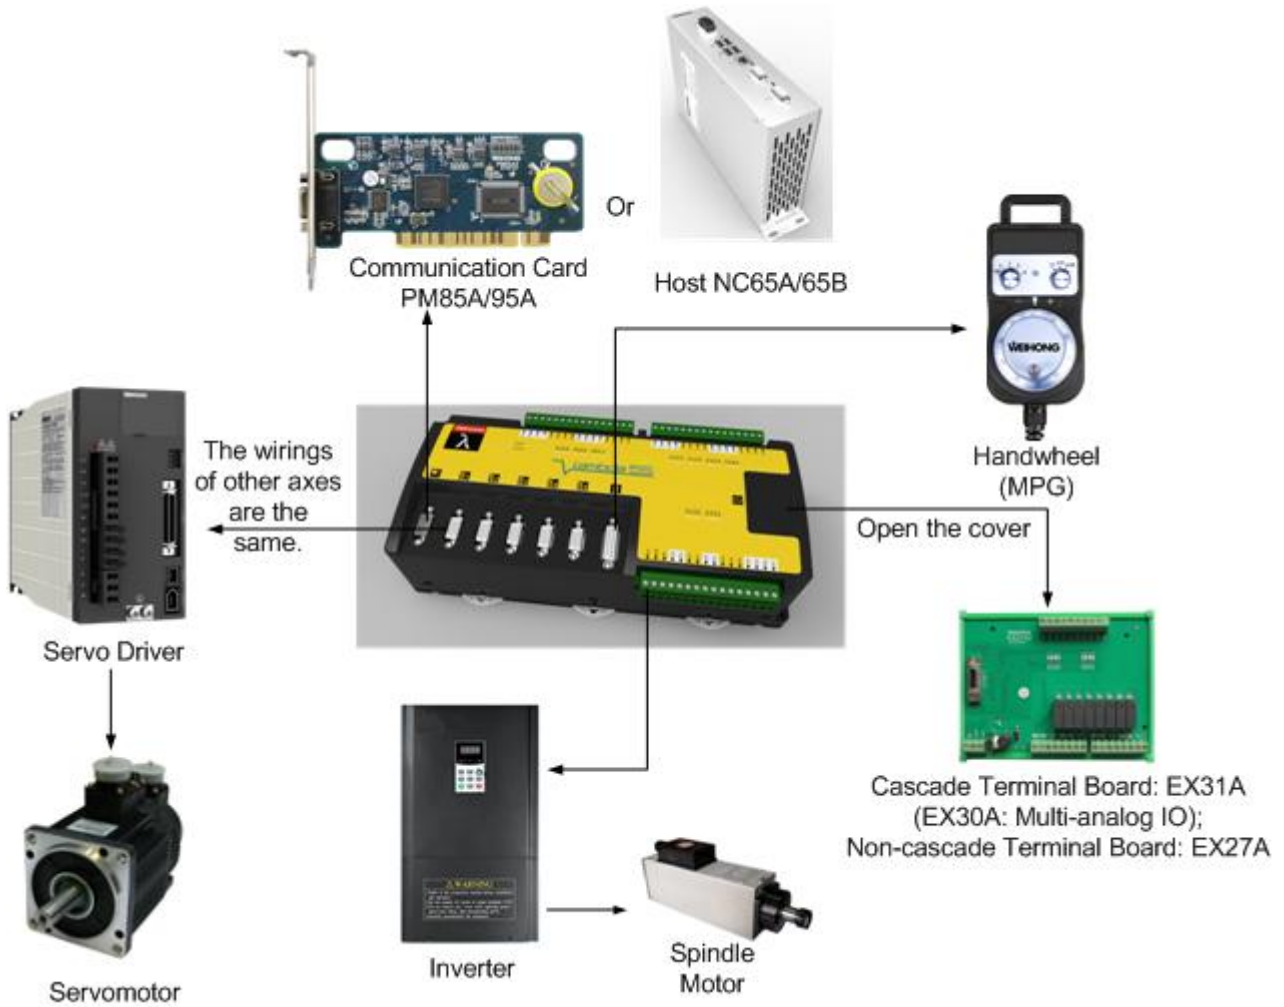


Fig. 1-7 Overall wiring diagram



Please connect according to the actual situations. The above picture is provided for reference only.

2 Wiring

2.1 Lambda 3S/3L Series Controller

Lambda series controller is compatible with PNP and NPN switches, with inputs NO/NC and active high/low. **When S is connected to COM, inputs are active high; when connected to +24V, active low.**

The type of the power circuit of Lambda 3S/3L series circuit board is switching power supply, with overvoltage and undervoltage protection.

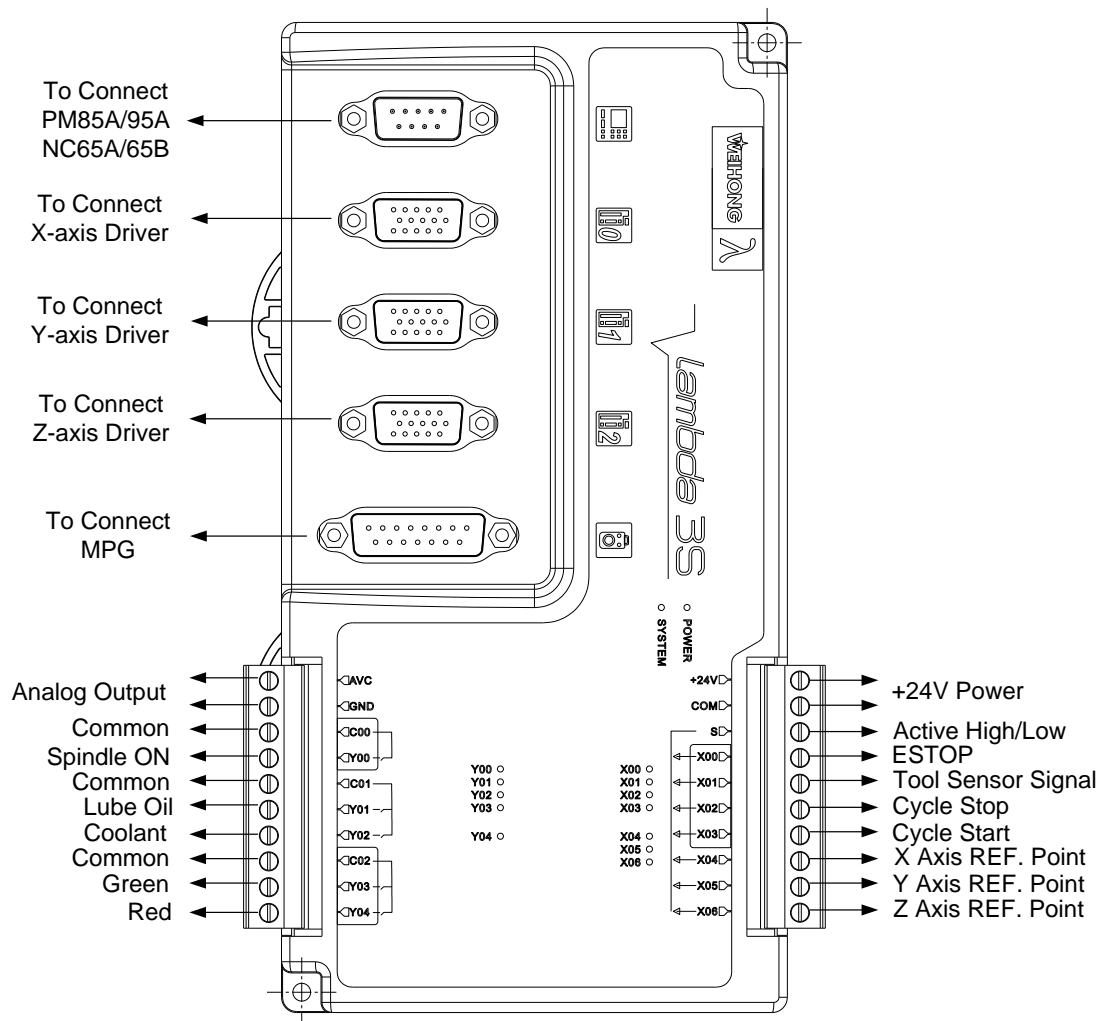


Fig. 2-1 IO definitions and wiring of Lambda 3S controller



- 1) Except for no MPG interface, Lambda 3L controller has the same inputs and outputs as Lambda 3S.
- 2) The above wiring is a standard one, provided for reference only. Please refer to the specific software for IO definitions and IO wiring.

2.1.1 Definitions of Inputs

There are altogether 7 inputs, with their definitions as follows:

Category	Port No.	Definition	Remark
External power supply	+24V	DC 24V power supply	Providing power supply for the controller.
	COM		
Inputs commonly used	X00	Emergency stop	Binary input, generally connected to a NC button.
	X01	Tool sensor signal	Binary input, connected to tool sensor signal.
	X02	Cycle stop	For external connection with an operating button.
	X03	Cycle start	For external connection with an operating button.
	X04	X-axis reference point	Binary input, connected to X-axis home switch.
	X05	Y-axis reference point	Binary input, connected to Y-axis home switch.
	X06	Z-axis reference point	Binary input, connected to Z-axis home switch.
Common	S	Common port of the above 7 inputs	When S is connected to COM, inputs are active high; when to +24V, active low.

2.1.2 Definitions of Outputs

The definitions of the outputs are as follows:

Category	Port No.	Definition	Remark
Spindle control	AVC	Analog voltage (0~10V) output signal	Controlling the rotary speed of spindle motor. It externally connects with the analog voltage frequency instruction input terminal of an inverter (generally known as AVI/VI) and controls spindle speed through voltage change causing frequency change of inverter.
	GND	Analog voltage ground	Connecting with analog ground of an inverter (generally known as ACM).
	Y00	Spindle on	Relay output.
Outputs commonly used	Y01	Lube oil	Relay output to control auto oil; LED on when lube oil on, while LED off when lube oil off.
	Y02	Coolant	Controlling coolant pump on/off.
	Y03	Green	Green lamp on when a machine tool is in normal working status.

Category	Port No.	Definition	Remark
	Y04	Red	Red lamp on when system E-stop occurs, also on as a reminder when machining ends regularly.
Common	C00	Common of Y00	
	C01	Common of Y01 and Y02	
	C02	Common of Y03 and Y04	

2.2 Lambda 4S/5S Series Controller

The normal working range of Lambda 4S/5S series controller is 17V~30V, and the rated voltage is 24V. When the voltage difference between power voltage and the Common S is over 8V, the input connection becomes effective. The inputs of Lambda 4S/5S series controller can be active high/low, so can the extended terminal board. **When Common S is connected to COM, inputs are active high; when to +24V, active low.**



The wirings below are for the general software for the time being, provided for reference only. Please refer to the specific software for IO definitions and IO wiring, because IO definitions and IO wiring change with software IO definitions.

2.2.1 Engraving and Milling

See this section for the wiring diagrams of controller for three to five axes engraving and milling machines.

For three and four axes engraving and milling machines, Lambda 4S controller is used. When IOs are not enough, you can choose extended terminal board EX27A.

For five axes engraving and milling machines, Lambda 5S controller is used. When IOs are not enough, you can choose extended terminal board EX31A.

◆ Three Axes Engraving and Milling

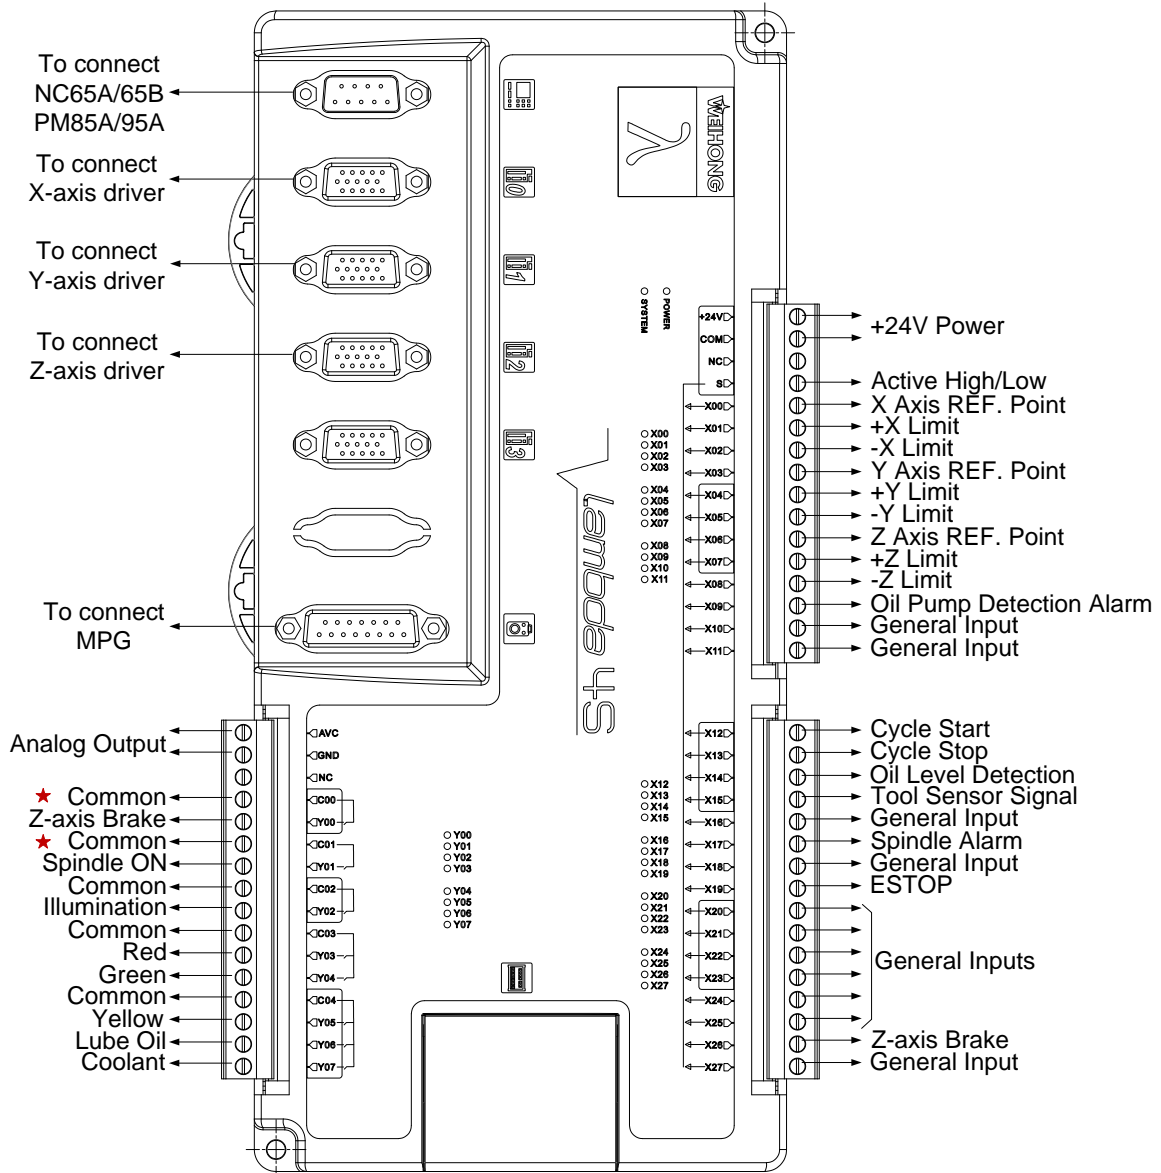


Fig. 2-2 Connection according to three axes engraving and milling software



- 1) The above wiring diagram is provided according to software NcStudio V8; for NcStudio V10 software, IO definitions are the same as those of NcStudio V8, except that Y05 is defined as “Spindle Cool” instead of “Yellow”.
- 2) For Lambda 4S/5S series controller, C00 is the common of Y00, C01 the common of Y01, C02 the common of Y02, C03 the common of Y03 and Y04, and C04 the common of Y05, Y06 and Y07.



Terminals Y00/C00 and Y01/C01 (marked with ★ in the wiring diagrams below) on Lambda 4S/5S controller should only be connected with load of voltage lower than or equal to 24V, otherwise, they will be damaged and cannot work due to burn-out of the piezoresistor, since a protective circuit is added to them for brake function (for serial connection with 24V motor brake coil).

◆ Four Axes Engraving and Milling

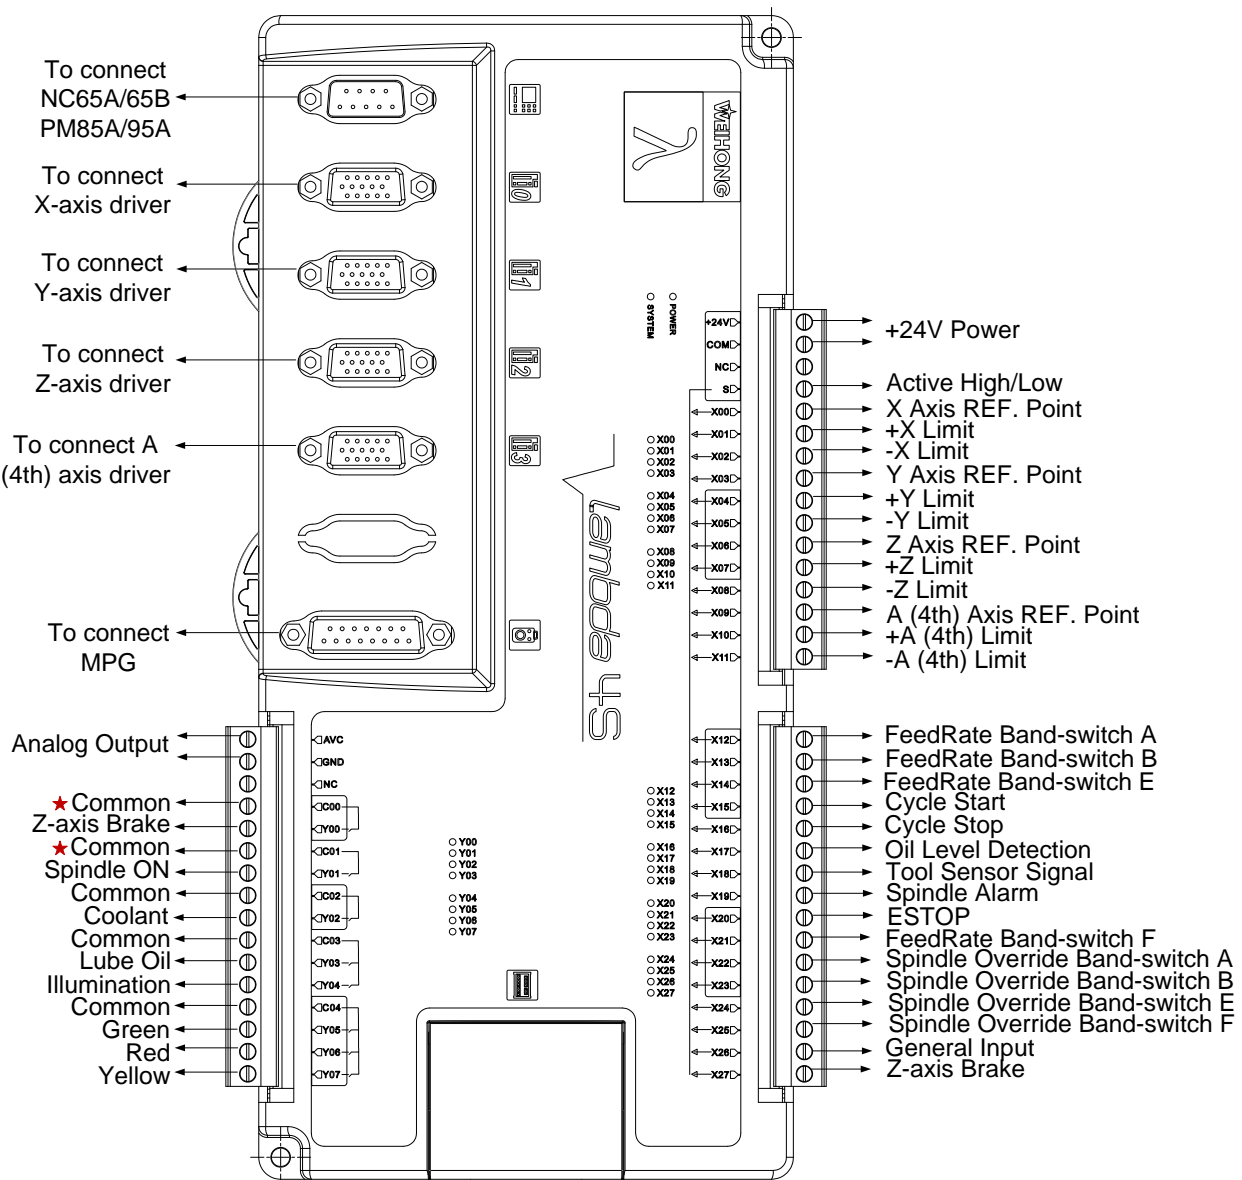


Fig. 2-3 Connection according to four axes engraving software



You can decided whether to connect input ports of feedrate override band switch and spindle override band switch according to the actual situation.

◆ **Five Axes Engraving and Milling**

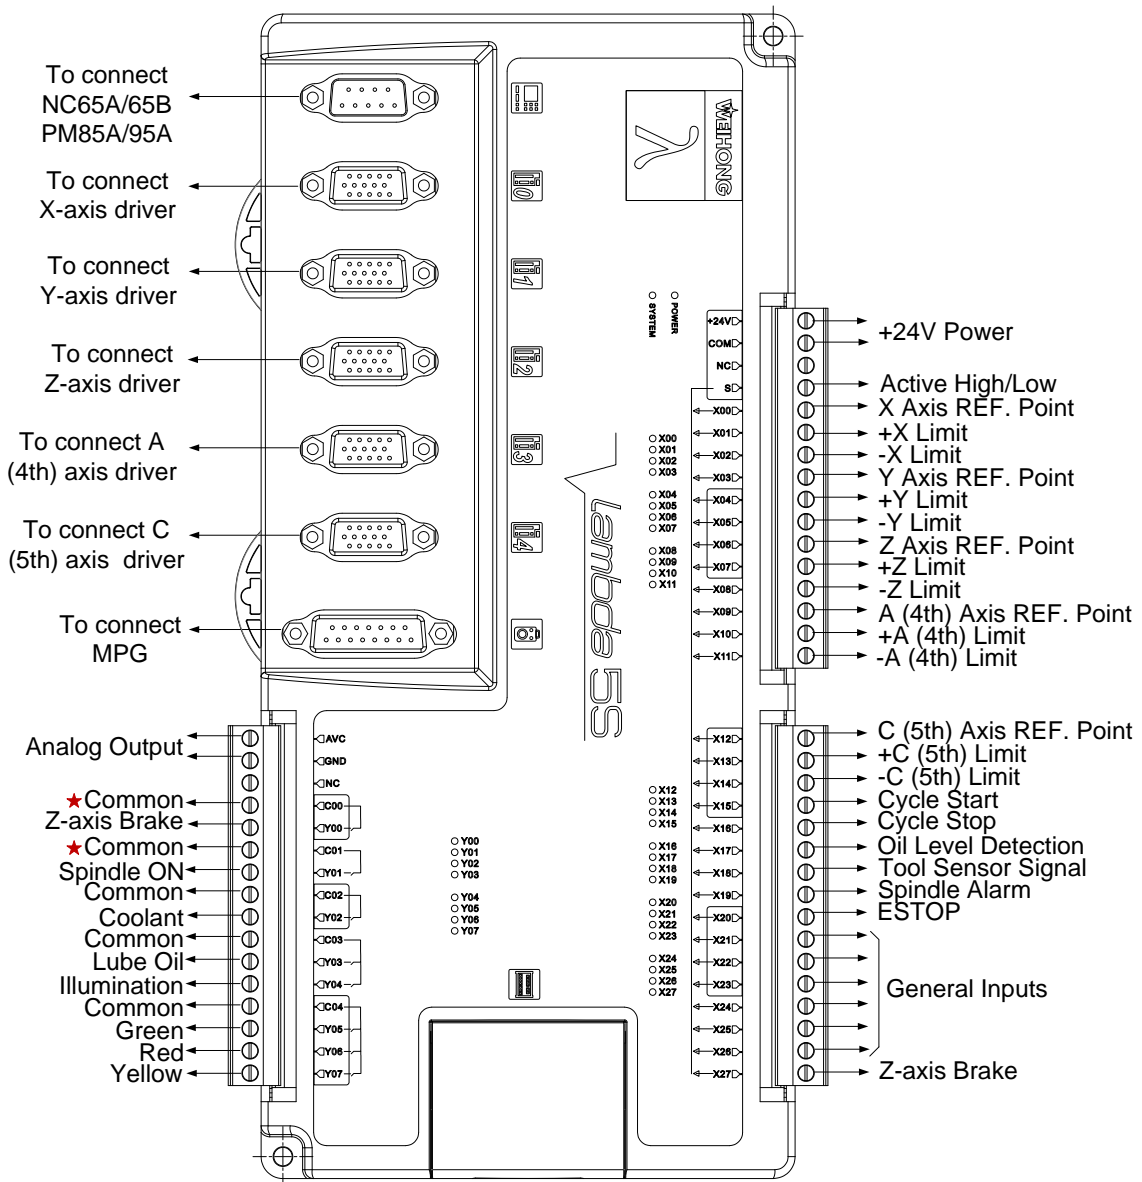


Fig. 2-4 Connection according to AC configuration



For AB and BC configuration, the definitions of inputs and outputs are the same as those in AC configuration, except X9~X14 are defined as REF. point and \pm limit of AB/BC axes respectively.

2.2.2 Glass Cutting

Glass cutting software includes five kinds of configuration—XYA config, XYZA config, X1YAX2 config, XYA no edge config and XYZA no edge config. See this section for wiring diagrams of Lambda 4S controller according to the five configurations respectively.

◆ **XYA Config**

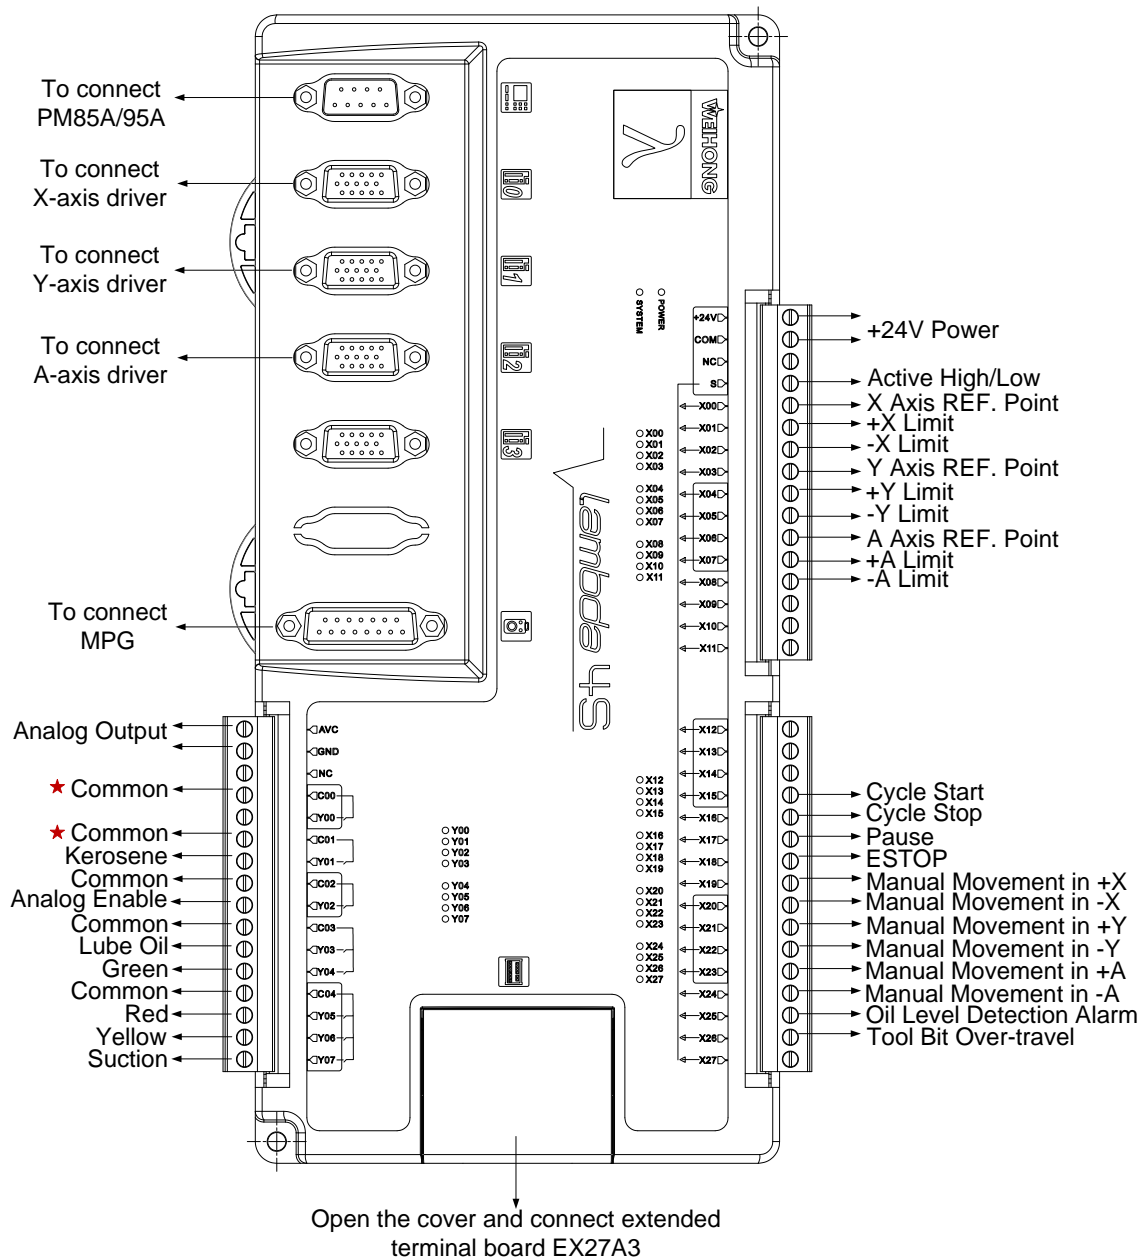


Fig. 2-5 Connection according to XYA configuration

The extended terminal board EX27A3 (118mm*83mm*56.45mm) is required in XYA configuration. See Fig. 2-6 for the I/O definition and wiring diagram.

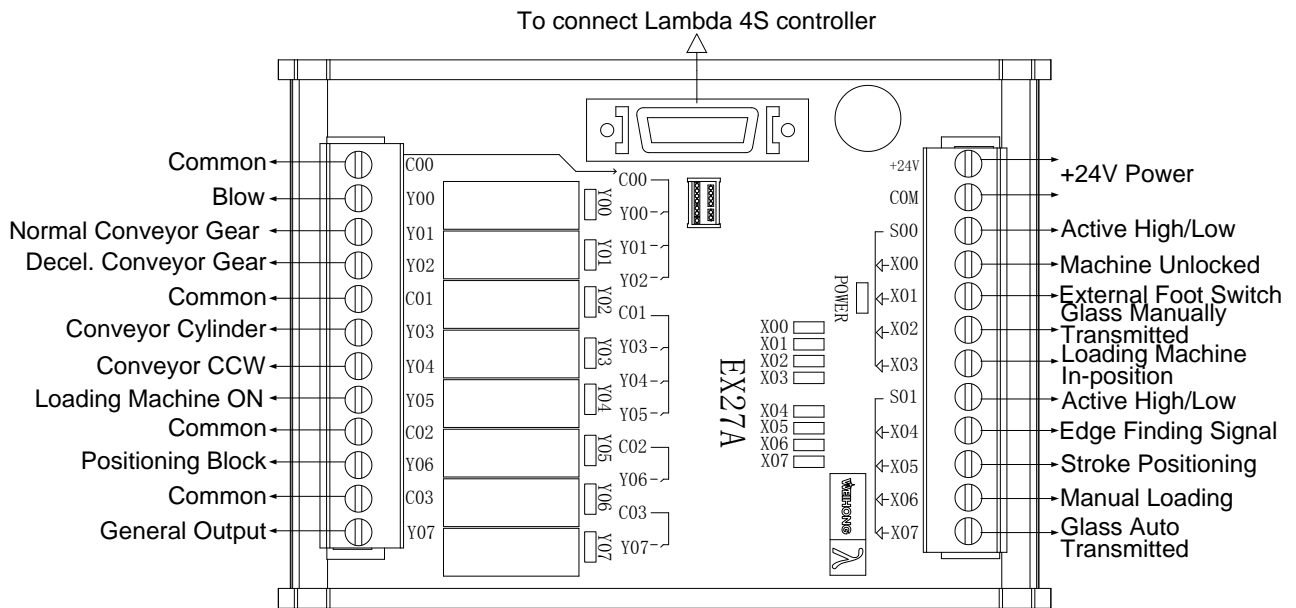


Fig. 2-6 Wiring example of EX27A3 according to XYA configuration

◆ XYZA Config

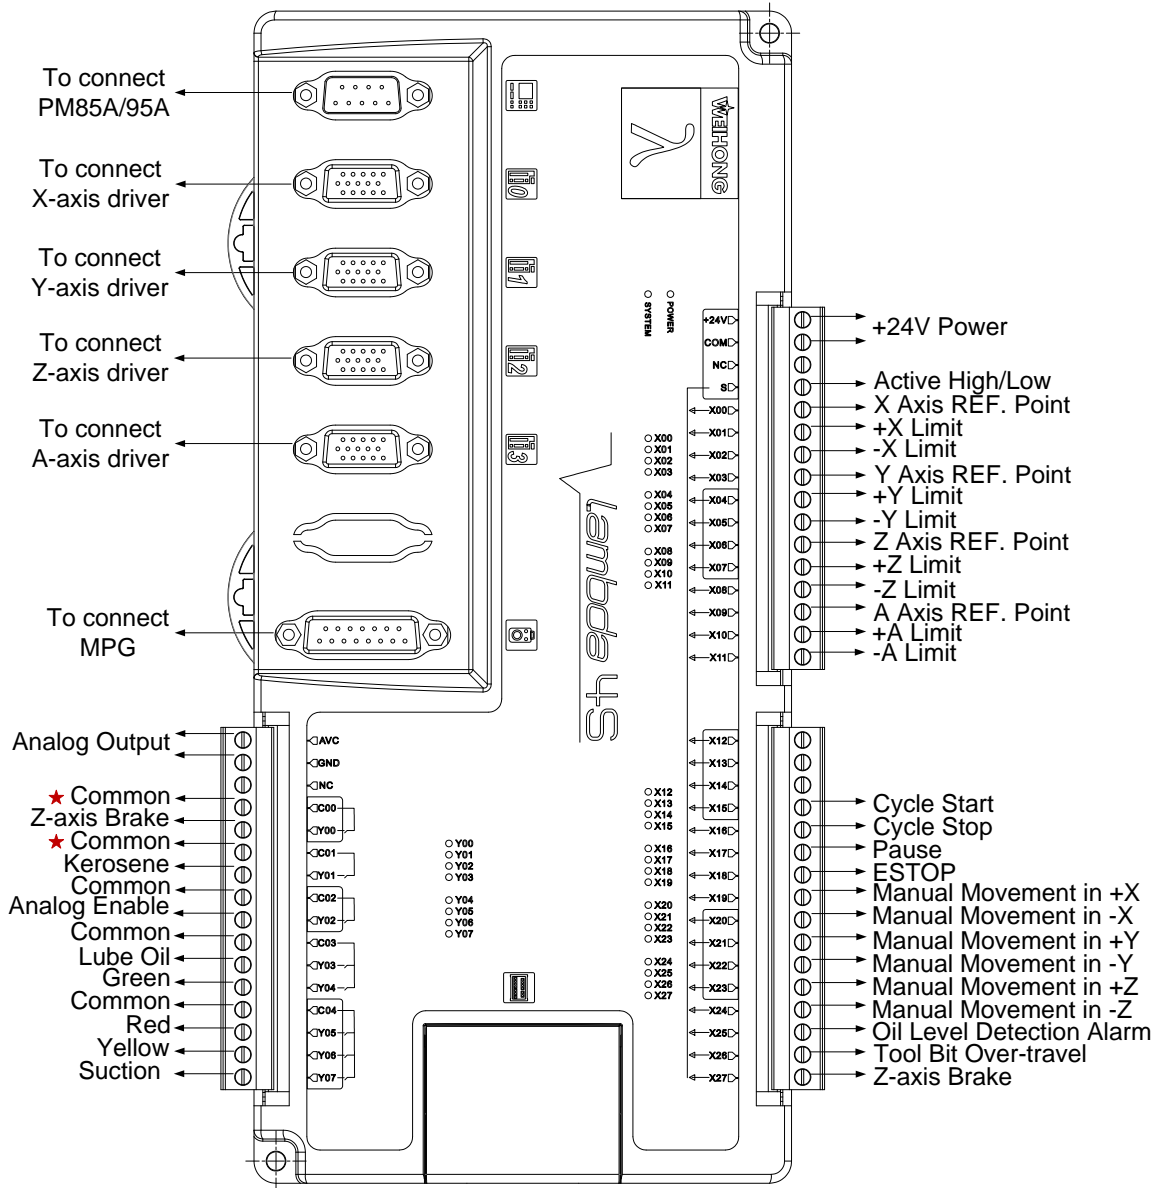


Fig. 2-7 Connection according to XYZA configuration

The extended terminal board EX27A3 (118mm*83mm*56.45mm) is required in XYZA configuration. See Fig. 2-8 for the I/O definition and wiring diagram.

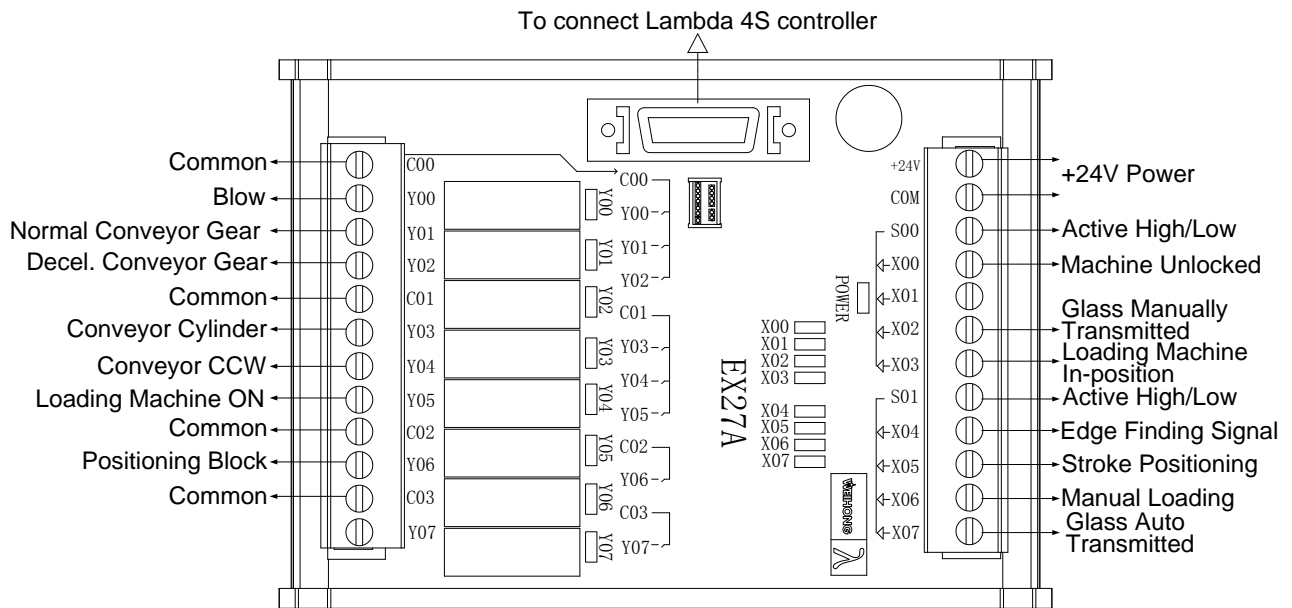


Fig. 2-8 Wiring example of EX27A3 according to XYZA configuration

◆ X1YAX2 Config

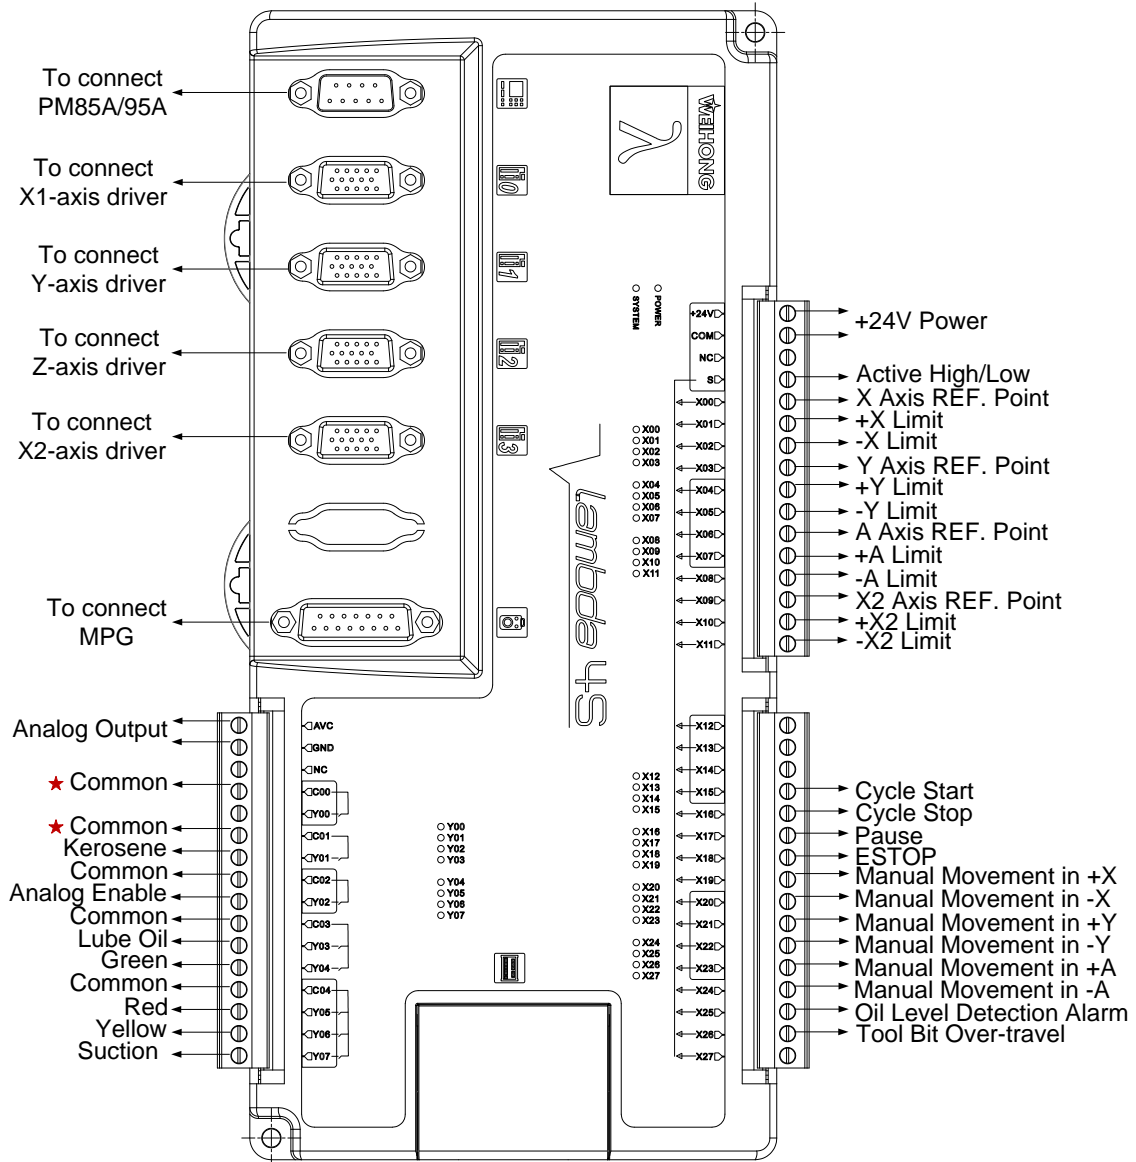


Fig. 2-9 Connection according to X1YAX2 configuration

The extended terminal board EX27A3 (118mm*83mm*56.45mm) is required in X1YAX2 configuration. See Fig. 2-10 for the I/O definition and wiring diagram.

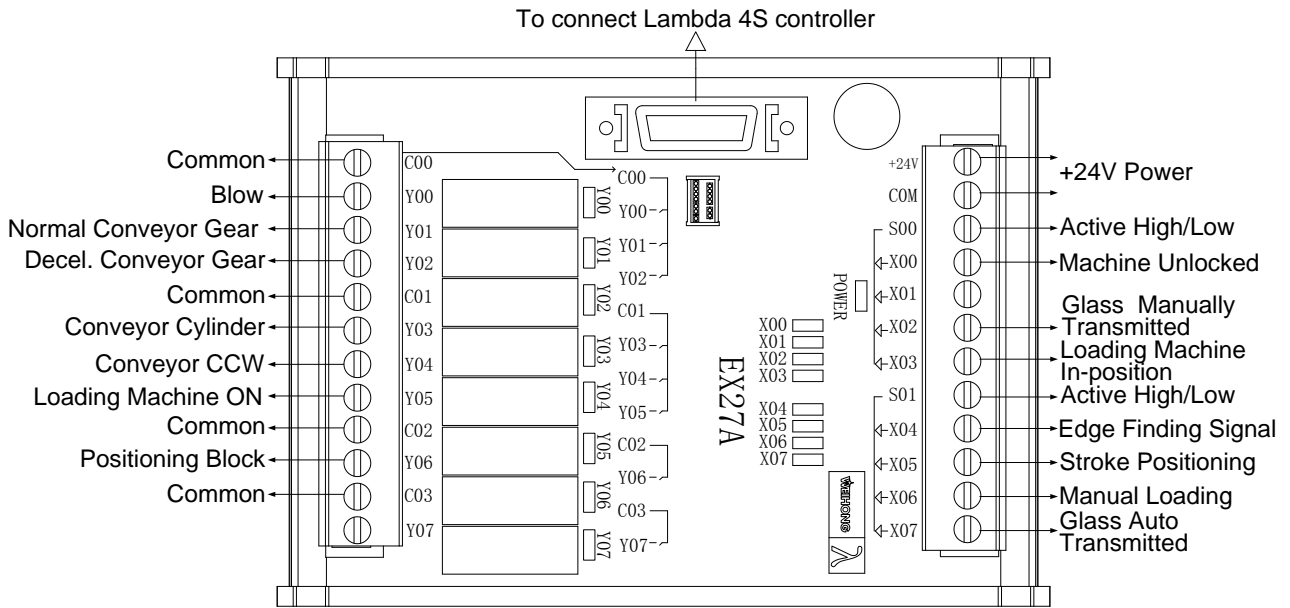


Fig. 2-10 Wiring example of EX27A3 according to X1YAX2 configuration

◆ XYA No Edge Config

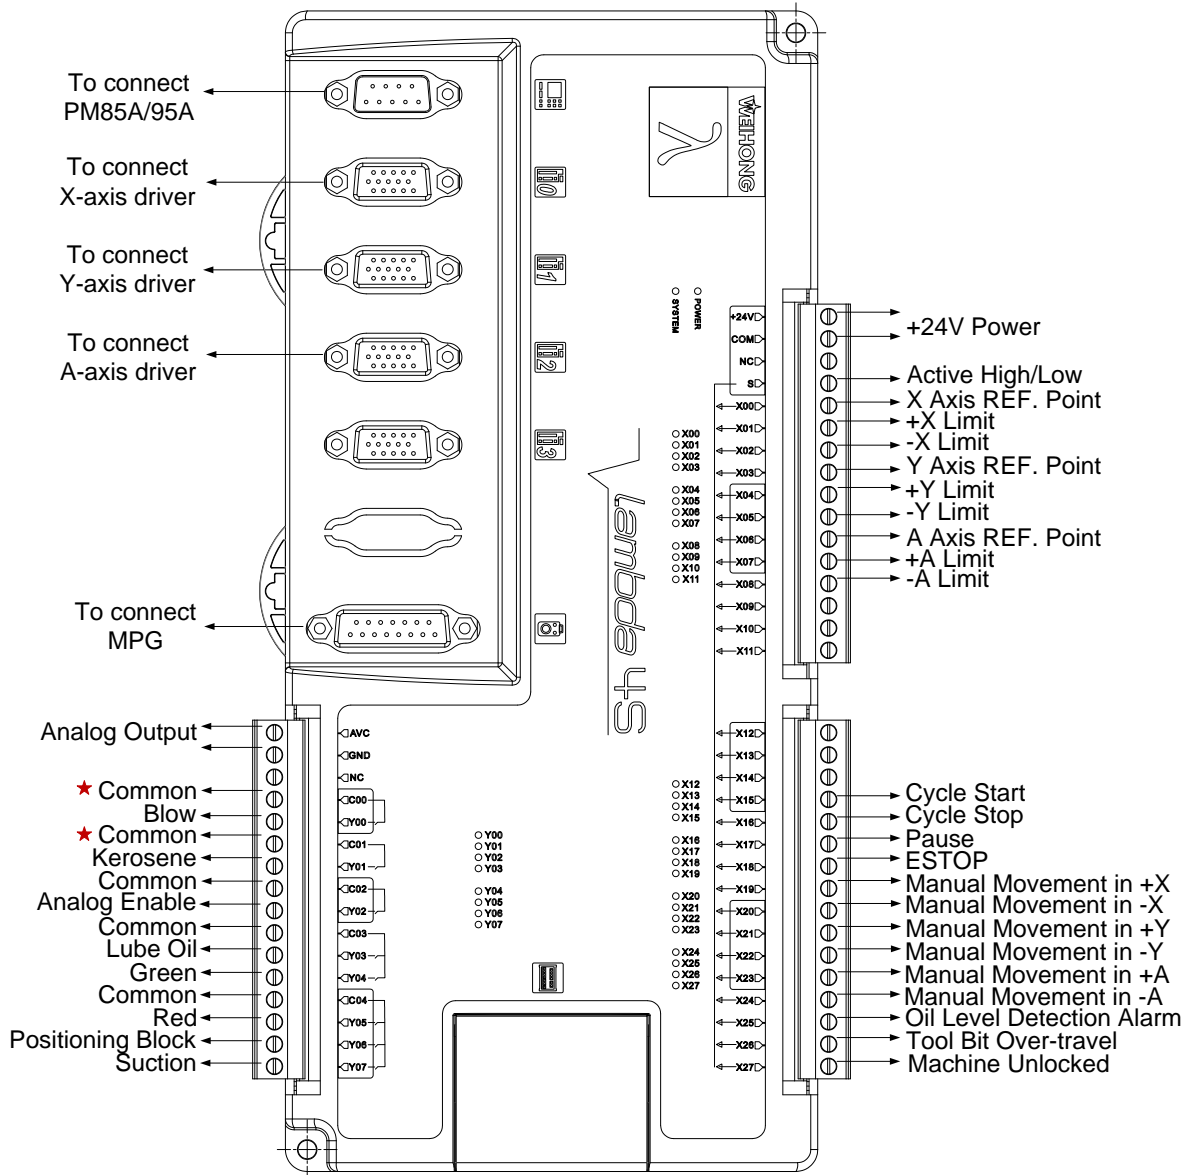


Fig. 2-11 Connection according to XYA no edge configuration



Extended terminal board EX27A is not required if XYA no edge configuration is selected.

◆ XYZA Config

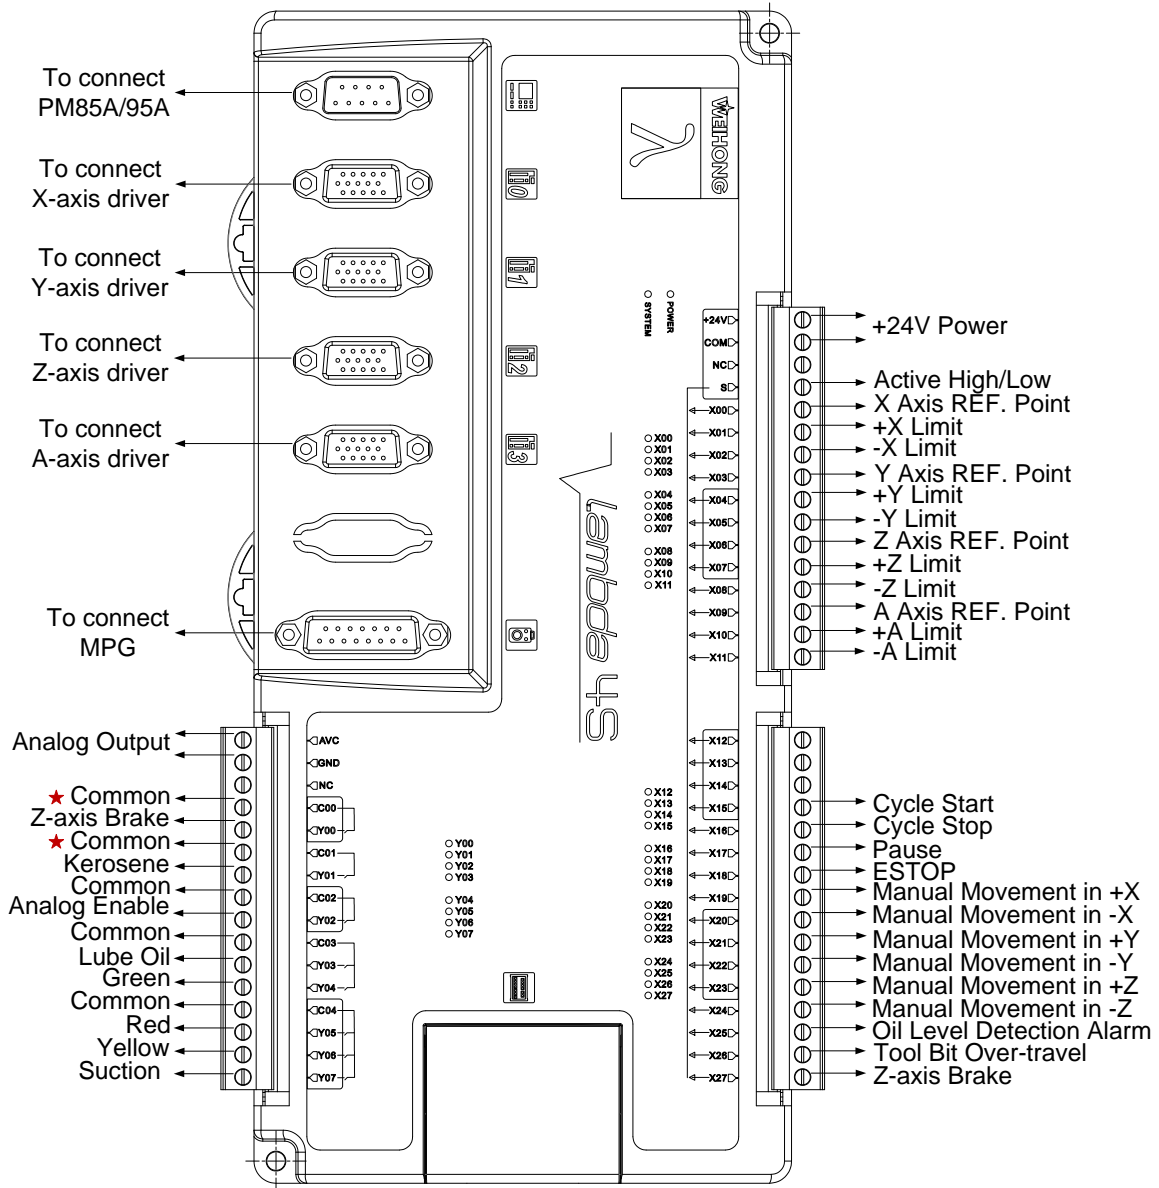


Fig. 2-12 Connection according to XYZA no edge configuration



Extended terminal board EX27A is not required if XYZA no edge configuration is selected.

2.2.3 Waterjet Cutting

For four and five axes waterjet cutting machines, Lambda 5S controller and extended terminal board EX31A are required.

Four axes waterjet cutting software includes four configurations—XYC, XY1CY2, XYZC and XY1ZCY2.

◆ **XYC Configuration**

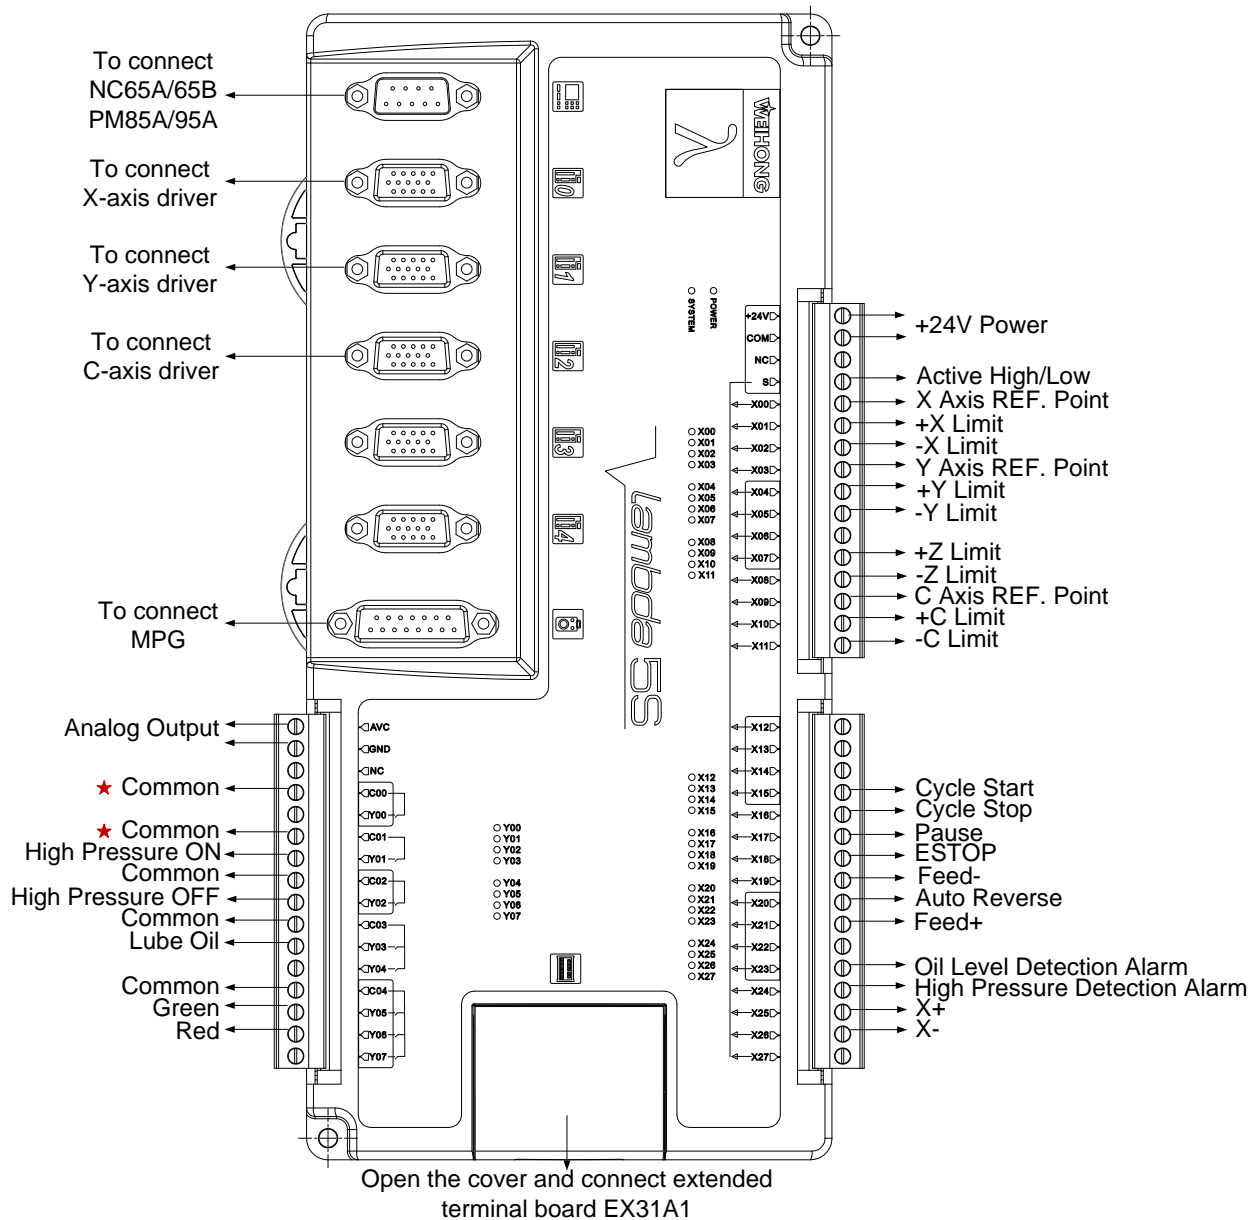


Fig. 2-13 Connection according to XYC configuration

The extended terminal board EX31A1 (153mm*118mm*56.45mm) is required in XYC configuration, with wiring as shown in Fig. 2-14.


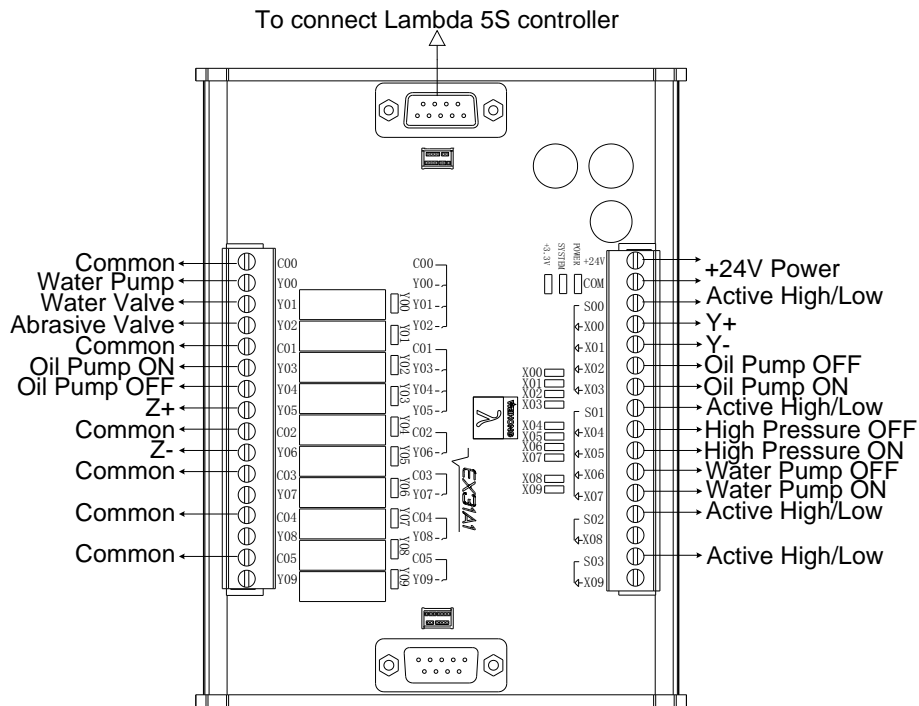


Fig. 2-14 Wiring of EX31A1 according to XYC configuration



For terminal board EX31A1, C00 is the common of Y00, Y01 and Y02, C01 the common of Y03, Y04 and Y05, C02 the common of Y06, C03 the common of Y07, C04 the common of Y08, and C05 the common of Y09.

◆ XY1CY2 Configuration

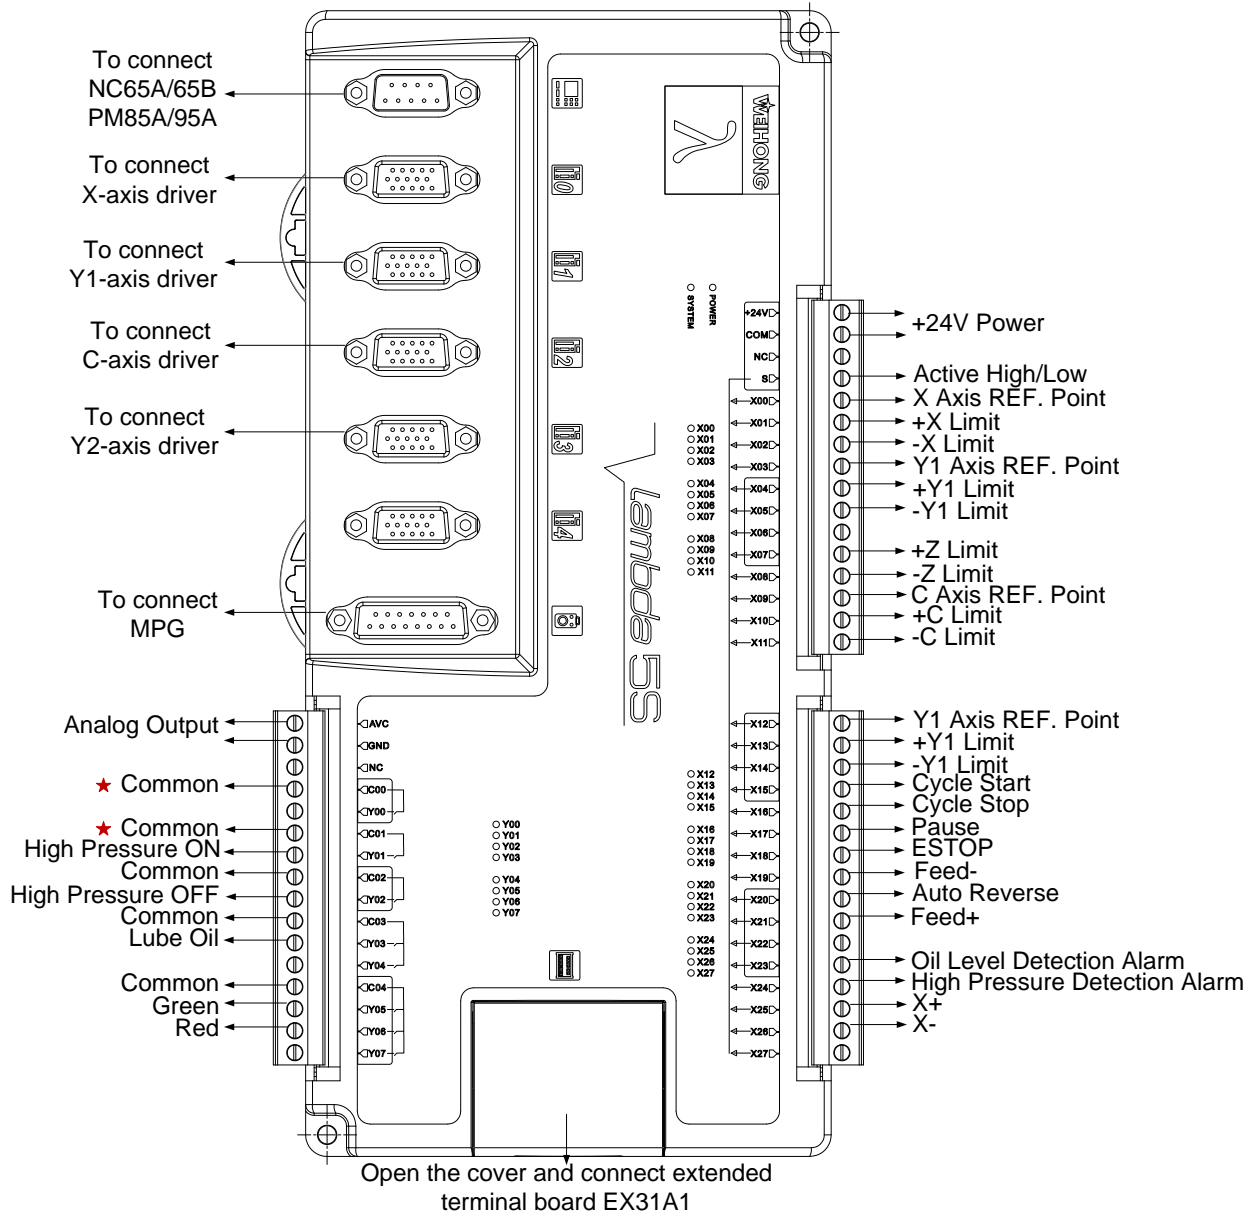

The extended terminal board EX31A1 (153mm*118mm*56.45mm) is required in XY1CY2 configuration, with wiring as shown in Fig. 2-16.

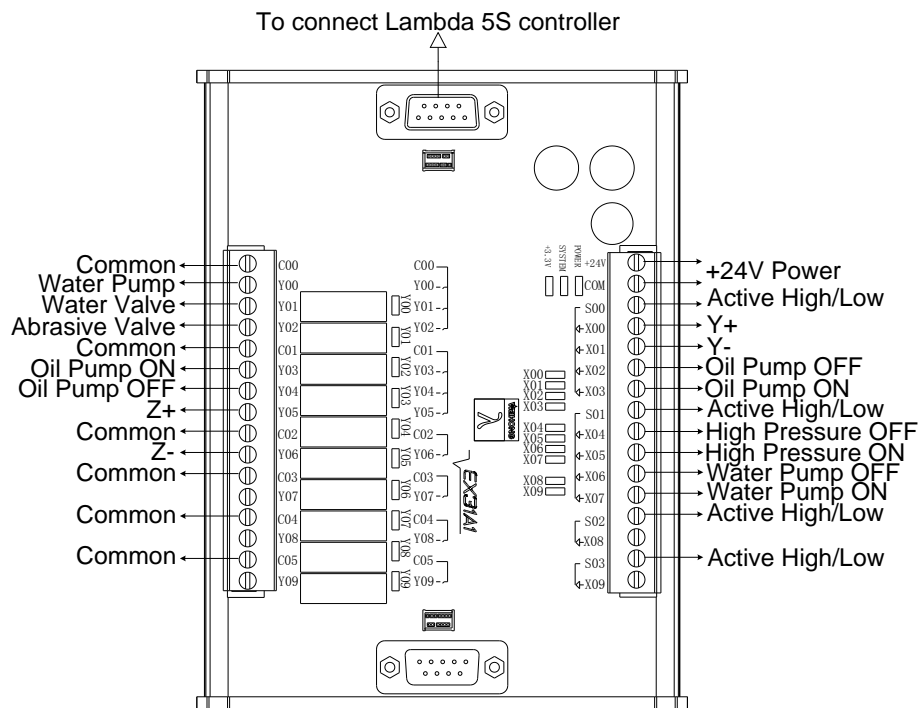


Fig. 2-16 Wiring of EX31A1 according to XY1CY2 configuration

◆ XYZC Configuration

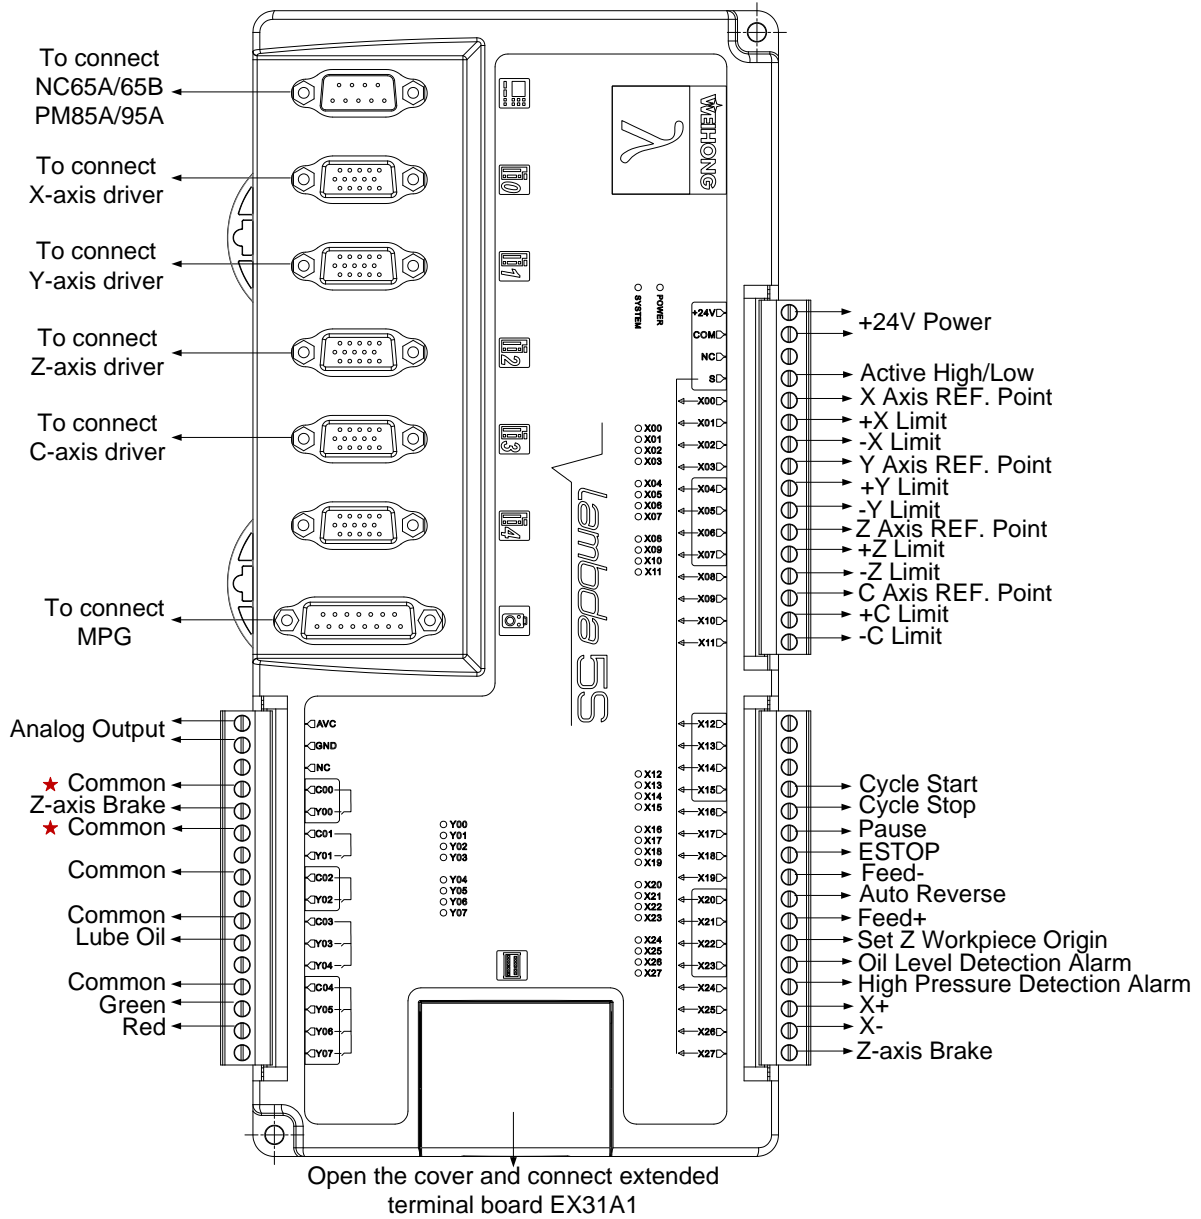


Fig. 2-17 Connection according to XYZC configuration

Two pieces of extended terminal board EX31A1 (153mm*118mm*56.45mm) are required in XYZC configuration, with wiring as shown in Fig. 2-18.

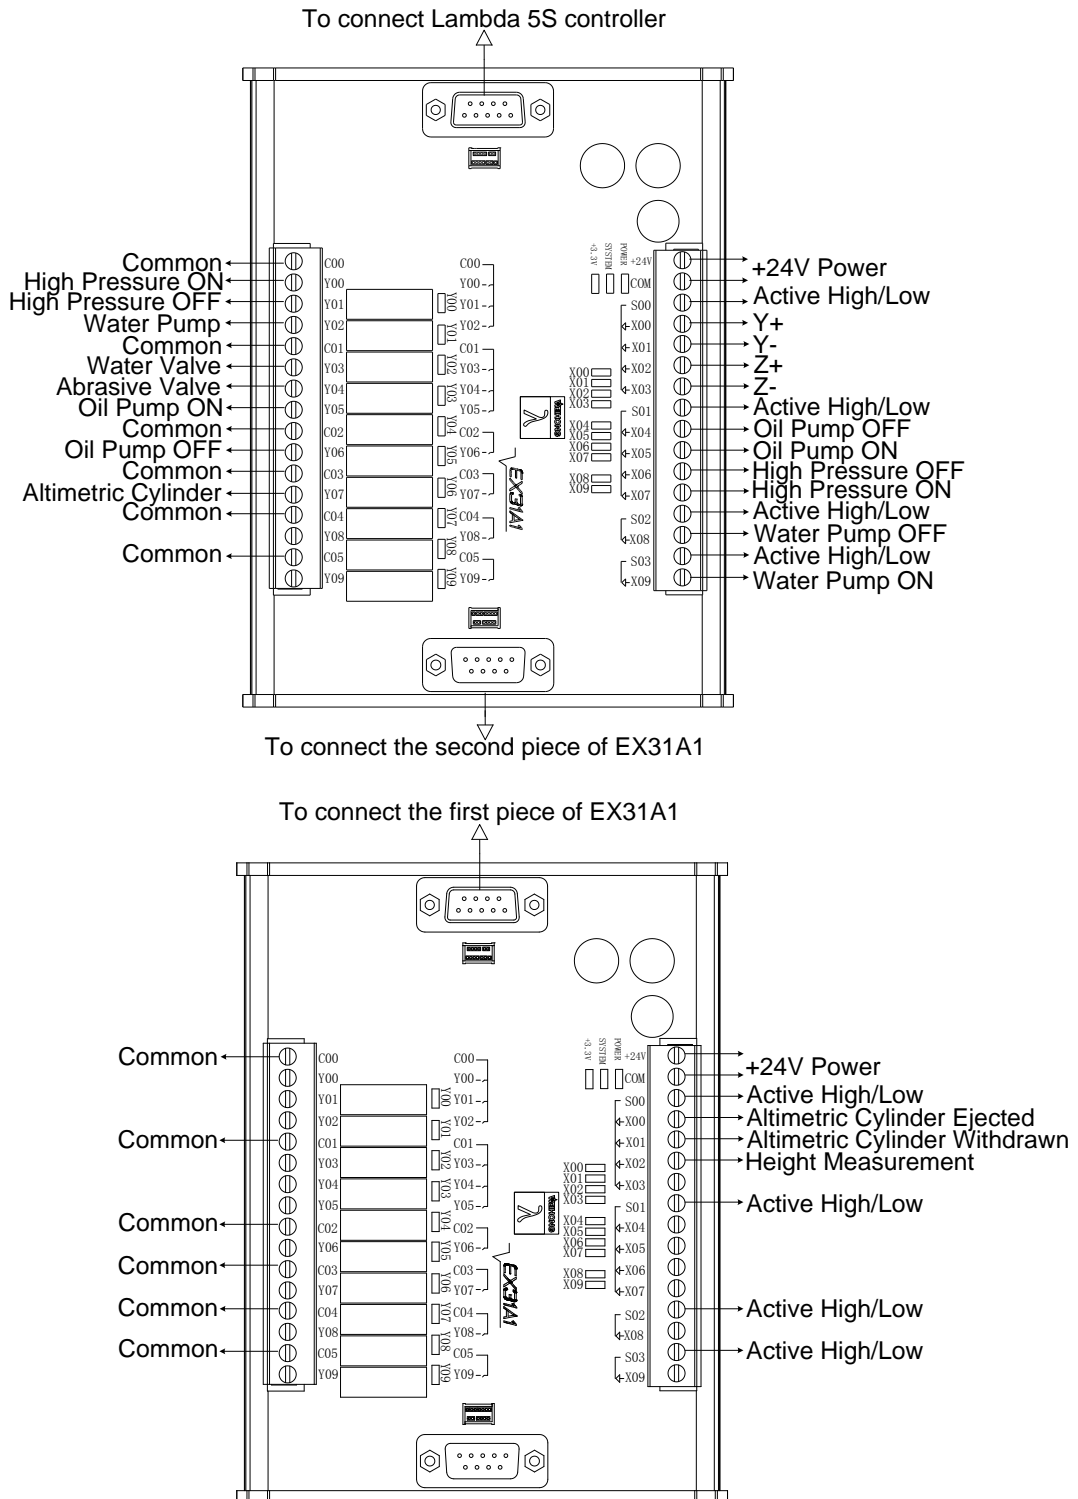


Fig. 2-18 Wiring of EX31A1 according to XYZC configuration



Only one piece of EX31A1 is enough if height measurement function is not needed.

◆ XY1ZCY2 Configuration

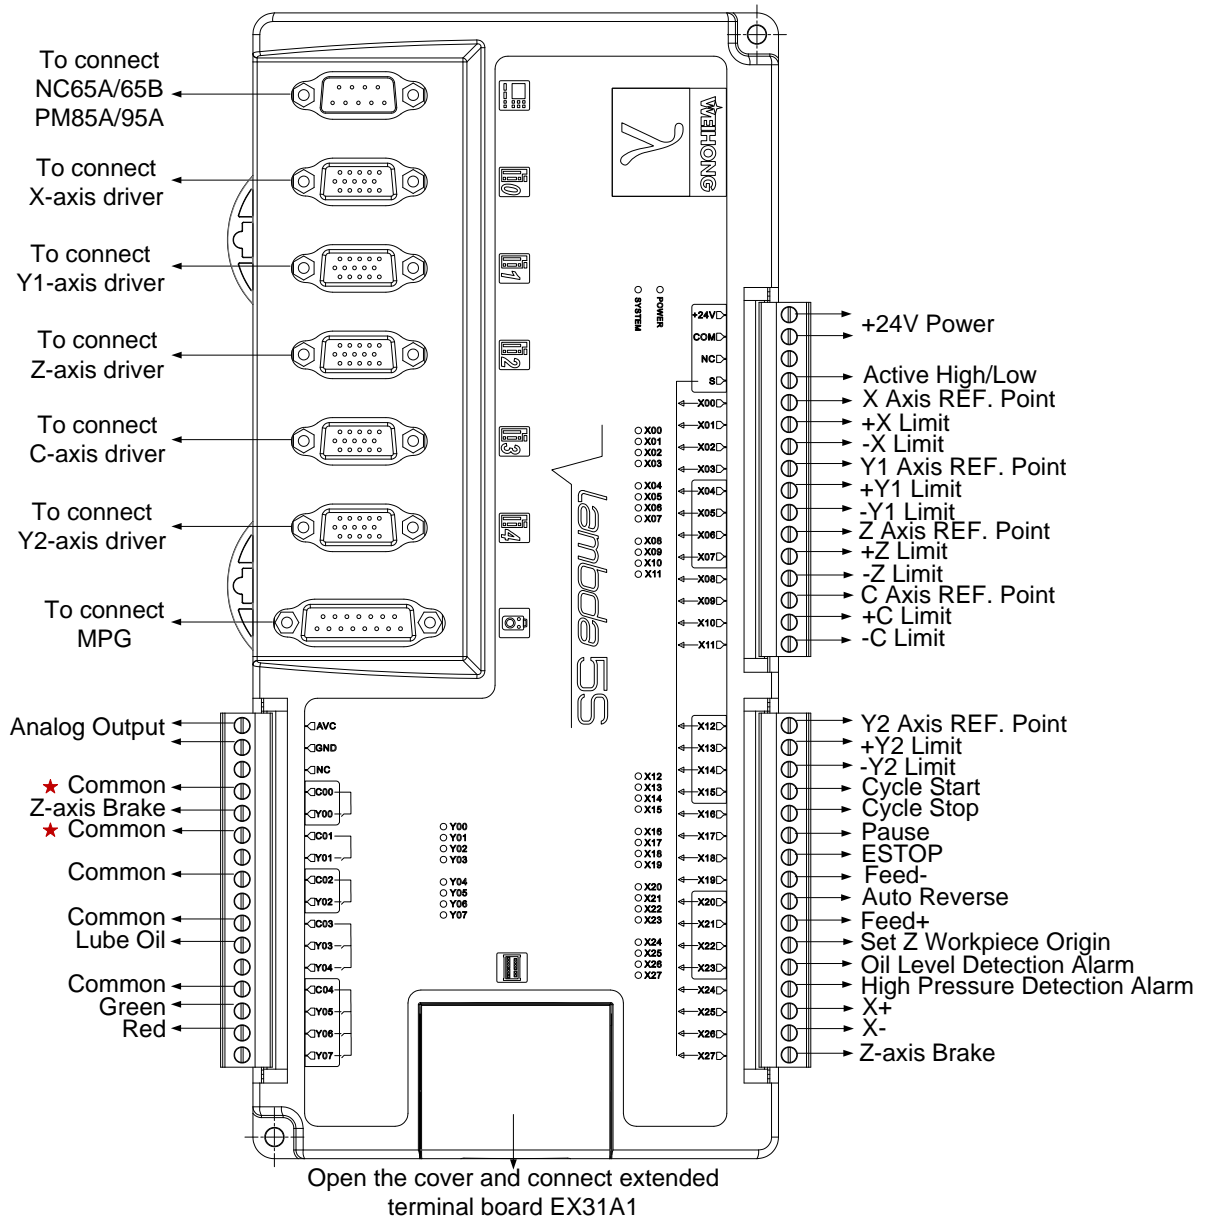


Fig. 2-19 Connection according to XY1ZCY2 configuration

Two pieces of extended terminal board EX31A1 (153mm*118mm*56.45mm) are required in XY1ZCY2 configuration, with wiring as shown in Fig. 2-20.

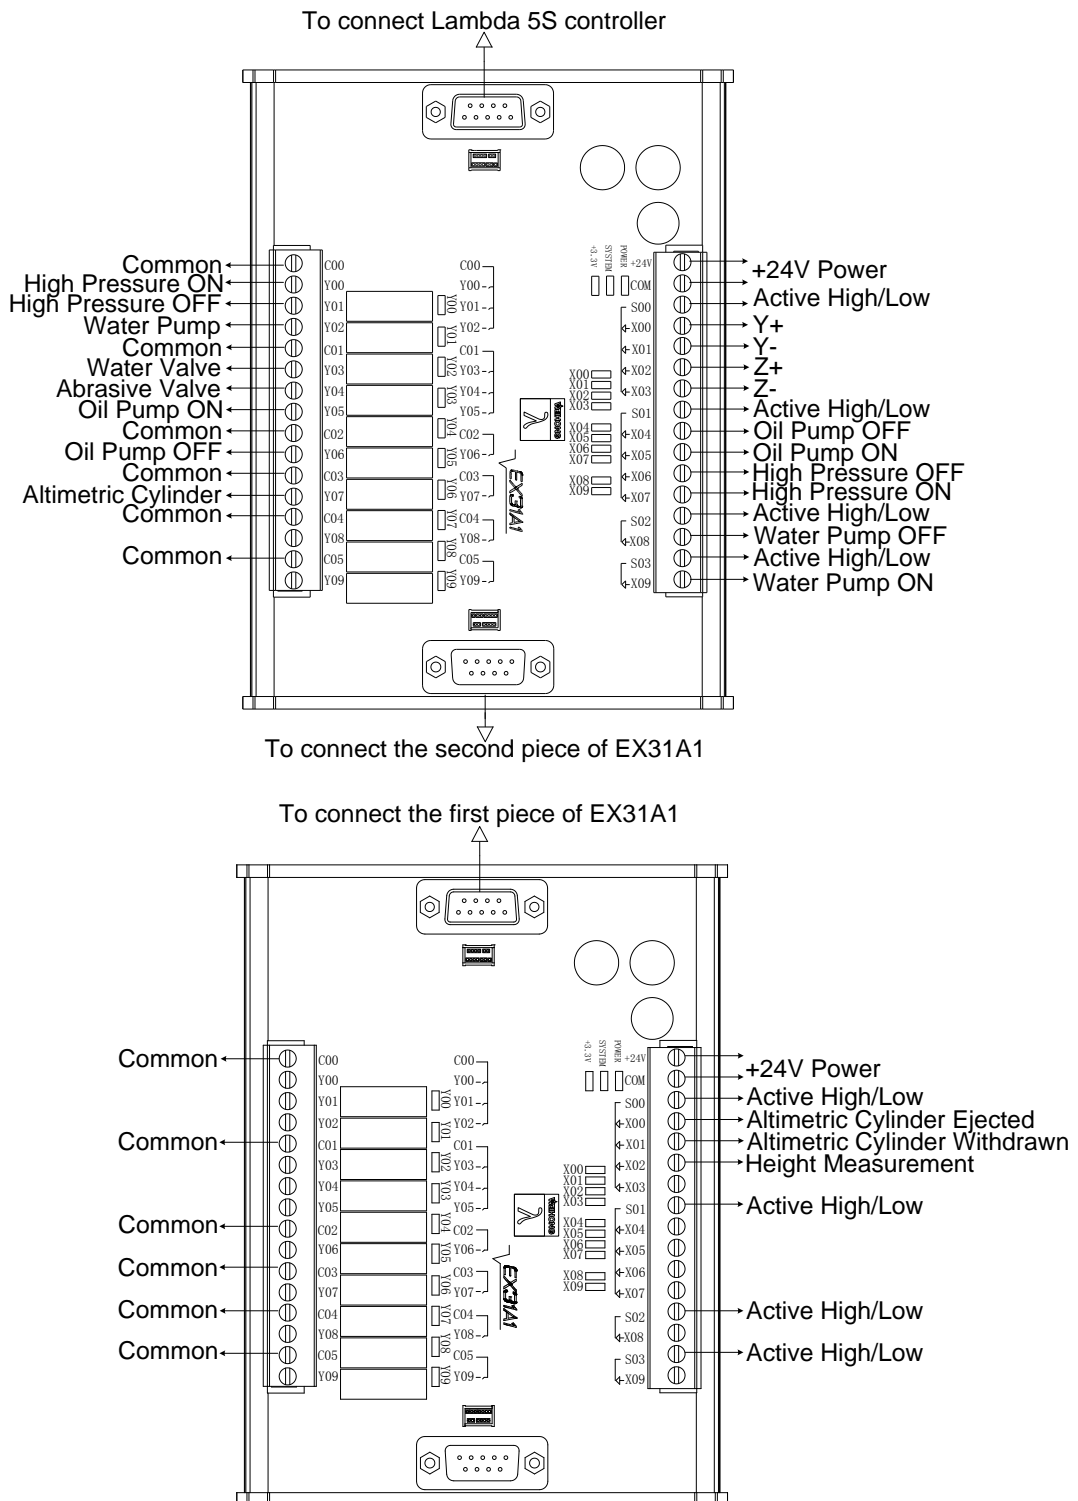


Fig. 2-20 Wiring of EX31A1 according to XY1ZCY2 configuration



Only one piece of EX31A1 is enough if height measurement function is not needed.

Currently, five axes waterjet cutting software includes two configurations—StandA with 2Y configuration and StdA configuration, both used for controlling AB-type machine tools.

◆ StadA with 2Y Configuration

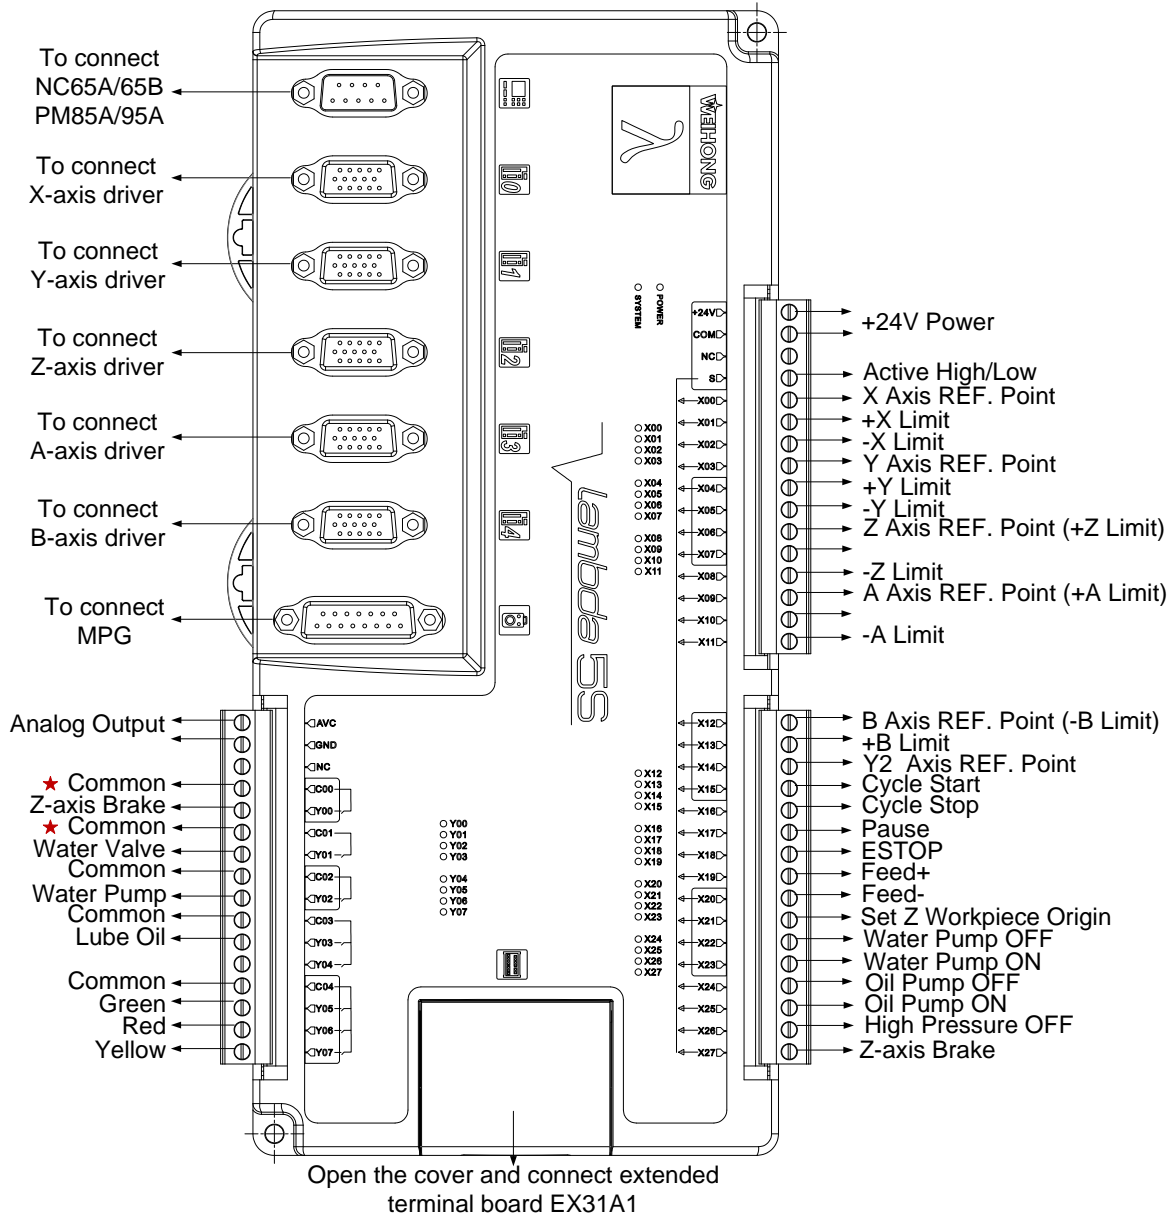


Fig. 2-21 Connection according to StadA with 2Y configuration



- 1) The REF. point and positive limit of Z axis share the same port, so do the REF. point and positive limit of A axis, while the REF. point and negative limit of B axis share the same port.
- 2) The wiring according to StdA configuration is the same as that according to StdA with 2Y configuration, except that the input port X14 is reserved for use instead of being defined as the Y2-axis REF. point. The Y2 axis in dual Y configuration is controlled by pulses.

Two pieces of extended terminal board EX31A1 (153mm*118mm*56.45mm) are required according to five axes waterjet cutting software, with wiring as shown in Fig. 2-22.

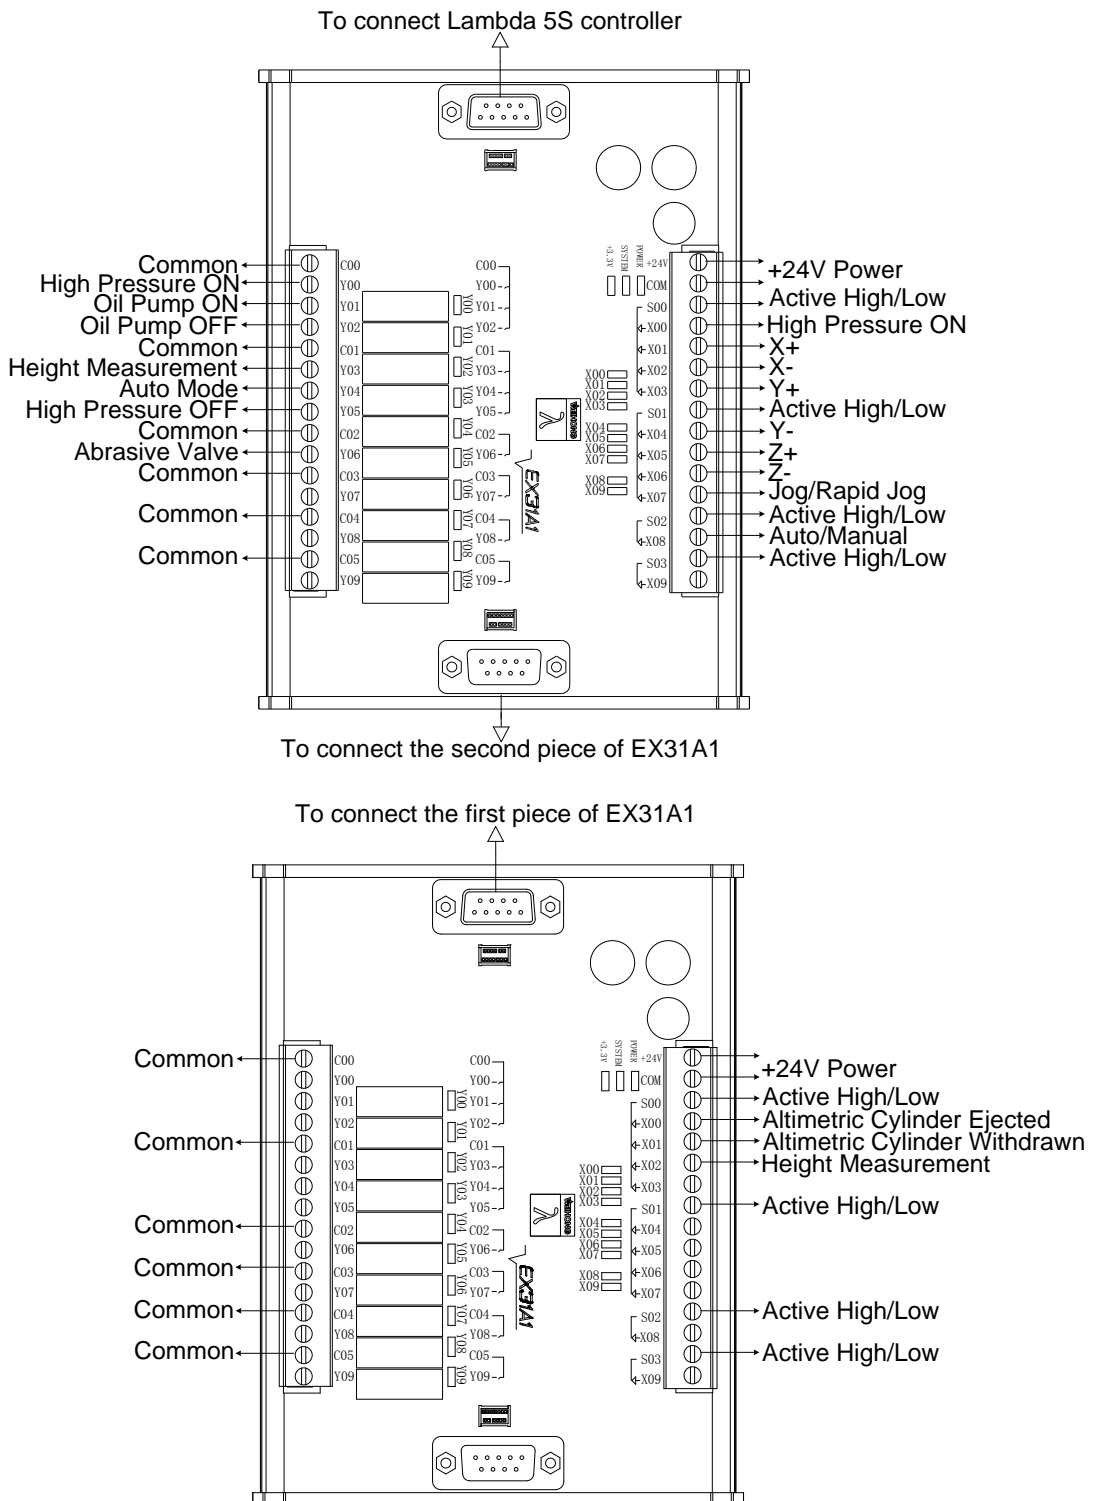


Fig. 2-22 Wiring of EX31A1 according to XY1ZCY2 configuration



Only one piece of EX31A1 is enough if height measurement function is not needed.

2.2.4 Three Axes Laser Cutting

When used together with three axes laser cutting software, Lambda 5S controller should be wired according to Fig. 2-23 in dual Y configuration.


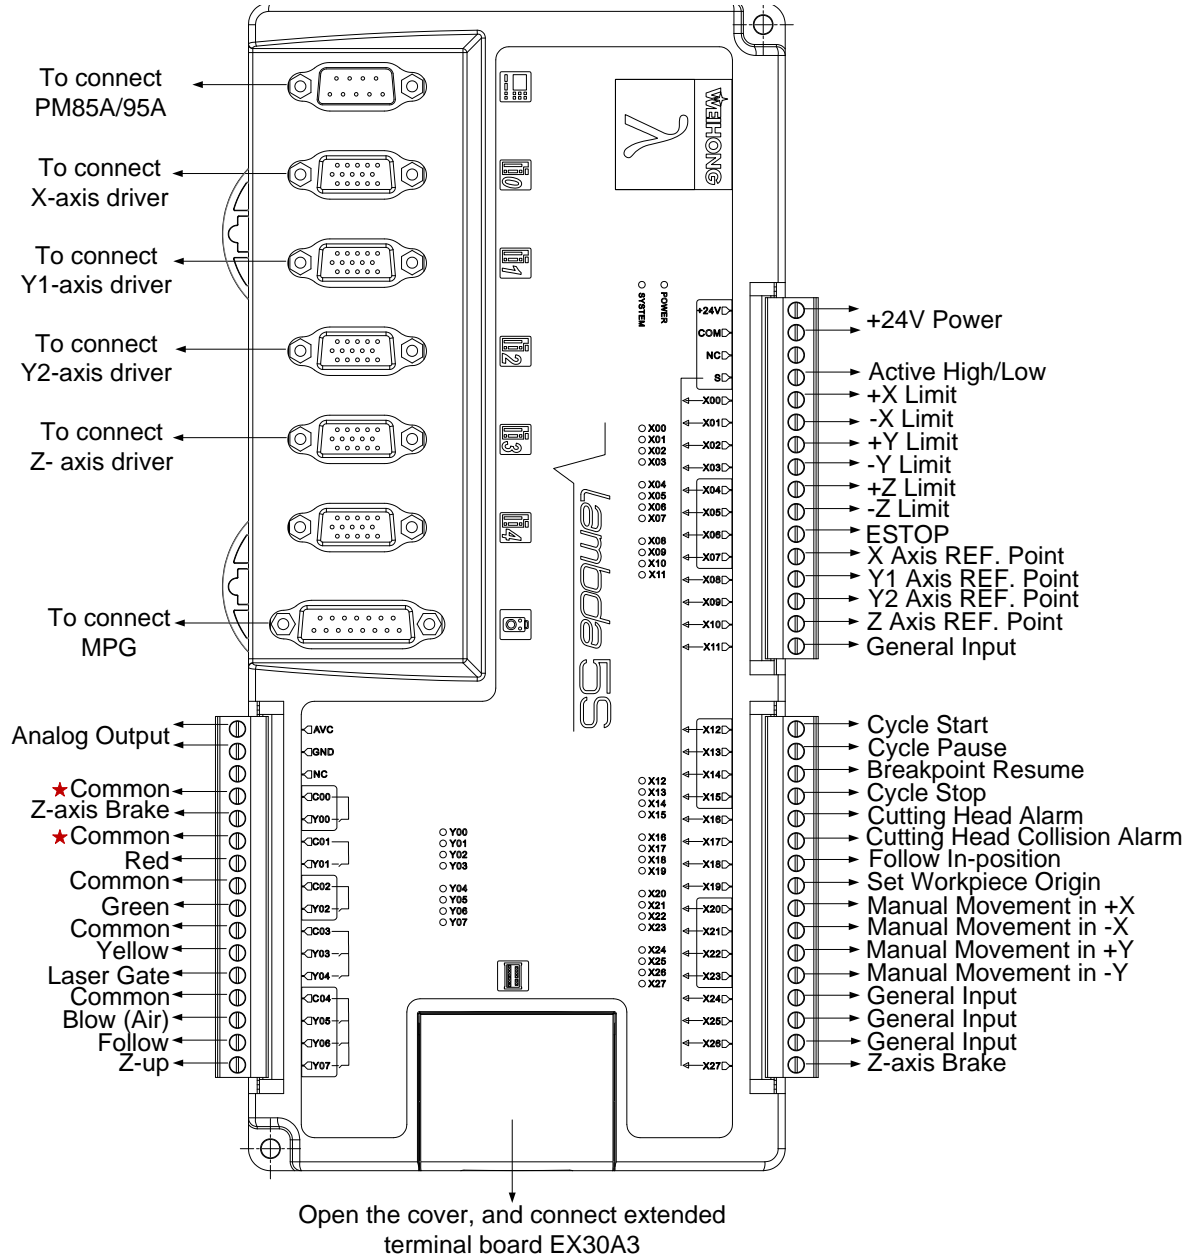


Fig. 2-23 Connection according to doubleY configuration

 

The software consists of singleY configuration and doubleY configuration. The wiring of singleY configuration is the same as that of doubleY configuration, except for two differences:

- 1) In singleY configuration, only X, Y and Z axes should be connected to the first three axes driver interfaces.
- 2) In singleY configuration, X08 is defined as Y-axis REF. point and X09 general input.

Extended terminal board EX30A3 (175mm*118mm*56.5mm) is required in laser cutting, with wiring diagram as shown in Fig. 2-24.

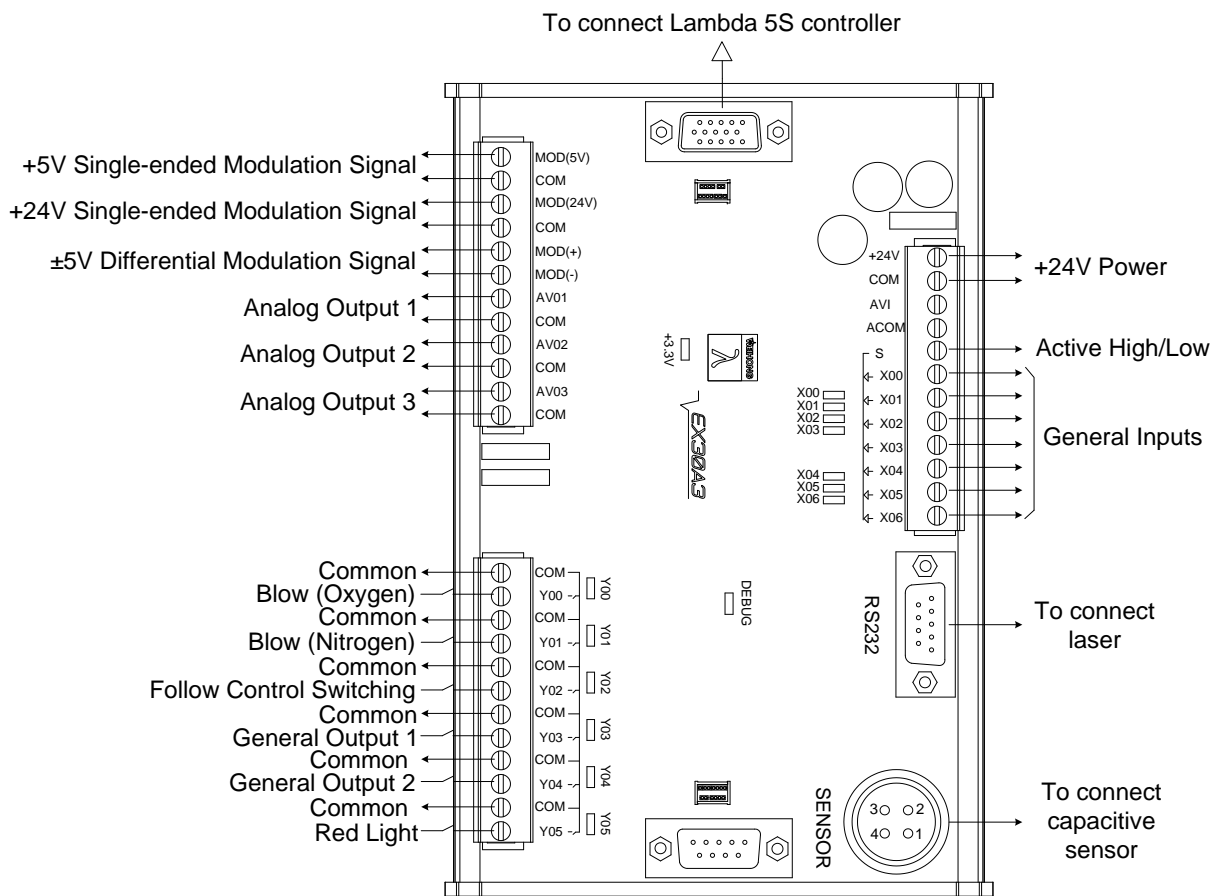


Fig. 2-24 Connection of EX30A3 according to laser cutting software



- 1) The outputs of extended terminal board EX30A3 are Darlington outputs, and their load current should be $\leq 0.4A$.
- 2) Outputs Y00~Y05 should be connected to relays.

2.2.5 Dual Z Axes

When used together with dual Z axes software, Lambda 4S controller should be wired according to Fig. 2-25.

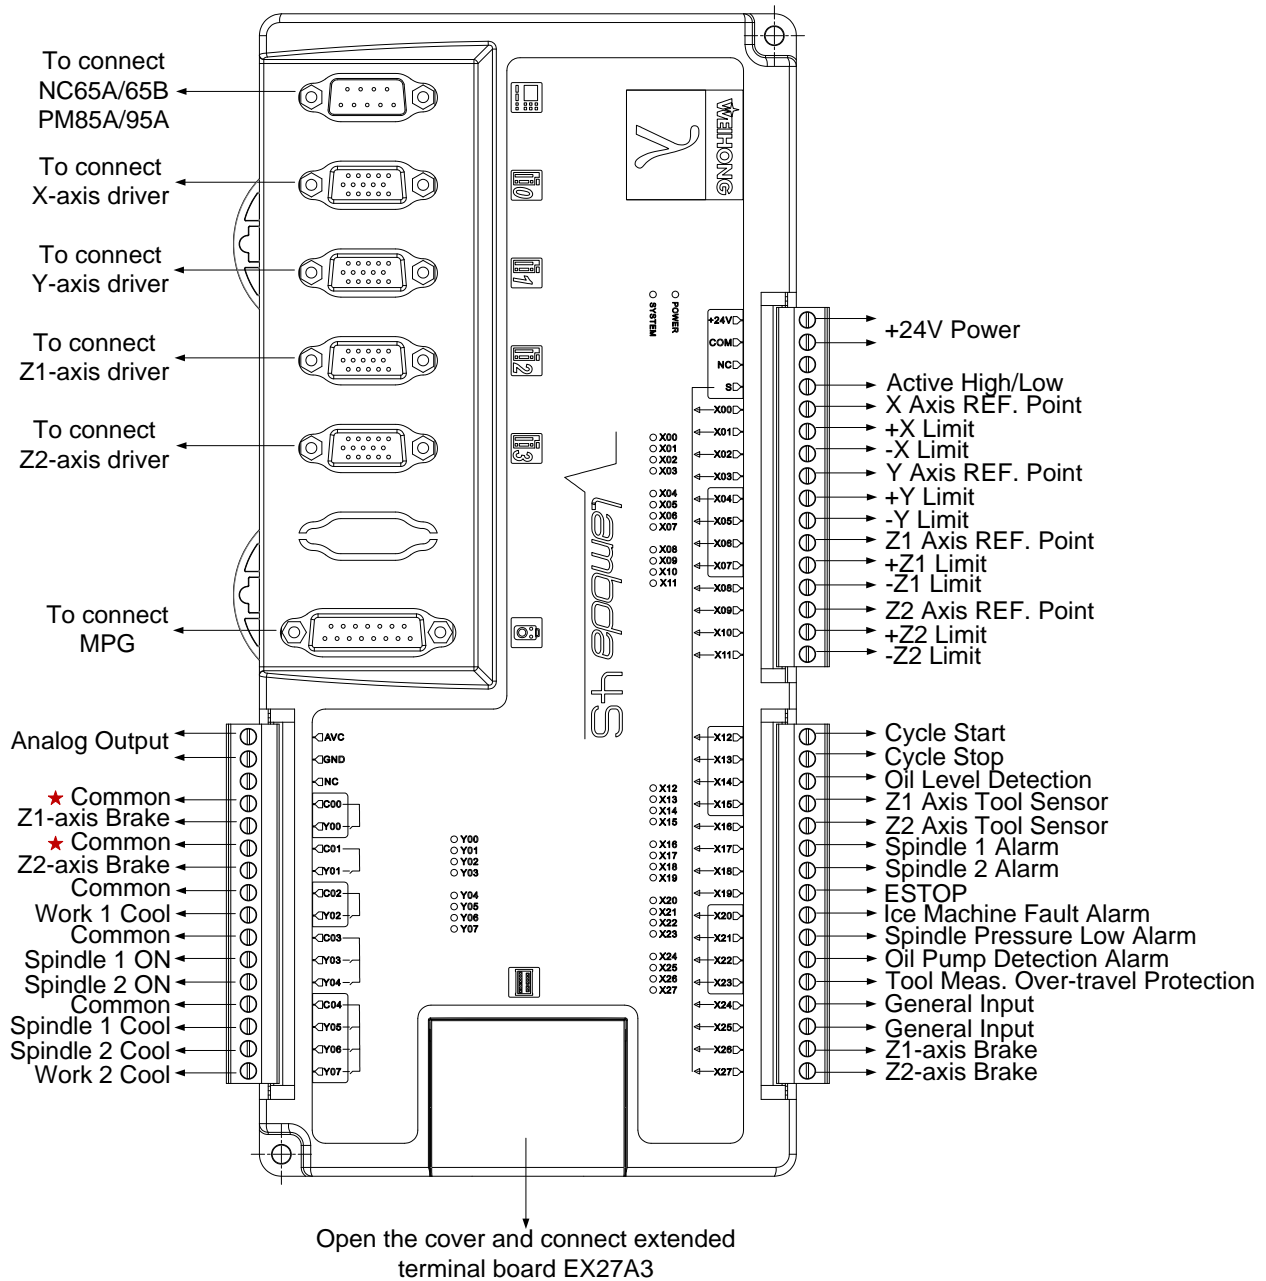


Fig. 2-25 Connection according to dual Z axes software

Extended terminal board EX27A3 (118mm*83mm*56.45mm) is required in dual Z axes, with wiring diagram as shown in Fig. 2-26.


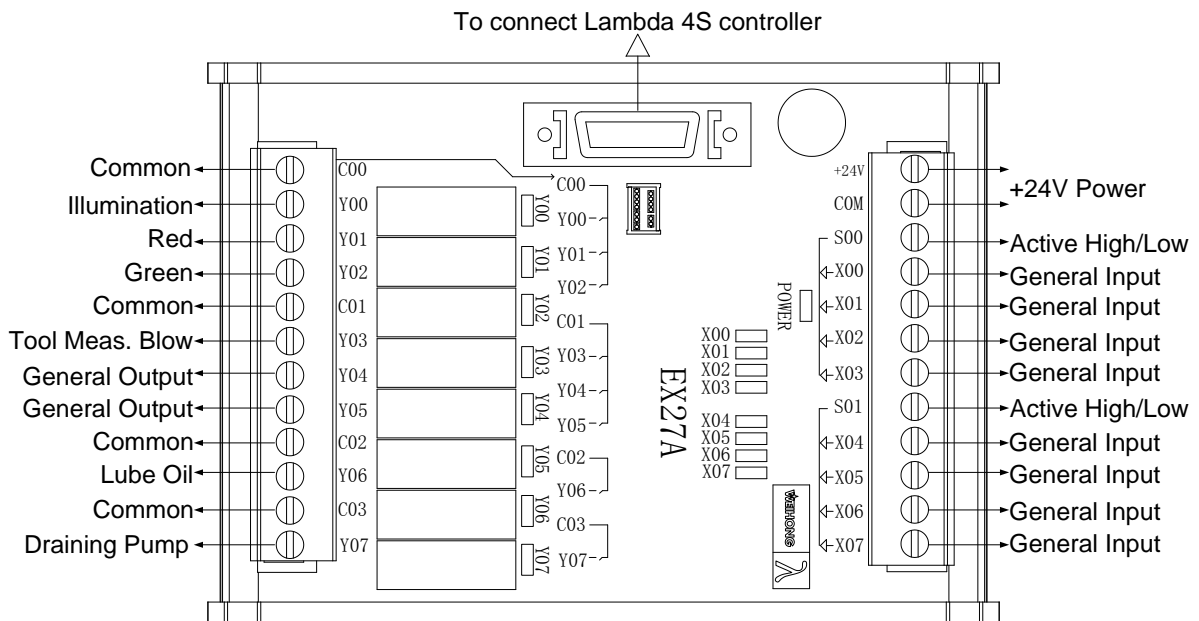


Fig. 2-26 Wiring of EX27A3 in dual Z axes

 

Dual Z axes software for general purpose includes two configurations—Z1Z2 configuration and turn configuration (alternative configuration), whose wirings are totally the same.

2.2.6 Three Z Axes

When used together with three Z axes software, Lambda 5S controller should be wired according to Fig. 2-27.

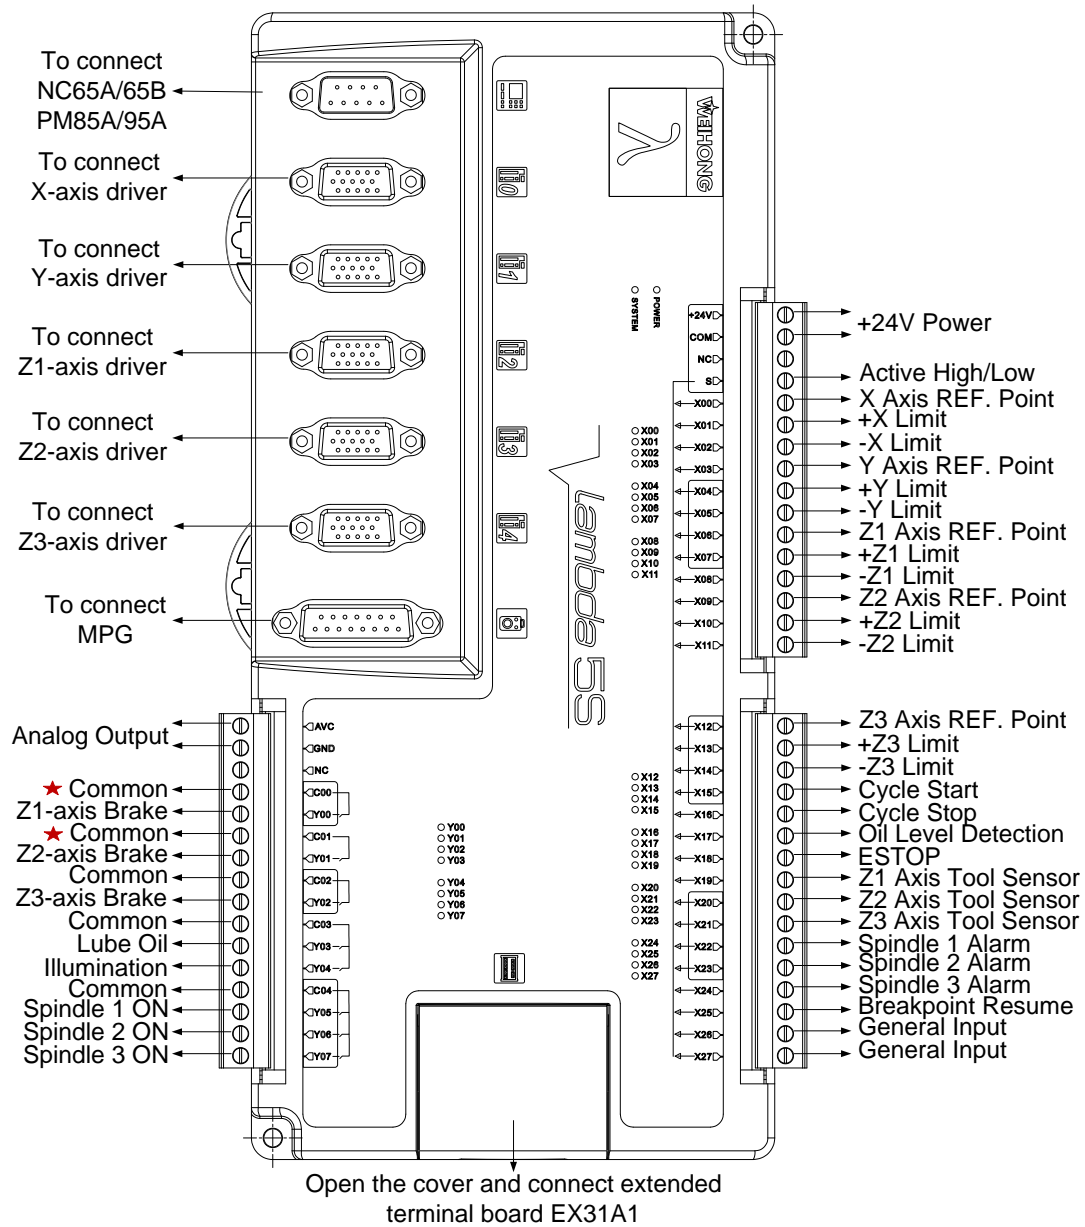


Fig. 2-27 Connection according to three Z axes software

Extended terminal board EX31A1 (153mm*118mm*56.45mm) is required in three Z axes, with wiring diagram as shown in Fig. 2-28.

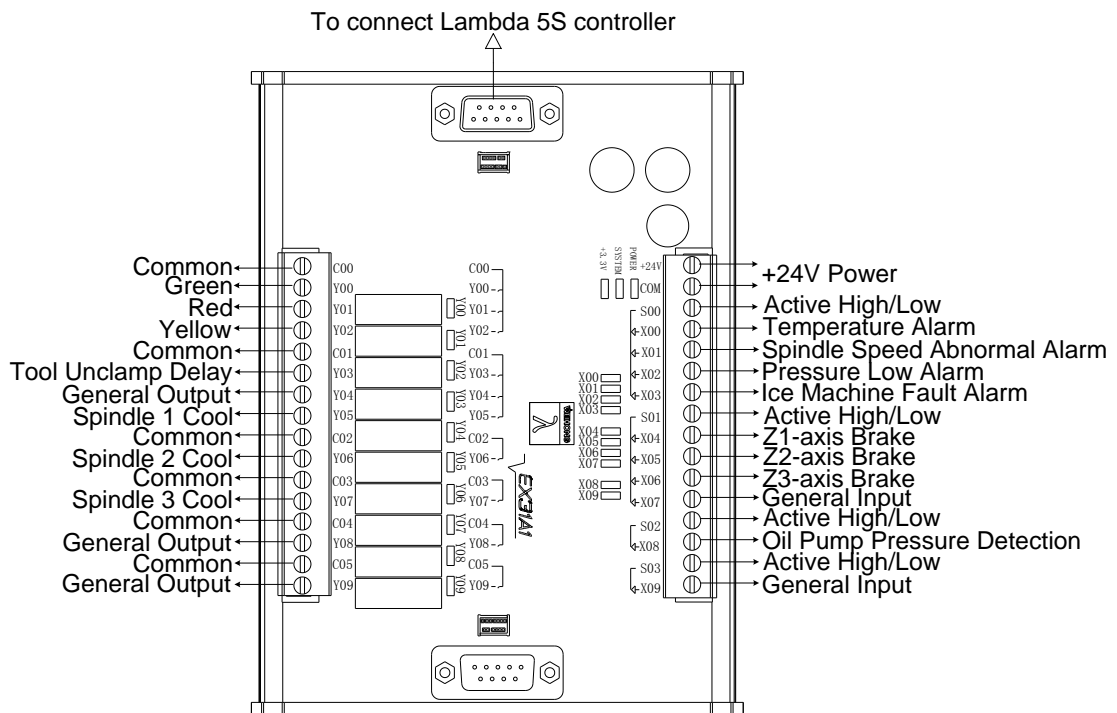


Fig. 2-28 Wiring of EX31A1 according to three Z axes software

2.3 Driver Interface

2.3.1 Lambda 3S/3L Series Controller

Lambda 3S/3L series controller provides 3 pulse feed driver interfaces for X/Y/Z axis. The 3 interfaces are 15-pin D-type sockets, and the pins definition is as shown in Fig. 2-29.

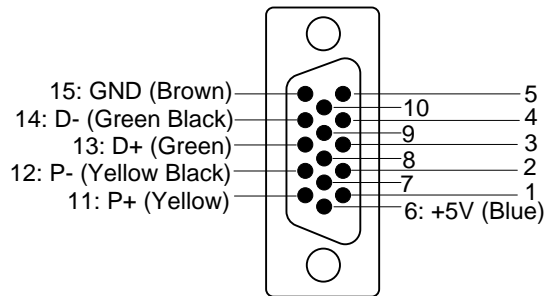


Fig. 2-29 Definition of driver interface

Only 6 of the pins should be wired when connected with a stepping driver, and the 6 wires at one end of DB15 provided by WEIHONG are distinguished by colors. You just need to connect the wires according to the colors shown in the above picture.

+5V, GND: supplying 5VDC power to a stepping driver;

P+, P-: pulse (PULS), differential output signals;

D+, D-: direction (DIR), differential output signals.

2.3.2 Lambda 4S/5S Series Controller

Lambda 4S/5S series controller provides up to 5 pulse feed driver interfaces for X/Y/Z/the fourth/the fifth axis. The 5 interfaces are 15-pin D-type sockets, and the pins definition is as shown in Fig. 2-30.

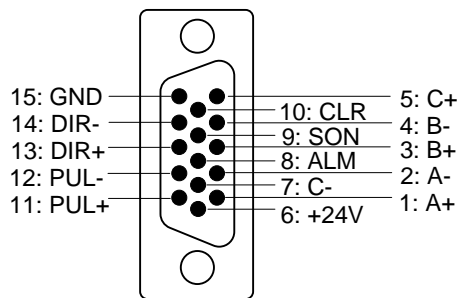


Fig. 2-30 Definition of driver interface

◆ Servo Driver Interface Definition

Name	Definition	Input /Output	Description
A+, A-	Feedback signal of encoder phase A	Input, differential signal transmission mode	Receive the differential output from encoder signal (phase A, B, C) of driver frequency divider (equaling to
B+, B-	Feedback signal of	Input, differential signal	

Name	Definition	Input /Output	Description
	encoder phase B	transmission mode	RS422).
C+, C-	Feedback signal of encoder phase C	Input, differential signal transmission mode	
ALM	Driver alarm signal	Input	When breakdown occurs in driver, the output (transistor) will be disconnected.
SON	Servo ON signal	Output	This signal is used for opening (power on) and closing (power off) servo motor. When this signal is connected to COM-, dynamic brake will be released and thus the driver is allowed to work (servo enabled).
CLR	Driver alarm clear signal	Output	This signal is used for alarm/warning status clear, and can only remove the alarms that can be removed.
PUL+, PUL-	Pulse output	Output, differential signal transmission mode	
DIR+, DIR-	Direction output	Output, differential signal transmission mode	
+24V, GND	DC 24V power	Output	Connected to driver



SON signal will be effective at 2 seconds after connecting of power supply. Don't try to drive the motor through external servo ON or servo OFF drive signal at any time, since the system controls the power-up state of the servo motor.

2.4 MPG Interface

Lambda CNC system has a MPG (or called handwheel) interface for connecting with a handwheel up to 6 axes. You can buy MPGs from WEIHONG, or from other companies.

Our MPG interface is composed of dual-in line DB15 holes, and its pins definition is as shown in Fig. 2-31.

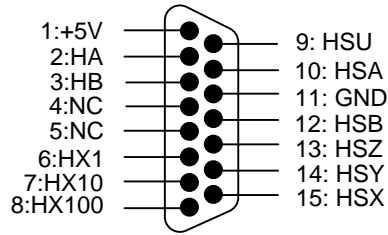


Fig. 2-31 Pins definition of MPG interface

◆ **Definition of MPG interface**

Pins No.	Function	Description
1	+5V	Power on handwheel
2	HA	Encoder phase A signal
3	HB	Encoder phase B signal
4	NC	
5	NC	
6	X1	X1 override
7	X10	X10 override
8	X100	X100 override
9	HSU	Selection of the fourth axis
10	HSA	Selection of the fifth axis
11	GND	Digital ground
12	HSB	Selection of the sixth axis
13	HSZ	Selection of Z-axis
14	HSY	Selection of Y-axis
15	HSX	Selection of X-axis

2.5 Extended Terminal Board Interface

The extended terminal board interface type of Lambda 4S controller is non-cascade connection type, while that of Lambda 5S controller is cascade connection type.

2.5.1 Cascade Connection

For cascade connection type, Lambda 5S controller should be connected with terminal board EX31A. N and P in Fig. 2-32 are the negative and positive polarities of two groups of differential signal respectively.

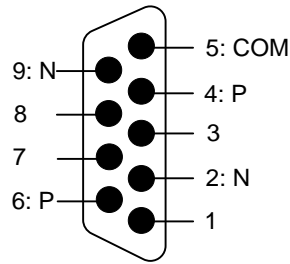


Fig. 2-32 Cascade connection type extended terminal board interface

2.5.2 Non-cascade Connection

For non-cascade connection type, Lambda 4S controller should be connected with terminal board EX27A. See Fig. 2-33 for pin connection to EX27A.

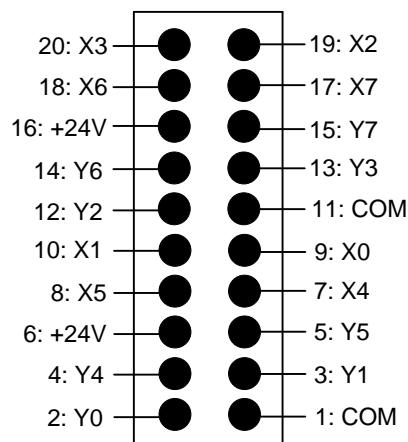


Fig. 2-33 Non-cascade connection type extended terminal board interface

2.6 Signal Types

2.6.1 Binary Input Signal

Binary input signals can be active low or active high. See Fig. 2-34. When S is connected to COM, inputs are active high, when to +24V, active low.

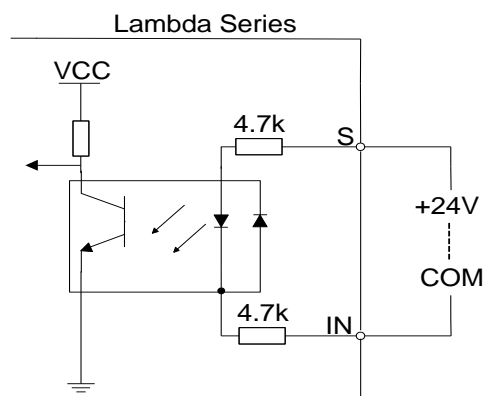


Fig. 2-34 Binary input connecting with mechanical switch

2.6.2 Relay Output Signal

The relay output contact points on the Lambda series controller have load capacity: 7A/250VAC and 7A/30VDC. If high power load is needed, a contactor can be used. See Fig. 2-35.

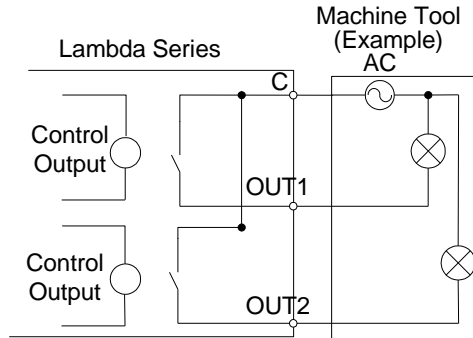


Fig. 2-35 Connection of relay output with contactor

2.6.3 Servo Enable Signal

This signal is used to activate (power on) and close (non-power on) servo motor. See Fig. 2-36.

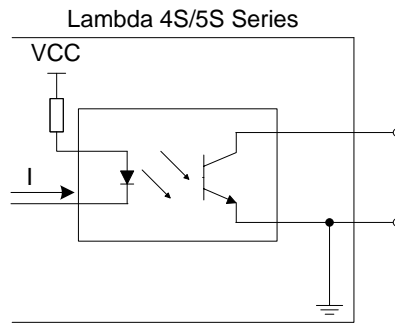


Fig. 2-36 Output circuit of servo enable signal

2.6.4 Encoder Signal

Servo interface receives differential output of encoder signal (phase A, B and C) from the frequency divider (equaling to RS422) of the driver. See Fig. 2-37.

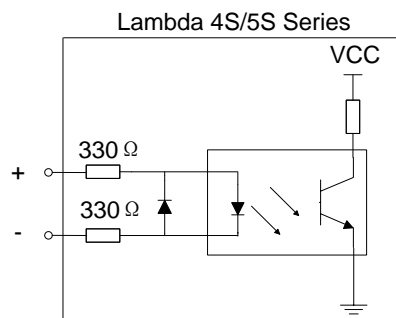


Fig. 2-37 Input circuit of encoder signal

2.6.5 Command Pulse Signal

Pulse command format to control driver motion is “pulse + direction, negative logic”. Its maximum pulse frequency is 1MHZ and the pulse mode is as shown in Fig. 2-38.

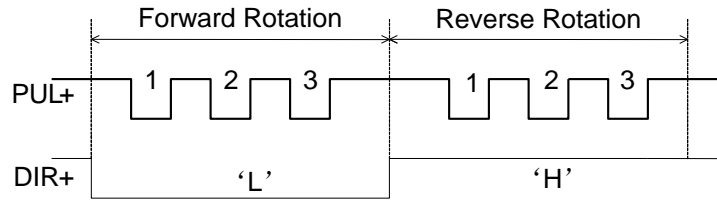


Fig. 2-38 Output type of pulse command

The output circuit of pulse command is as shown in Fig. 2-39.

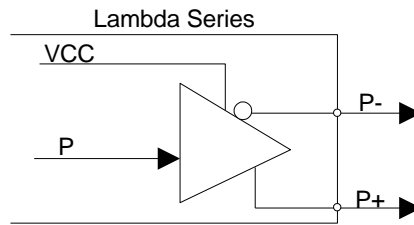


Fig. 2-39 Output circuit of pulse command

2.6.6 Analog Output Signal

SVC port, externally connected with the inverter analog voltage frequency command input port, outputs voltage controlled from 0V to 10V. And it controls spindle speed through voltage change causing inverter frequency change.

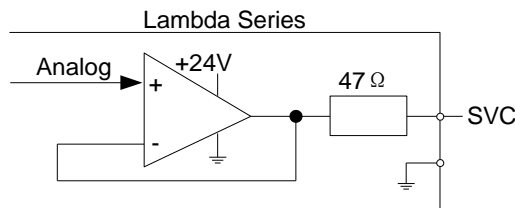



Fig. 2-40 Analog output signal circuit

3 Installation

3.1 PM85A/95A Communication Card

3.1.1 Installation Steps

- 1) Insert the software CD into the CD driver of computer, double click  in the NcStudio software CD, and then install the software according to the prompts of the software installation wizard;
- 2) Power off the computer, open the computer chassis, insert the communication card into a PCI slot (for PM85A) or PCI-E slot (for PM95A), fasten the screw of rail block, and cover the computer chassis;
- 3) Power on the computer, the computer to find the new hardware-device automatically. And then install the driver manually according to the driver installation wizard;
- 4) Double click the shortcut icon of NcStudio on the desktop; if it runs normally, installation is completed (if the software fails, please check whether the communication card is well inserted and whether gold fingers are clean).

3.1.2 Driver Update

If the system does not prompt finding a new device, you can update the driver manually by following the steps below:

- 1) Right click "My Computer", select "Properties", and click "Device Manager" under "Hardware" tab in the "System Properties" window. And then find "CNC Adapters" in the pop-up "Device Manager" window, right click the option under "CNC Adapters", and select "Update Driver..." to start updating the hardware driver. A new window appears, as shown in Fig. 3-1.

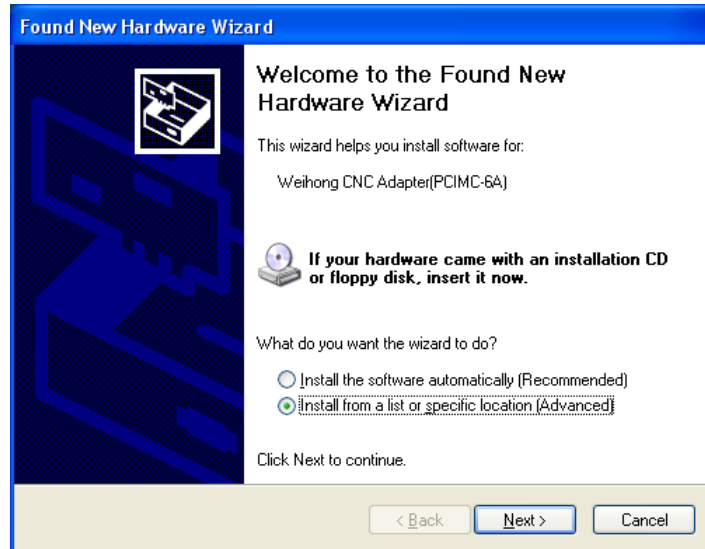


Fig. 3-1 Beginning of driver update

- 2) Select “Install from a list or specific location (Advanced)” in the pop-up “Found New Hardware Wizard”. And then click “Next”. See Fig. 3-2 for the new pop-up window.

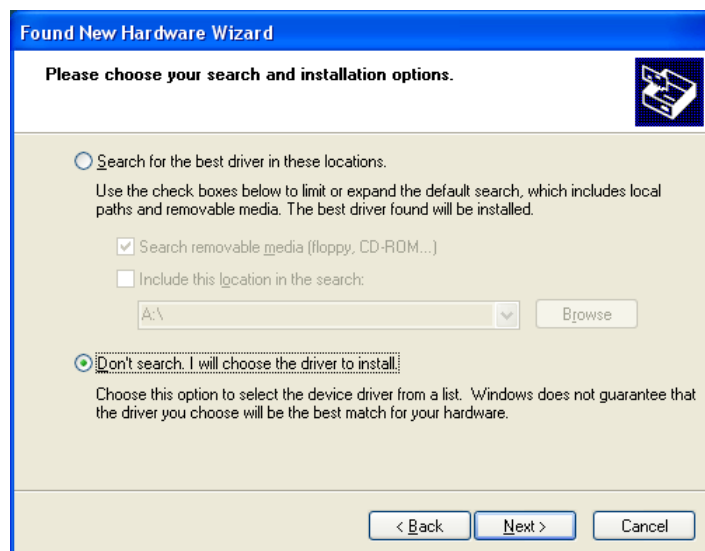


Fig. 3-2 Installation Options

- 3) Select “Don’t search. I will choose the driver to install”, and then click “Next”. See Fig. 3-3 for the new pop-up window.

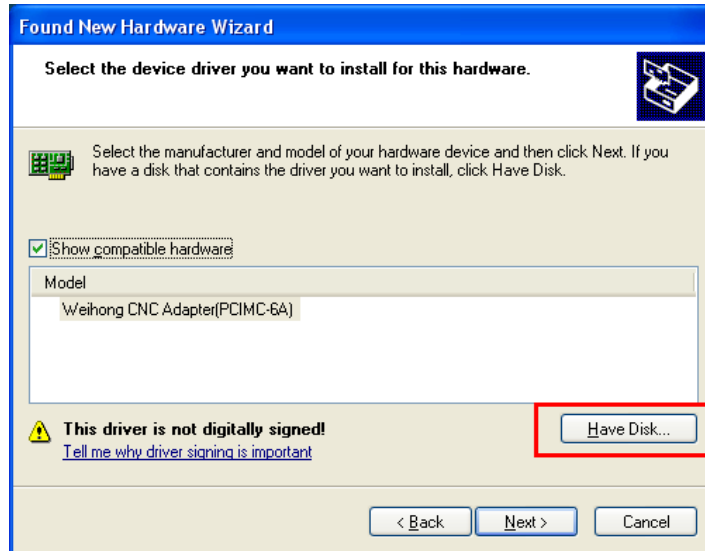


Fig. 3-3 Find driver location—1

- 4) Click “Have Disk...”, a new window to appear, as shown in Fig. 3-4.

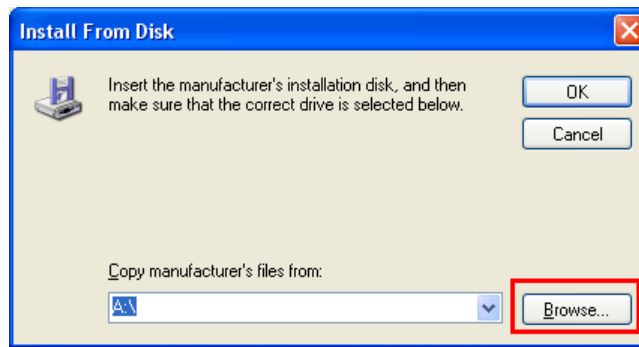


Fig. 3-4 Find driver location—2

- 5) Click the “Browse” button in the pop-up dialog “Install From Disk”, and select the target *Lambda.inf* file under “C:\Program Files\Naiky\PCIMC-Lambda”. (Here takes PM85A as an example)

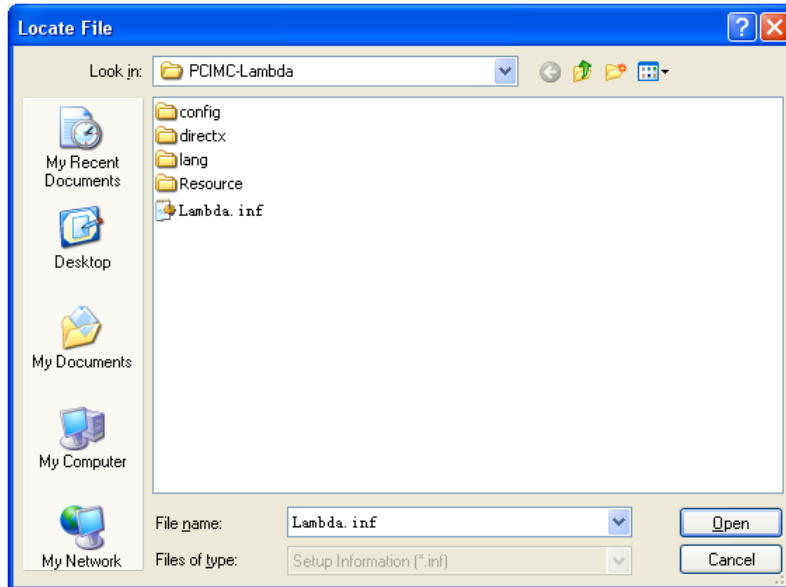


Fig. 3-5 Find driver location—3

- 6) After selecting the corresponding driver file, click “Open” to return to the previous page, showing the file directory under “Copy manufacturer’s files from”, as shown in Fig. 3-6.

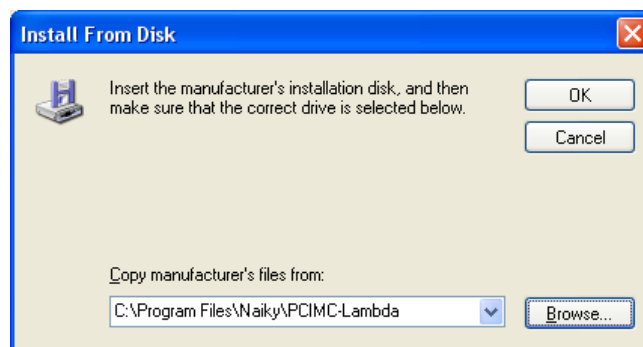


Fig. 3-6 Find driver location—4

- 7) Click “OK” to go back, and then click “Next” to start updating the hardware driver with the progress bar displayed. See Fig. 3-7.

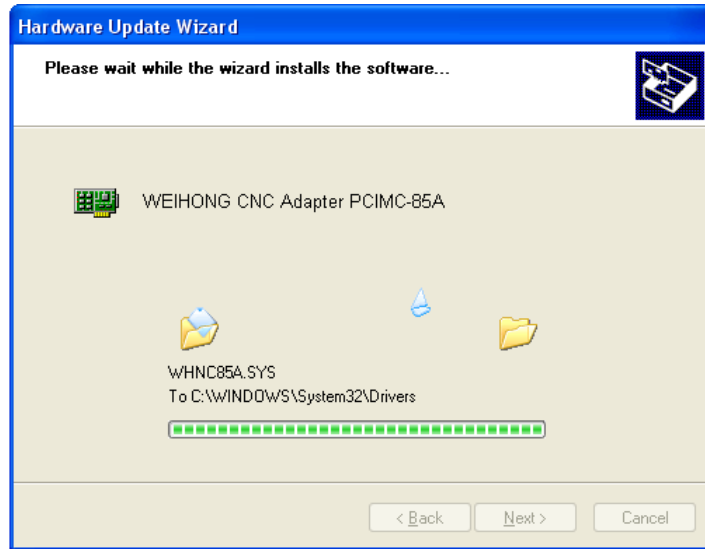


Fig. 3-7 Updating the driver

- 8) After updating completed, a new window, as shown in Fig. 3-8, appears. You just need to click “Finish” to complete the update of the hardware driver, and then you can open the software successfully.

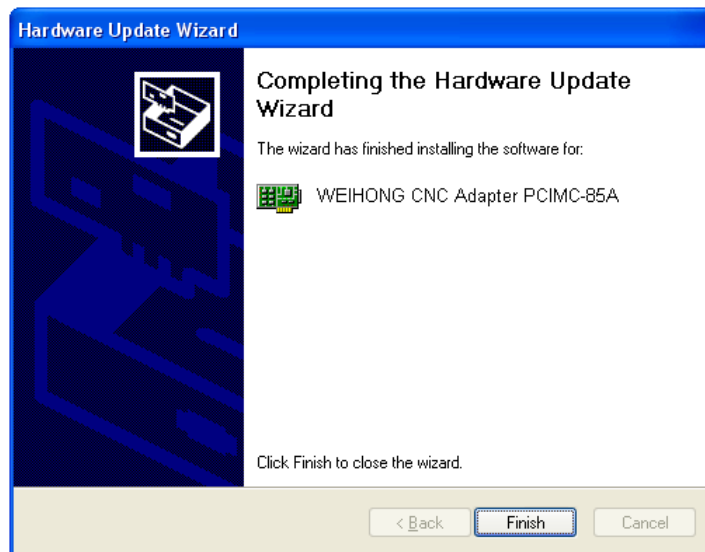


Fig. 3-8 Update driver complete

3.1.3 Customization of Setup Installation Package

A tool, named NcHelper.exe under the installation directory, helps customize setup installation package. For example, when you want to change the settings of some parameters and set them to default value in the process of using NcStudio, to achieve the best performance of a machine tool, you can change the settings, find this tool, double click it, select a default configuration, and generate a new software package with the parameter settings changed.

3.2 NC65A/65B Host

Before leaving factory, the NC65A/65B integrated CNC system has already been installed with software. In case of software failure, you can re-install or update the software following the steps in 3.2.1.

3.2.1 Software Setup

- 1) Enter the desktop, and double click the desired software package. The first pop-up dialog is for language selection. See Fig. 3-9. Selecting “ENGLISH” will run the software in English. Likewise, if “选择中文界面” is selected, NcStudio will run in Chinese.



Fig. 3-9 Language selection

- 2) Setup continues after a language is selected. If the operating system has already been installed with NcStudio software, the installation package will delete the old files and give a prompt, as shown in Fig. 3-10. If “OK” is selected, the setup will continue. Otherwise, the setup will exit.

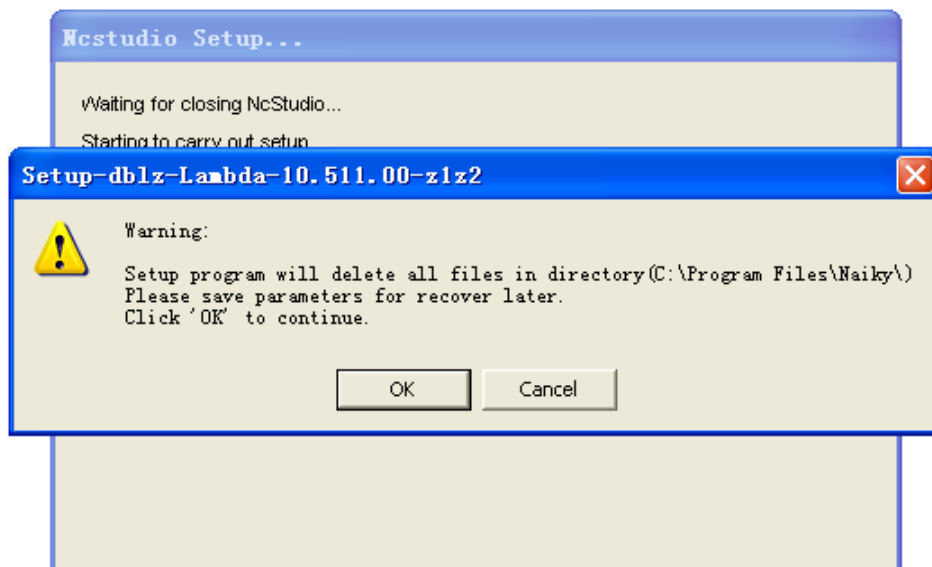


Fig. 3-10 Prompt to save parameters

- 3) Click “OK” to continue installation, the progress bar displayed, as shown in Fig. 3-11.

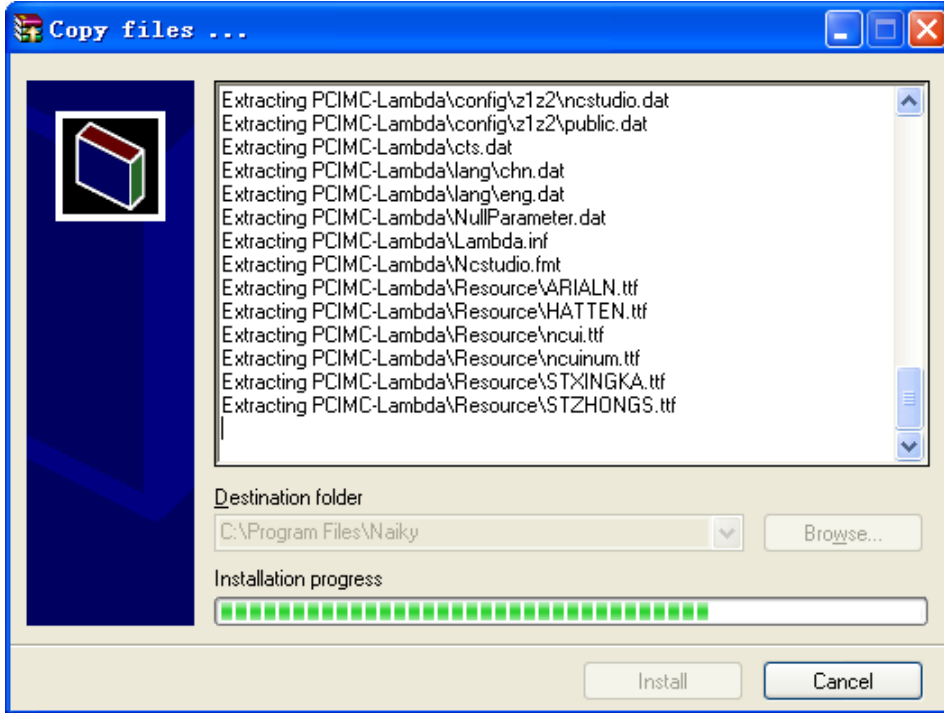


Fig. 3-11 Software setup progress

- 4) After setup completed, the system installs the driver automatically. See Fig. 3-12.

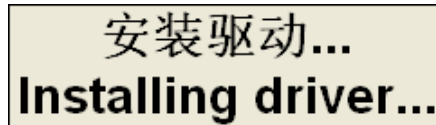


Fig. 3-12 Driver installation

- 5) After driver installation completed, the following dialog appears. At this time, clicking “OK” will reboot the system. After reboot completed, NcStudio will be opened automatically.



Fig. 3-13 Driver installation completed

3.2.2 OS Backup and Restore

The OS can be backed up and restored in NC65A/65B, and the concrete steps are as following.

3.2.2.1 First-time OS Backup

- 1) Press F7 repeatedly at boot until entering the interface shown in Fig. 3-14.



Fig. 3-14 First-time backup interface

- 2) Select “1 分区 备份” (means Partition Backup) to start OS backup.
- 3) After backup completed, the OS before backup will be rebooted automatically.

3.2.2.2 Other Backups

- 1) Press F7 repeatedly at boot until entering the interface shown in Fig. 3-15.



Fig. 3-15 System restore

- 2) Select “取消(C)” (means Cancel) to enter the interface shown in Fig. 3-16.



Fig. 3-16 Backup interface under other conditions

- 3) Select “2 重新 备份” (means Re-backup) by Up and Down keys to start OS backup.
- 4) After backup completed, the OS before backup will be rebooted automatically.

3.2.2.3 OS Restore

- 1) Press F7 repeatedly at boot until entering the interface shown in Fig. 3-15.

- 2) Select “还原(R)” (means Restore) to start OS restore.
- 3) After restore completed, the fresh restored OS will be booted automatically.



Selecting “1 分区 还原” (means Partition Restore) in Fig. 3-15 will also execute OS restore.

3.2.3 OS Backup and Restore via USB Flash Disk

If OS failed and cannot be backed up or restored following the above steps, you can execute OS backup and restore by creating an USB startup disk.

3.2.3.1 Preparation

- 1) An USB flash disk (above 1G)
- 2) The backup and restore kit

3.2.3.2 Setup

◆ Creating USB Startup Disk

Double click “hpUpgsh\hpUpgsh.exe” under the designated file folder. As shown in Fig. 3-17, a dialog pops up. Select the drive letter, file system, format options and the path of boot files (H:\hpUpgsh\boot) in this dialog, and then select “Start” to begin formatting. Keep selecting “Yes” until the making of USB startup disk finishes.

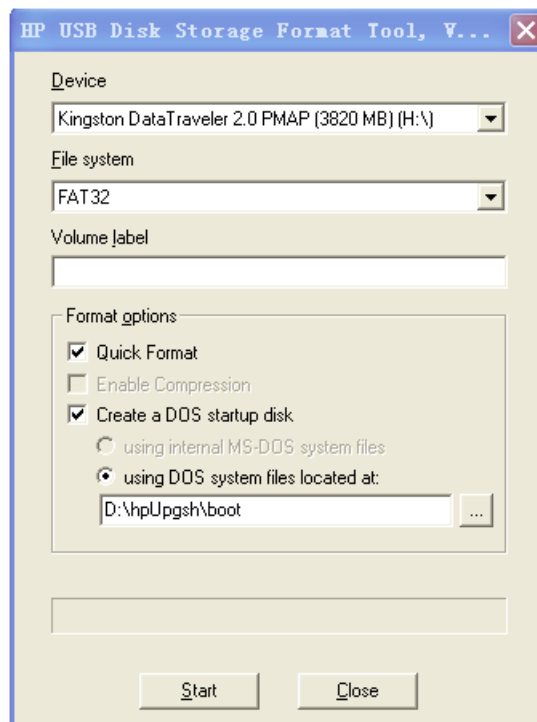


Fig. 3-17 The interface to make a USB startup disk

◆ Tool Kit Installation

After creating the USB startup disk successfully, double click the installation package file “WEIHONG-NC65A/65B-XP-V*.exe”. Select “浏览(W)...” (means Browse), and define “目标文件夹” (means Destination Folder) as the root directory of the USB flash disk. And then click “安装” (means Install) to start extracting, as shown in Fig. 3-18.

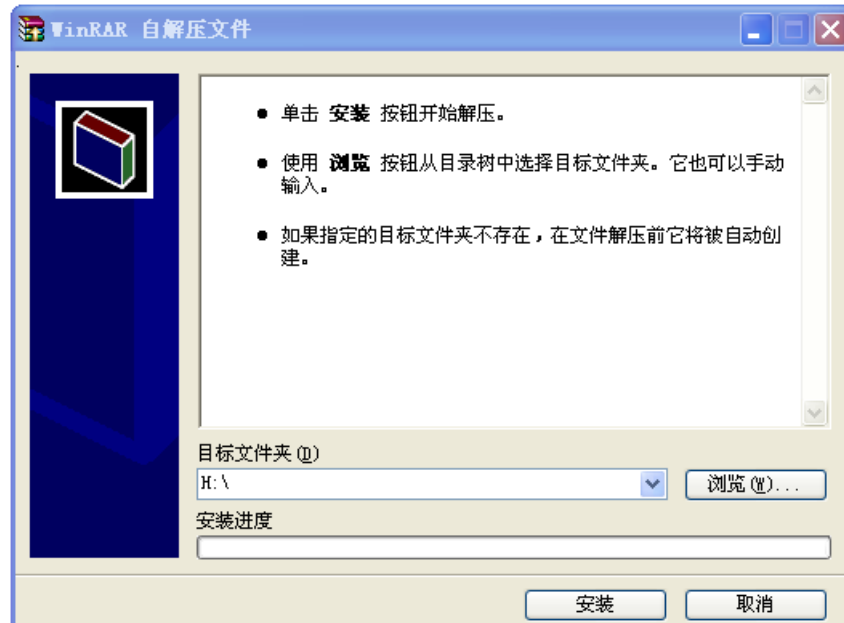


Fig. 3-18 Setup

After extraction finishes successfully, the setup of backup and restore kit is completed.

3.2.3.3 OS Backup and Restore

◆ Setting BIOS Booting from USB Flash Disk and the Sequence of System Disk and Data Disk

Insert the startup disk with the OS backup file into the NC65A/65B host, and then reboot the NC65A/65B, while pressing the “Delete” key to enter BIOS. Select “Advanced Bios Features →Hard Disk Boot Priority” to set the disk sequence: U 盘设备(means USB flash disk)/Cho M/Cho S/; (note: for start-up the OS, the sequence must be Cho M/ Cho S). Otherwise, OS restore and backup may aim at the data disk.

◆ One-key Restore

After entering the one-key restore DOS environment by booting from the USB flash disk, there are two options. Continuously pressing “1” twice will make the tool kit restore the OS automatically. After restoring, remember to reset BIOS “Hard Disk Boot Priority” before removing the USB flash disk. Then the OS can be rebooted.



After restore, it is required to reboot the system in a normal way before installing the software, because write-protect is not opened after the OS is installed for the first time. After rebooting, write-protect is opened.

◆ One-key Backup

Select “2” to return to DOS environment after entering environment selection by booting from the

USB flash disk. Input “back”, and then press “Enter” to enter backup selection environment. Selecting “2” will enter into backup state automatically. If there is already the image file “diskback.gho” in the USB flash disk, remember to rename it or cut it before one-key backup. Otherwise, the tool kit will exit from backup environment automatically if the image file has already existed in the USB flash disk.

◆ **Note:**

If abnormal conditions occur during system restore and backup, the most possible causes are as following:

- 1) The boot sequence of BIOS hard disk is wrong.
- 2) The OS has already been broken before backup.
- 3) The USB space is not enough.
- 4) The image file has already existed in the USB in the process of backup.
- 5) Sometimes, if backup or restore exits abnormally, it is possible that there are bad sectors in the system CF card. The way to solve it is to repair the hard disk of CF card.
- 6) On account of the above issues, it is suggested to check and repair the system disk before OS restore and backup, or system performance may be affected, so is the data disk.

4 Machine Tool Debugging

4.1 Debugging Steps

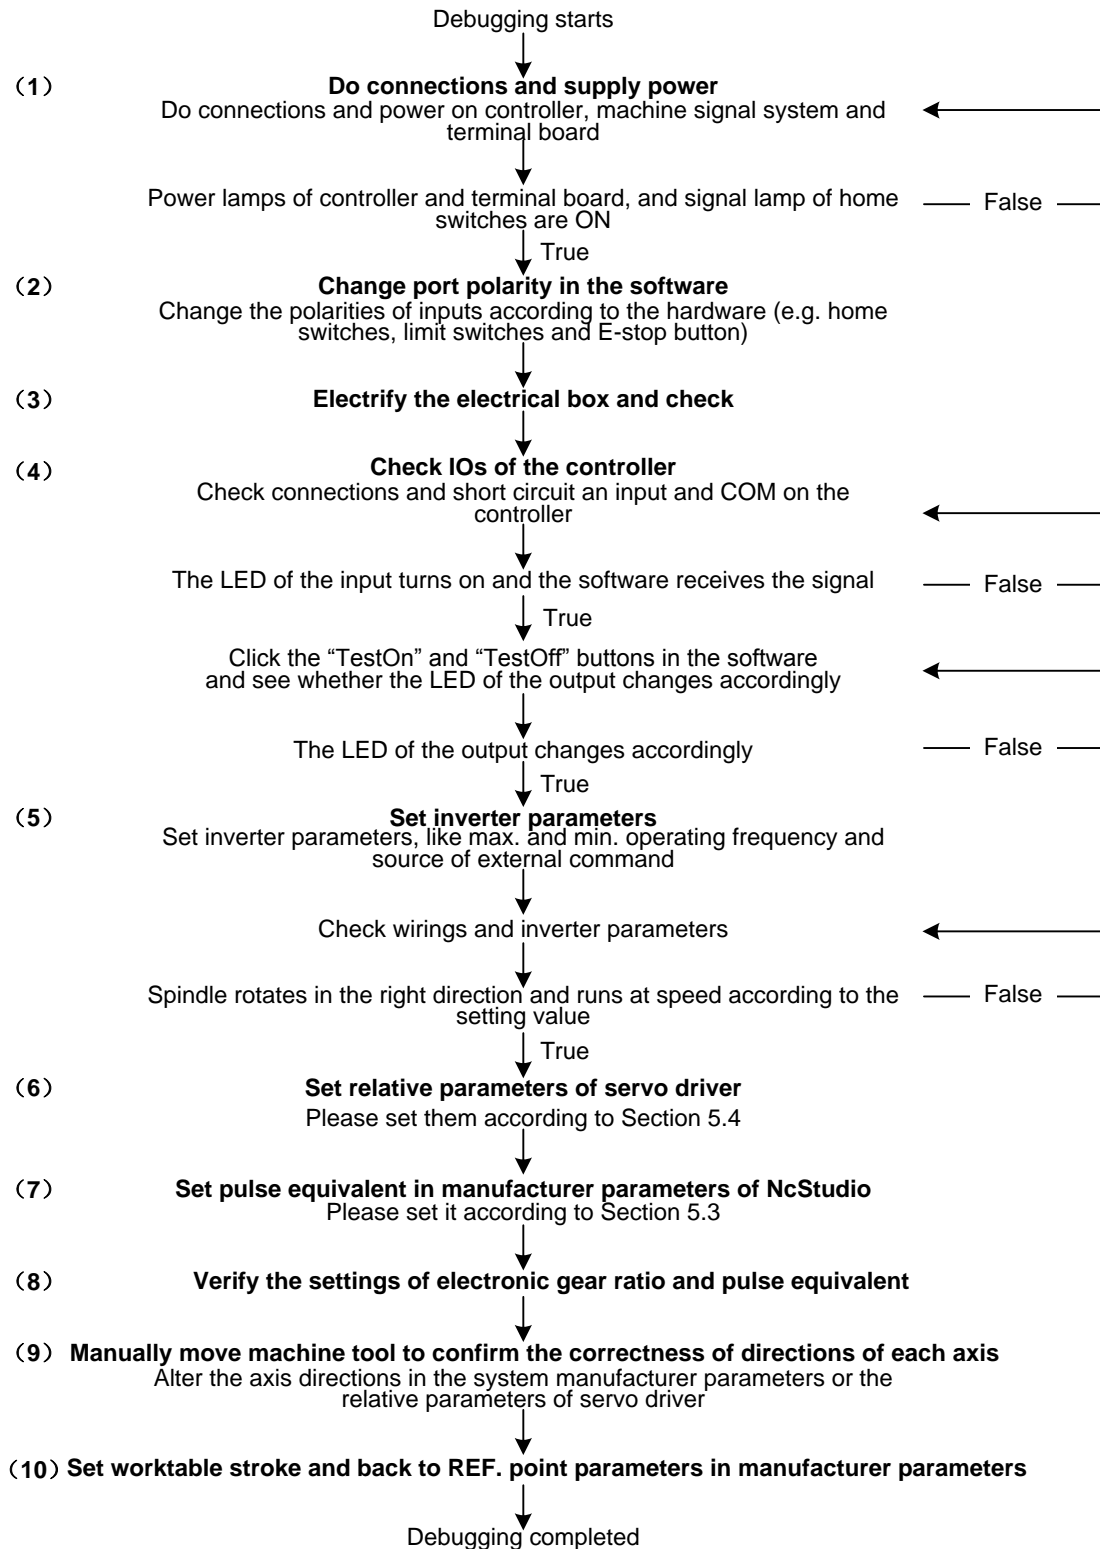


Fig. 4-1 Process of machine tool debugging



The above process is for preliminary debugging, see below for detailed steps:

- 1) Connect the Lambda controller to the communication card or NC65A/65B host with a DB9M/F cable, provide 24V power supply for the controller, check whether the power indicator on the controller is on, and power on the machine signal system (proximity switch, etc). If the home switches connected are normally closed, at this time, three LEDs of X0, Y0 and Z0 should be on. Trigger a home switch through artificial imitation. (For a travel switch, artificial press can be used to observe whether the signals can be received. For a photoelectrical switch, artificially obstruct the light to see if the signals can be gotten. For a metal proximity switch, artificially approach it with a metal block to see if the signals can be gotten.) If the corresponding LED is out, it indicates the REF. point signals have been sent to the controller. If the home switches connected are normally open, LEDs should be usually out, and by artificially touching a switch, the LED should light, which shows the REF. point signals have been sent to the controller. The same method can be taken to test other input ports to ensure the correctness of the wiring between the controller and the machine tool, to greatly shorten the debugging time.
- 2) Power on the computer, run NcStudio software, and then switch to “DIAG”→ “IOPort” window, displaying input and output signals (in dual Z axes software, switch to “IOPort”). Solid dots indicate input signals, while hollow dots output signals; dots in red indicate the signals are invalid at the time (with no input or output), while dots in green indicate valid at the time. The “IOPort” window is as shown in Fig. 4-2. (It is for reference only. Ports displayed in the “IOPort” window vary with software version and hardware. The actual situation is in line with shipment).

Tag	Pin	P..	PL...	Input Sa...	Description
InPort					
●XC		N	000...	E,F:4ms ...	Encoder Zero of X-axis
●YC		N	000...	E,F:4ms ...	Encoder Zero of Y-axis
●ZC		N	000...	E,F:4ms ...	Encoder Zero of Z-axis
●AC		N	000...	E,F:4ms ...	Encoder Zero of A-axis
●XALM		N	000...	E,F:4ms ...	Axis X Servo Alarm
●YALM		N	000...	E,F:4ms ...	Axis Y Servo Alarm
●ZALM		N	000...	E,F:4ms ...	Axis Z Servo Alarm
●AALM		N	000...	E,F:4ms ...	Axis A Servo Alarm
●HX1		N	000...	E,F:4ms ...	Handwheel Ratio X1
●HX10		N	000...	E,F:4ms ...	Handwheel Ratio X10
●HX100		N	000...	E,F:4ms ...	Handwheel Ratio X100
●HSX		N	000...	E,F:4ms ...	Select X-axis by Handwheel
●HSY		N	000...	E,F:4ms ...	Select Y-axis by Handwheel
●HSZ		N	000...	E,F:4ms ...	Select Z-axis by Handwheel
●HSA		N	000...	E,F:4ms ...	Select A-axis by Handwheel
●X00		N	001...	E,F:4ms ...	Reference Point of X-axis
●X01		N	001...	E,F:4ms ...	Positive Limit of X-axis

Fig. 4-2 NcStudio I/O ports window

- 3) Alter the input port polarity of the software in terms of the home switches and E-STOP button used: the polarity of NO input ports is N, while that of NC input ports is P. The way to alter the polarity is as follows:

In V8 version: press Ctrl, Alt and Shift simultaneously, while right clicking the signal to be modified its polarity, a menu to appear, and then choose "Toggle Polarity". After changing the polarity of all desired ports, close and restart NcStudio, polarity modification to become valid instantly.

In V9 and V10 versions: directly click the manipulation button [ConvPol] under [IOPort] screen of [DIAG] function section. After changing the polarity of all desired ports, close and restart NcStudio, polarity modification to become valid instantly.

- 4) Electrify the electrical box. At this time, the dots in front of such input signals as REF. point signals of the three axes, E-STOP signal, cycle start/stop signals and tool sensor signal should be in red, indicating all these signals are invalid. Otherwise, it is necessary to check the correctness of electrical circuitry and signals polarity. If electrical circuitry is correct, alter the corresponding signal polarity to ensure the dots in front of the above-mentioned signals red.
- 5) Test whether the inputs and outputs on the controller work normally. For an input, the method is as following: short circuit an input and COM on the controller: if the corresponding LED on the controller turns on, but the corresponding input in the software does not have the signal, you need to check the connection of the cable DB9M/F between the communication card (NC65A/65B host) and the controller. If the LED does not turn on, you need to check whether the controller meets a fault (like power supply issue). For an output, the method is as following: click the "TestOn" and "TestOff" buttons in the software, and observe whether the corresponding LED on the controller turns on or off accordingly. If so, the output works normally; if not, check the connection of the cable DB9M/F between the communication card (NC65A/65B host) and the controller.
- 6) Set inverter parameters to make the inverter work under 0~10V analog voltage control mode. Spindle ON/OFF adopts forward rotation terminal control mode. Press down the [Spindle Start] button in the software, and observe in the IOPort window whether the color of signal dot in front of "Spindle" turns green, on the controller whether the green output indicator LED beside the corresponding relay becomes brightening, and whether the spindle starts to rotate. If the spindle does not rotate, please examine the connection of the inverter. Adjust the spindle speed in the software and the actual spindle speed should be changed correspondingly; otherwise, examine the connection and the parameters setting of the inverter. If the spindle rotates in a wrong direction, you can change the settings of the relative inverter parameters, or change the connection between the spindle and inverter: usually, there are three wires connected with the spindle. Exchanging any two of them will alter the spindle rotation direction.
- 7) Set the relative parameters of servo driver. Refer to Section 5.4 for the setting of driver parameters.
- 8) Set pulse equivalent in the "manufacturer parameters" of Ncstudio. The password of manufacturer parameters is "ncstudio". The smaller the pulse equivalent is, the higher the resolution will be. The value of pulse equivalent will affect the maximum feed speed. Generally speaking, regarding the pulse equivalent of a mold machine, 0.001mm/p (the corresponding maximum feed rate is 9600mm/min) or 0.0005mm/p (the corresponding maximum feed rate is 4800mm/min) can be taken into consideration; for users who are not very critical of the accuracy, the pulse equivalent can be set a litter larger, such as 0.002mm/p (the corresponding maximum feed rate is 19200mm/min) or

0.005mm/p (the corresponding max. feed rate is 48000mm/min). When pulse equivalent is confirmed, calculate the electronic gear ratio of servo driver in terms of value of pulse equivalent. Refer to Section 5.3 for the calculation of electronic gear ratio.

- 9) Examine whether the value of electronic gear matches with that of pulse equivalent. Make a mark on any axis of the machine tool and set this marked point as the workpiece zero. Drive this marked axis to move a fixed distance by direct command input, jog or handwheel, and so on. Measure the actual moving distance with a vernier caliper and check whether the result is equal to the distance showed in the software.
- 10) Move the machine tool manually to make sure the correctness of moving direction of each axis. Note that NcStudio adopts “right hand” coordinate system. For X-axis, right movement is the positive direction; for Z-axis, upward movement the positive direction; while the positive direction of Y-axis is to move away from the operator (if the movement of Y-axis is the movement of worktable, its positive direction is the worktable moving towards the operator). If the direction is not correct, alter the axis direction in the system parameters or the relative parameters of servo driver. If Z-axis has brake, check the relative wiring of brake and the relative parameters of servo driver before Z-axis starts to move for the first time. After confirmation, move Z-axis in jog mode at a slow speed, and observe the response of Z-axis, making sure the brake can be opened normally.
- 11) Set the worktable stroke in the manufacturer parameters according to the actual size of the machine tool to enable software limit function.
- 12) Set “Back to Machine Zero” parameter in manufacturer parameters according to the installation position of home switches of the three axes. After correct setting, perform the “Back to Machine Zero” function under menu “Operate”. At first, home a single axis. Home the other two axes on condition that the moving direction of the first axis is correct; otherwise, stop homing and revise “The Direction of Backing to Machine Zero” parameter in the manufacturer parameters until all axes can return to the machine zero.
- 13) Axial acceleration: it is used to describe the acceleration / deceleration ability of a single axis, in mm/s^2 . The value is determined by the physical characteristic of the machine tool, such as quality of movement part, torque, resistance, cutting load of feed-motor, and so on. The larger the value is, the less time spent in the process of acceleration / deceleration will be, and the higher the efficiency will be. Generally, for a stepping motor system, the value is between 100 and 500; for a servo motor system, the value is between 400 and 1200. Set the value smaller at the beginning; make the machine tool perform various typical movements for a period of time, and carefully observe it; when there is no abnormal situation, increase the value gradually; otherwise, decrease the value and reserve 50% ~ 100% insurance allowance.
- 14) Turning acceleration: it is used to describe the acceleration/deceleration ability in synchronized motion of multi-axis, in mm/s^2 . The value limits the maximum speed of the machine tool in circular movement. The larger this value is, the higher the maximum allowable speed on circular movement of the machine tool will be. Generally, for a stepping motor system, the value is between 400 and 1000; for a servo motor system, the value is between 1000 and 5000; for a heavy machine tool, the

value should be smaller. Set the value smaller at the beginning; make the machine tool perform various typical movements for a period of time, and carefully observe it; when there is no abnormal situation, increase the value gradually; otherwise, decrease the value and reserve 50% ~ 100% insurance allowance.

Usually, given the drive ability of servo motor, friction of machine assembly, and endurance capacity of mechanical components, limit the maximum speed of the three axes in actual using by modifying the max. speed of each axis in the manufacturer parameters.

15) Set the parameter of auto lubrication (set a value smaller, such as once every 5 seconds). Observe if auto lubrication is executed correctly. If so, set it according to the actual need.

In case of any problem in the running of the machine tool, check every part carefully according to the steps above.



For a stepping motor system, usually, start-up speed should also be set. Generally, the value should be between 200 and 300.

4.2 Pulse Test

If you suspect there is pulse loss, you can confirm it by either of the following two methods.

4.2.1 Stepping Driver

Mark a little dot on the surface of a workpiece blank with a dagger; set this point as the workpiece zero; lift up Z-axis; set the coordinate of Z-axis as 0; repeatedly move the machine tool, for example, run a typical procedure with no tools (including synchronized movement of the three axes is much better), and pause or stop during machining is permitted; and then back to the workpiece zero; descend Z-axis slowly; observe whether the knife point matches with the marked dot.

4.2.2 Servo Driver

For a servo system, there is a more precise method: set servo driver mode as “input pulse count mode” in the “surveillance mode” (for example, the parameter of YASKAWA servo is UN00C); regulate it to display the lower 4 bits (with “L” before the count value) in count value (hexadecimal system); set workpiece zero and then write down the pulse count value at this time, then repeatedly run the procedure with no tools on the machine tool, then back to the workpiece zero and see whether the pulse count value at this time is the same with the original value.



For YASKAWA servo, as long as the value difference of pulse count value is no more than 4 (the frequency of host controller is 1/4 times the frequency of pulse sent by servo drive), indicating that the main controller sends the pulse within the tolerance of 1 pulse, the control system runs normally; otherwise, please check the pulse signal type of servo driver, and make the pulse type received by servo in accord with the pulse type sent by the system.

5 Appendix

5.1 Back to Machine Zero (Back to Reference Point)

Machine Zero (also called machine origin, home) is the datum mark of MCS (machine coordinate system). The process of returning to machine zero, varying with different machine structures & control software versions, is achieved via the execution of a block of G codes.

“Back to Reference Point” is a process to synchronize local coordinate system with actual external coordinate system via control system. In other words, since the system does not know the concrete position of each axis after start-up, it will control the motion of each axis and detect the switch signals pre-installed on each axis during the motion (the control system has already known the installation position of these switches). Thus, once these switch signals are found, the system will learn that the machine tool has reached the predetermined position and then set the coordinates of this position as current coordinates, namely, the local coordinate system is synchronous with the actual one.

Generally, these switches are installed at the position of machine zero, i.e. “Back to Machine Zero” equals to the term “Back to Reference Point” in our system. Home switches are also allowed to be installed at other locations.

The principle of returning to REF. point can be divided into two types—with encoder feedback and without encoder feedback.

5.1.1 Principle of Returning to Machine Origin (without Encoder Feedback)

The sketch map of returning to machine origin with servo motor is as below (without encoder feedback):

◆ Coarse Positioning Stage

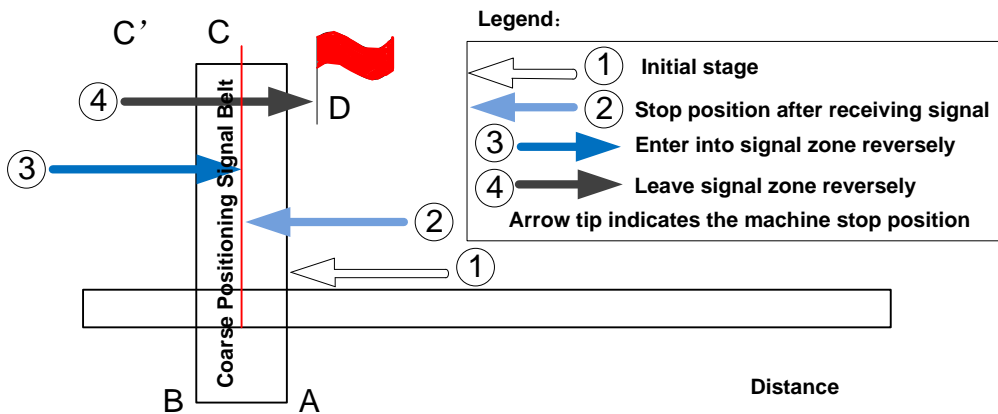


Fig. 5-1 Sketch map of coarse positioning (stopping within the signal belt after receiving REF. point signal)

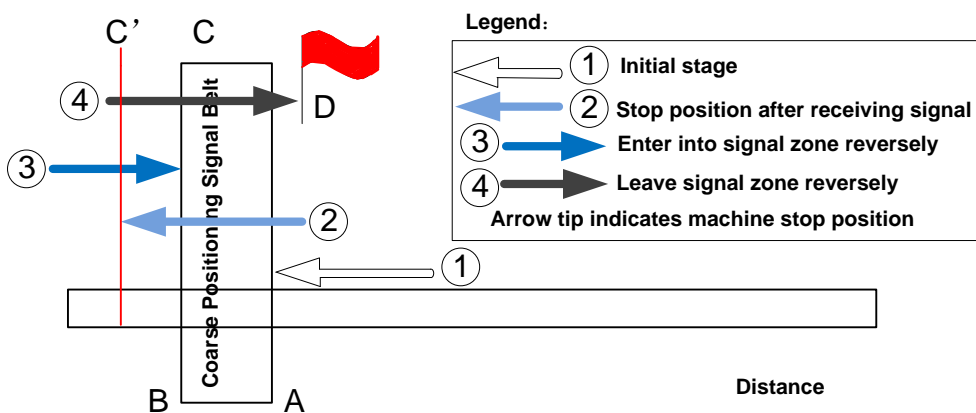


Fig. 5-2 Sketch map of coarse positioning (stopping out of the signal belt after receiving REF. point signal)

- 1) When the machine keeps moving until receiving REF. point signal at place A, it should stop immediately, but it may stop at place C or C' due to time lag and inertia.
- 2) The machine keeps moving reversely at one third of "Home Search Velocity" until receiving REF. point signal (if the machine has stayed in the signal belt in the above step 1, it will make no motion in this step).
- 3) The machine keeps moving reversely at one-tenth of "Home Search Velocity" until the REF. point signal disappears (across the signal belt).

4) The machine halts at the red flag place D at the end of this stage.

◆ **Fine positioning Stage**

Fine positioning, with various methods, is used to make each axis return to machine zero exactly by regarding encoder zero as fine positioning switch in our system, i.e. the axis is locating for machine zero in the motion via detecting encoder zero. Due to one zero signal sent per revolution of encoder, the fine positioning signal is periodic.

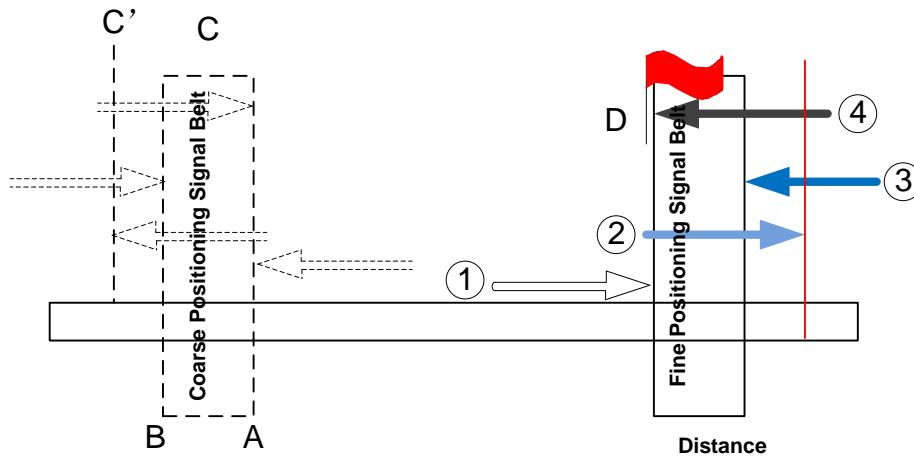


Fig. 5-3 The process of fine positioning

◆ **Retracting Stage**

After finishing the fine positioning stage, the system will execute retracting motion once with recommended retracting distance as half of the screw pitch. The sketch map is shown in Fig. 5-4.

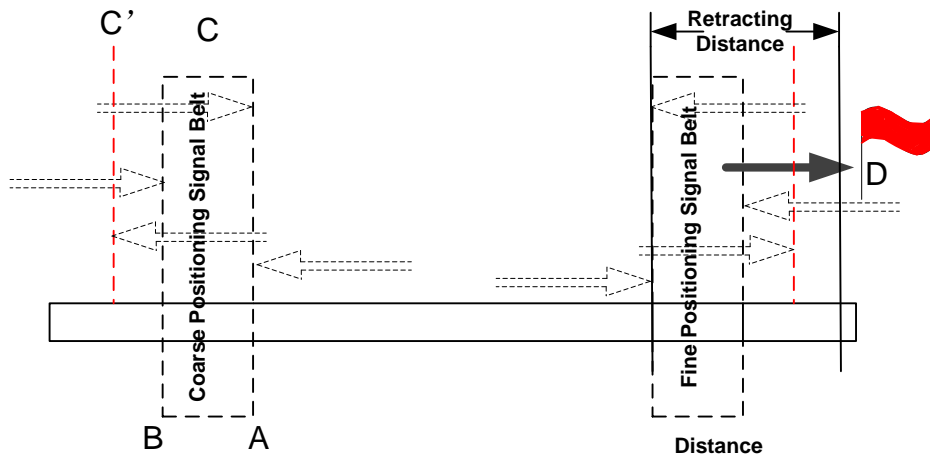


Fig. 5-4 Retracting stage

5.1.2 Principle of Returning to Machine Origin (with Encoder Feedback)

With encoder feedback function, the system will execute coarse positioning and fine positioning only once in returning to machine origin. The retracting distance after fine positioning is the actual retracting distance adjusted in terms of actual situation. And the concrete process is as below:

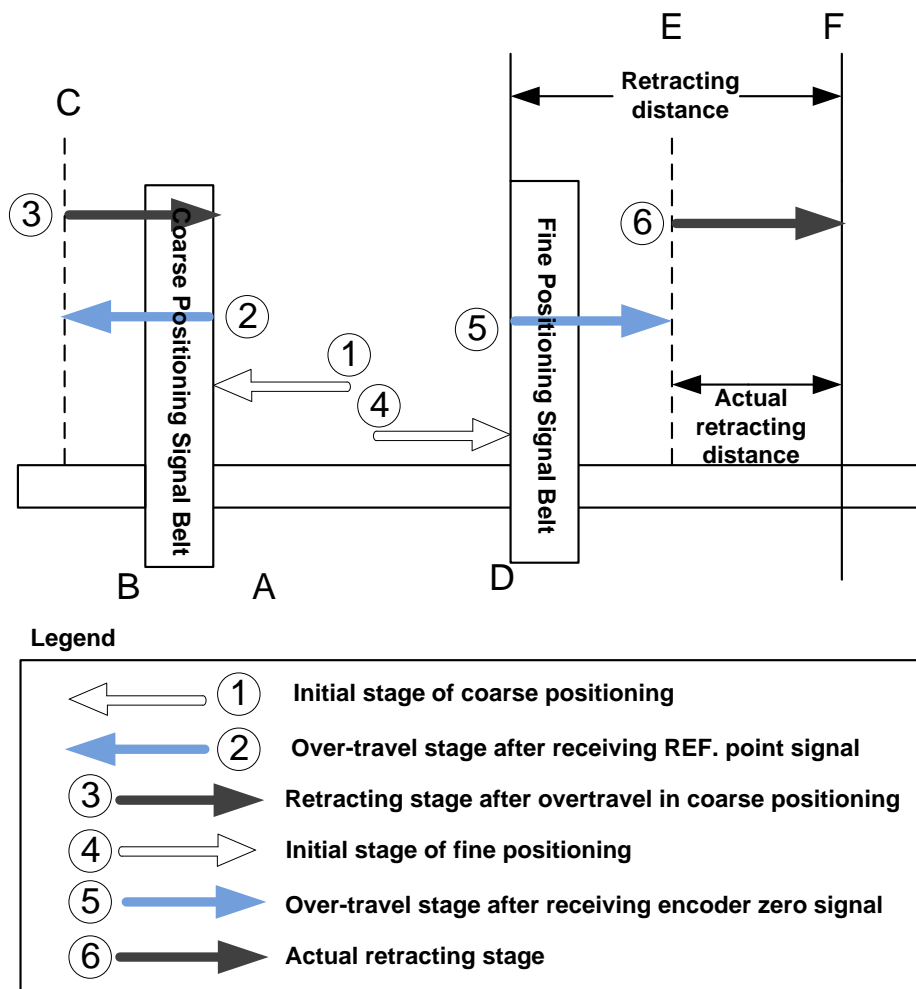


Fig. 5-5 The process of returning to machine origin

- 1) In coarse positioning stage, the machine tool should stop immediately at place "A" when receiving REF. point signal, but it may stop at place "C" due to over-travel caused by inertia and time-lag.
- 2) The machine executes retracting stage of coarse positioning.
- 3) In fine positioning stage, the machine tool moves reversely and should stop at place "D" immediately when receiving encoder zero signal; at the mean time, the feedback data of encoder will be latched, but the machine will generate over-travel and stop at place E due to inertia and time-lag. And the displacement between encoder zero signal and stop position (i.e. DE) is the across distance of

signal deceleration.

- 4) In terms of the retracting distance and across distance calculated, calculate the actual retracting distance, and use this actual distance to make the machine move and stop at place F, keeping it free from the signal source.

5.2 Pulse Equivalent Adjustment

Pulse equivalent (p): the moving distance of workbench or rotation degree of rotary axis corresponding to one pulse sent by CNC device, the minimum available distance controlled by CNC system as well.

The smaller the pulse equivalent is, the higher the machining precision and surface quality will be. The larger, the faster feedrate will be. Therefore, lower pulse equivalent should be set under the condition of meeting the demand of feedrate. The relationship between max. feedrate and pulse equivalent is as following:

Max. Feedrate = pulse equivalent \times 60 \times frequency

For example, the hardware frequency of Lambda series CNC system is 1MHz and provided the pulse equivalent is 0.001 mm/p, then:

Max. feedrate = 0.001 \times 60 \times 1000000 = 60m/min

Mechanical deceleration ratio (m/n): the ratio of reducer input speed to output speed, equal to the ratio of the teeth number of driven wheel to that of driving wheel. When applied in CNC machines, it specifies the ratio of motor speed to screw speed.

$$\text{Mechanical deceleration ratio} = \frac{\text{reducer input speed}}{\text{reducer output speed}} = \frac{\text{teeth number of driven wheel}}{\text{teeth number of driving wheel}} = \frac{\text{motor speed}}{\text{screw speed}}$$

Pitch (d): The axial distance between the corresponding points of two adjacent teeth on the threads.

The calculation of pulse equivalent varies with different motor systems.

◆ Stepping Motor

In general, firstly set the subdivision and then calculate the pulse equivalent. You can also set the pulse equivalent before calculating subdivision. Their relationship can be shown as:

$$\frac{d}{p} = \frac{360}{\theta} \times x \times \frac{m}{n}$$

Hereinto, p stands for pulse equivalent, x represents subdivision of stepping motor while θ refers to stepping angle. Therefore,

$$\text{Pulse equivalent} = \frac{\text{screw pitch}}{\frac{360}{\text{stepping angle}} \times \text{subdivision} \times \text{mechanical deceleration ratio}}$$

For instance, the selected screw lead of X-axis for a certain type of machine tool is 5mm, and the stepping angle of stepping motor is 1.8 degree, with “10” subdivision and motor directly connected with screw by coupling. Thus, the pulse equivalent of X-axis is:

$$\text{Pulse equivalent} = \frac{5\text{mm}}{\frac{360}{1.8} \times 10 \times 1} = 0.0025\text{mm/p}$$

◆ Servo Motor

In general, set the default value of pulse equivalent (p) as 0.001mm/p and calculate electronic gear ratio (B/A). Their relationship can be shown as:

 
$$\text{Electronic gear ratio } \frac{B}{A} = \frac{\text{encoder resolution}}{\text{screw pitch}} \times \text{mechanical deceleration ratio}$$

pulse equivalent

Namely, $\frac{B}{A} = \frac{F \times p}{d} \times \frac{m}{n}$

Electronic gear ratio (B/A): the parameter of servo driver (take YASKAWA driver as an example, B is PN202 while A PN203). This ratio represents servo scales up or down the pulse frequency sent by CNC system. When B is larger than A, it means scaling up and vice versa. For example, provided the pulse frequency sent by CNC system is 100HZ, if the numerator of electronic gear ratio (B) is set as 1 while the denominator 2, the actual running speed of servo is 50HZ. On the contrary, if the numerator is set as 2 while denominator 1, the actual running speed turns to 200HZ.

Encoder Resolution (F): needed pulse number for one circle of servo motor. Please see the servo motor label plate and then refer to the corresponding manual to confirm its encoder resolution.



See Section 5.3 for more info of electronic gear ratio and encoder resolution.

◆ Rotary Axis

The pulse equivalent of rotary axis refers to the rotation degree of the axis clamping the workpiece corresponding to each pulse. The difference of rotary axis movement from linear axis movement lies in that the screw pitch of rotary axis is 360 degrees. Therefore, in calculating rotary axis pulse equivalent, you just need to replace screw pitch with 360.

- For Stepping Motor

$$\text{Pulse equivalent} = \frac{360}{\frac{360}{\text{stepping angle}} \times \text{subdivision} \times \text{mechanical deceleration ratio}}$$

- For Servo Motor

$$\text{Electronic gear ratio } \frac{B}{A} = \frac{\text{encoder resolution} \times \text{pulse equivalent}}{360} \times \text{mechanical deceleration ratio}$$

5.3 Electronic Gear Ratio

5.3.1 Electronic Gear

Electronic Gear: assume that the system sends 5000 pulses per revolution of servo motor. When doubling revolutions of servo motor driven by the same amount of pulses is needed, there are two methods available, “set servo parameters” and “addition of mechanical gear between motor spindle and load-spindle”. Using circuit to realize the functions of mechanical gear is called electronic gear, viz. pulse frequency multiplication function.

5.3.2 Electronic Gear Functions

Regarding “Electronic Gear”, it refers to a proportional control factor of output displacement to motor when a certain amount of pulses is input. For the “senior device” issuing pulses, it can be regardless of encoder pulse No. and mechanical deceleration ratio in controlling.

Functions of electronic gear: it can set the command unit freely (the displacement of screw corresponding to one pulse sent by the system). Frequency multiplication can be used to amplify the frequency of pulse issued by the system.

Electronic gear ratio = encoder resolution × command unit × mechanical deceleration ratio / screw pitch

Please see the servo motor label plate and then refer to the corresponding driver manual to confirm the encoder resolution of servo motor. Fig. 5-6 is a label plate of YASKAWA SGMSH motor, and the 4th character of the motor type is the serial encoder specification, so the resolution of this motor is 2^{17} , i.e. 131072.

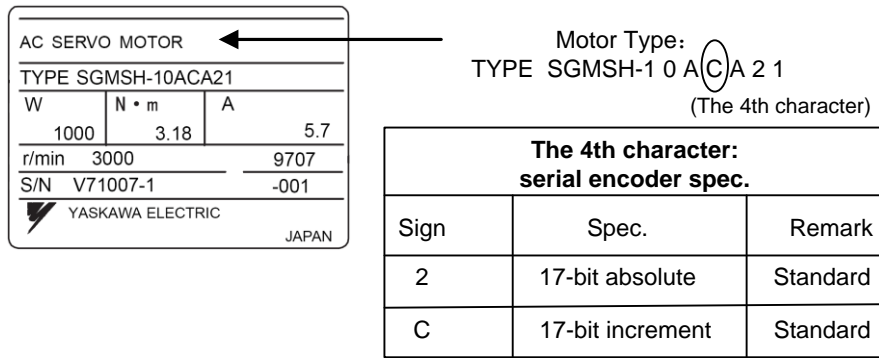


Fig. 5-6 Name plate of servo motor-encoder resolution

For instance: (an example of YASKAWA servo) screw pitch of a certain type of machine is 5mm, with 17 bit encoder resolution, “0.001mm/p” pulse equivalent and “1:1” deceleration ratio.

$$\text{Electronic gear ratio} \frac{PN202}{PN203} = \frac{2^{17}}{5/0.001} \times 1 = \frac{131072}{5/0.001} \times 1 = \frac{16384}{625}$$

The conversion of electronic gear ratio is as shown below.

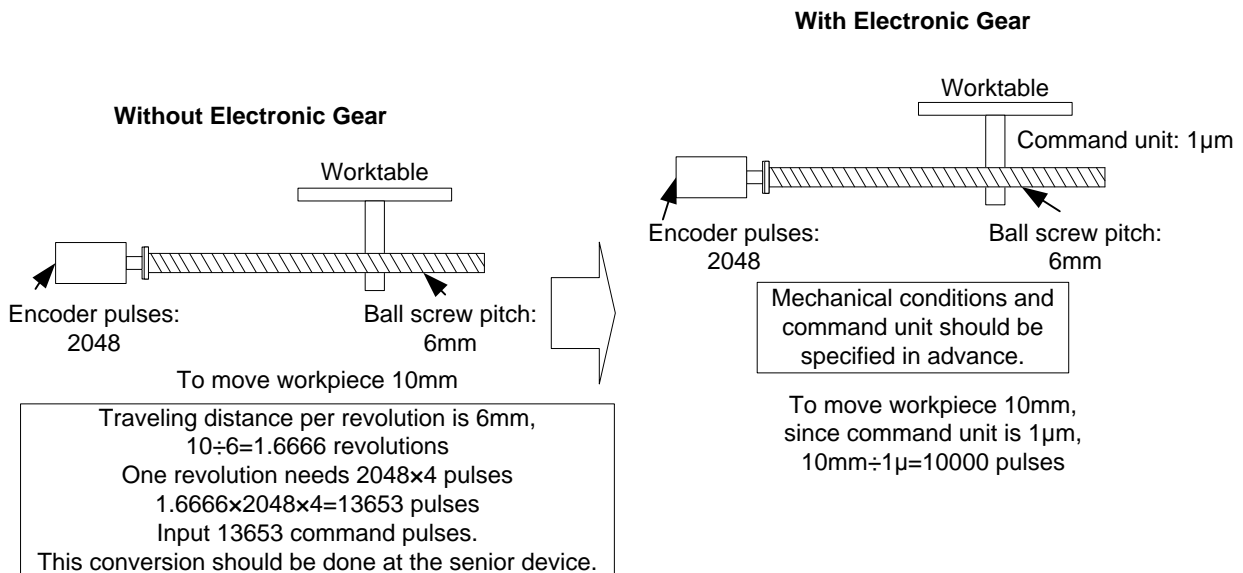


Fig. 5-7 Schematic conversion of electric gear ratio

5.3.3 Computing Method of Electric Gear Ratio

The setting of electronic gear ratio should be in accordance with the specification of equipment.

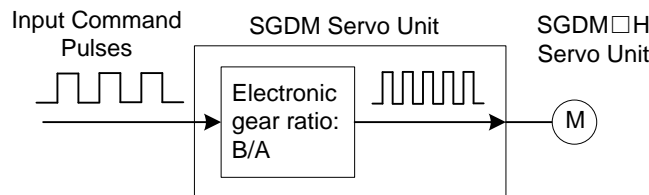


Fig. 5-8 Schematic map of electronic gear ratio function

$$\text{Electronic Gear Ratio} \frac{B}{A} = \frac{Pn202}{Pn203} = \frac{\text{Encoder Pulses} \times 4}{\text{Amount of movement per revolution of bearing axle}} \times \frac{m}{n}$$

$\frac{m}{n}$ is mechanical deceleration ratio.

5.3.4 Samples of Electronic Gear Setting

◆ **Sample One**

As screw pitch= 6mm (the screw travels 6mm per revolution of bearing axle), “2048” ($2^{13}/2^2$) pulses will be generated per revolution of servo motor with 13-bit incremental encoder.

Command unit= 0.001mm (the screw moves 0.001mm per pulse generated by the system)

Amount of movement per revolution of bearing axle= 6mm/0.001mm=6000

Ball Screw

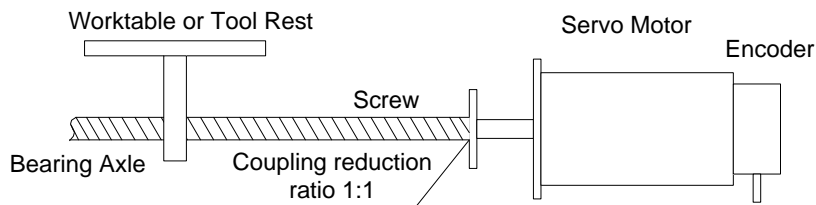


Fig. 5-9 Servo motor and screw sharing same axle (without reduction gearbox)

Servo motor and screw are sharing the same axle (without reduction gearbox), and one revolution of motor will lead to one rotation of screw.

$$\text{ElectronicGear Ratio} \frac{B}{A} = \frac{2048 \times 4}{6000} \times \frac{1}{1} = \frac{8192}{6000} = \frac{\text{Pn202}}{\text{Pn203}}$$

(Note: for YASKAWA servo, “4” should be multiplied by the numerator.)

Table 1 Parameters setting value

Parameter	PN202	PN203
Setting Value	8192	6000

◆ **Sample Two**

Round Table

Command unit: 0.1°

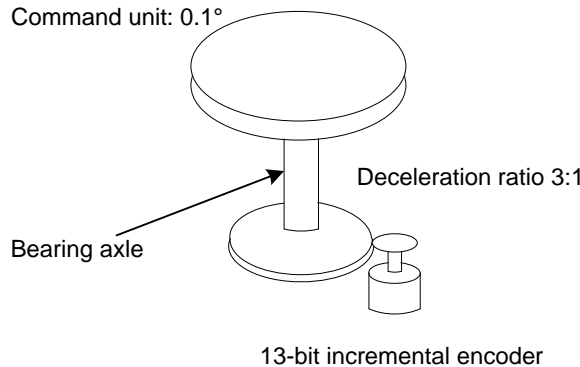


Fig. 5-10 Sample of round table

Pulses generated per revolution of motor= $2^{13}/2^2=2048$

Angle of rotation per revolution=360°

Command unit=0.1°

Amount of movement per revolution of bearing axle= 360°/ 0.1°=3600

$$\text{ElectronicGear Ratio} \frac{B}{A} = \frac{2048 \times 4}{3600} \times \frac{3}{1} = \frac{Pn202}{Pn203}$$

Table 2 Parameters setting value

Parameter	PN202	PN203
Setting Value	24576	3600

◆ **Sample Three**

Belt + Pulley

Command unit: 0.02mm

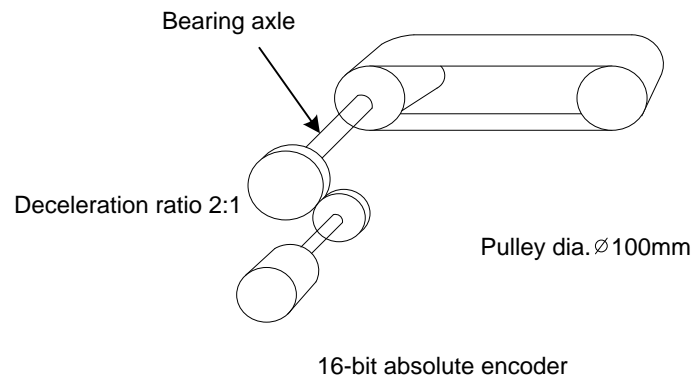


Fig. 5-11 Sample of belt and pulley

Pulses generated per revolution of motor=2¹⁶/2²=16384

Pulley diameter=100mm

Command unit=0.02mm

Amount of movement per revolution of bearing axle= 3.14×100mm/ 0.02mm=15700

$$\text{Electronic Gear Ratio} \frac{B}{A} = \frac{16384 \times 4}{15700} \times \frac{2}{1} = \frac{Pn202}{Pn203}$$



If the calculation result is out of setting range, both the numerator and denominator should be divided by their common divisor.

Table 3 Parameters setting value

Parameter	PN202	PN203
Setting Value	131072	15700

5.4 Driver Parameters

Driver parameters listed in the following chapters can only ensure normal working of a machine tool, without ensuring machining results. To get a better machining result, you need to set those parameters according to actual situations.

5.4.1 Lambda 3S/3L Series

5.4.1.1 Parameter Setting of WISE Servo Driver

Para. No.	Function	Value	Description
Pr528	LED initial status	6	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection in order to determine whether there is electrical interference.
Pr008	Command pulse No. per motor circle	0	When it is set to "0", parameters Pr009 and Pr010 are valid.
Pr009	1 st numerator of command pulse frequency division/multiplication	Need calculation	Range: 0~2 ³⁰ Typical value: pitch 5 mm, encoder resolution 10000, deceleration ratio 1:1, pulse equivalent 0.001 mm:
Pr010	Denominator of command pulse frequency division/multiplication	Need calculation	Pr009=10000 Pr010=pitch 5mm/ pulse equivalent 0.001mm=5000 Pr009/Pr010=10000/5000=2/1
Pr100	1st position loop gain	480 (default)	Unit: 0.1/s. Set it according to the actual situation.
Pr101	1st velocity loop gain	270 (default)	Unit: 0.1Hz. Set it according to the actual situation.
Pr102	1st velocity loop integrated time constant	210 (default)	Unit: 0.1ms. Set it according to the actual situation.
When the value of Pr008 is not "0", it can be calculated in terms of the following formula: $\text{Command pulse No. per motor circle} = \frac{\text{Screw pitch}}{\text{Pulse equivalent} \times \text{Mechanical deceleration ratio}} = \frac{5\text{mm}}{0.001\text{mm} / p} = 5000$ When screw pitch is 5mm and pulse equivalent 0.001, the value of Pr008 is "5000".			

◆ Attached List: the relationship among parameters Pr008, Pr009 and Pr010.

Pr008	Pr009	Pr010	Description
0~2 ²⁰	– (no influence)	– (no influence)	<p>As shown above, the process is undergone in terms of the setting value of Pr008, not affected by the settings of Pr009 and Pr010.</p>
0	0	0~2 ³⁰	<p>When the values of Pr008 and Pr009 are both set to “0”, as shown above, the process is undergone in terms of the setting value of Pr010.</p>
	0~2 ³⁰	0~2 ³⁰	<p>When the value of Pr008 is “0”, but the value of Pr009 is not “0”, as shown above, the process is undergone in terms of the setting values of Pr009 and Pr010.</p>

5.4.1.2 Parameter Setting of YASKAWA Σ -II Servo Driver

Para. No.	Function	Value	Description		
Un00C	Surveillance mode	LXXXX (Hexadecimal system)	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection in order to determine whether there is electrical interference.		
Pn000	Direction selection Control mode selection	0010	Bit 0: Set 0, "CCW" is forward rotation (viewed from the load end of screw ball); Set 1, the rotation direction of the motor is reversed. Bit 1: Set 1, position control mode (calculate pulse instruction all the time).		
Pn001	Selection servo off or alarm stop mode	XXX0	Bit 0: Set "0", stopping the motor by applying dynamic brake(DB) which will be maintained after stop; Set "1", stopping the motor by applying dynamic brake(DB) and then the motor can rotate freely after stop.		
Pn200	Select pulse instruction mode	0005	Bit 0: Set 5, select the instruction input mode as "pulse + direction", negative logic. Bit 3: Set 0, input differential signal into filter.		
Pn201	Encoder cycle-divided ratio (Pulses output per motor cycle by encoder after cycle-divided)	Right-side	Gain Encoder	Type	Encoder Pulse No. per Motor Circle (pulse/ revolution)
				A	13bit 2048
				B	16bit 16384
C	17bit 32768				
Pn202	Electronic gear ratio (numerator)	Need Calculation	Pn202 = pulse No. of each encoder circle \times 4 \times mechanical deceleration ratio. Pn203 = (screw pitch/ pulse equivalent).		
Pn203	Electronic gear ratio (denominator)	Need Calculation	Typical value: pitch 5mm, encoder 17-bit, deceleration ratio 1:1, pulse equivalent 0.001mm, Pn202=16384; Pn203=625. Pitch 5mm, encoder 17-bit, deceleration ratio 1:1, pulse equivalent 0.0005mm, Pn202=8192; Pn203=625.		

5.4.1.3 Parameter Setting of DELTA ASDA-A Servo Driver

Para. No.	Function	Format & Range	Value	Description
P0-02	Driver status display		02	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection to determine if there is electrical interference.
P1-00	External pulse input type	ZYX	102	X=2: pulse + direction; Z=1: negative logic
P1-01	Control mode setup	ZYX1X0	0000	Z=0: during control mode switching, DIO is maintaining the set value. Since switching control mode is not used, Z=0 Y=0: forward rotation (CCW) (in terms of load); Y=1: the rotation direction is reversed. X1X0=00: position control mode
P1-44	Electronic Gear Ratio (Numerator)(N1)	1~32767	Need calculation	$N1/M = \text{encoder pulses} \times 4 \times \text{pulse equivalent} \times \text{mechanical deceleration ratio} / \text{pitch}$
P1-45	Electronic Gear Ratio (Denominator) (M)	1~32767	Need calculation	Representative value: encoder pulses=2500, pitch=5mm, pulse equivalent=0.001, deceleration ratio=1, calculation as below: $N1/M = 2500 \times 4 \times 0.001 / 5 = 2 / 1$, N1=2, M=1; When the multi-electronic gear ratio is not used, P2-60~ P2-62 are not required.
P2-51	Servo ON (SON) setup		0	0: Servo ON must be triggered by numerical input signal. 1: when servo is powered, if there is no alarm signal, servo will be automatically on. Set 1 when there is no SON signal wire.

5.4.1.4 Parameter Setting of DELTA ASDA-B Servo Driver

Para. No.	Function	Format & Range	Value	Description
P0-02	Driver status display		02	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection in order to determine whether there is electrical interference.
P1-00	External pulse train input type	ZYX	102	X=2: pulse + direction; Z=1: negative logic
P1-01	Set control mode	YX1X0	000	Y=0: forward rotation (CCW) (from the view of load); Y=1: the rotation direction is reversed. X1X0=00: position control mode
P1-32	Motor stop mode	YX	00	Y=0: when there is no servo enabled, motor dynamic brake occurs; Y=1: motor is free. X=0: motor stops instantly, X=1: motor stops with deceleration.
P1-44	Electronic Gear Ratio (Numerator)(N1)	1~32767	Need calculation	N1/M= mechanical deceleration ratio \times 4 \times encoder pulses \times pulse equivalent / pitch. Representative value: encoder pulses=2500, pitch =5mm, pulse equivalent=0.001 mm/p, deceleration ratio = 1, calculation as below: $N1 / M = 2500 \times 4 \times 0.001 / 5 = 2 / 1$, N1=2, M=1; When the multi-electronic gear ratio is not used, P2-60 ~P2-62 are not required.
P1-45	Electronic Gear Ratio (Denominator)(M)	1~32767	Need calculation	
P2-30	Servo ON (SON) setup		0	0: Servo ON must be triggered by numerical input signal. 1: when servo is powered, if there is no alarm signal, servo will be automatically on. Set 1 when there is no SON signal wire.

5.4.1.5 Parameter Setting of Panasonic MINAS A4 Servo Driver

Para. No.	Function	Value	Description
Pr01	LED initial status	12	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection in order to determine whether there is electrical interference.
Pr02	Select control mode	0	0: position mode 1: velocity mode 2: torque mode
Pr40	Selection of command pulse input	1	1: input by differential exclusive circuit
Pr42	Select command pulse input mode	3	Set command pulse input mode: command pulse + command direction, negative logic
Pr48	1st numerator of command pulse frequency multiplication	Need calculation Range: 1~10000	Typical value: pitch 5 mm, encoder resolution 10000, deceleration ratio 1:1, pulse equivalent 0.001mm: Pr48=10000
Pr4B	Denominator of the command pulse frequency multiplication	Need calculation Range: 1~10000	Pr4B = pitch 5mm / pulse equivalent 0.001mm=5000 Pr48/Pr4B=10000/5000=2/1



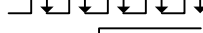



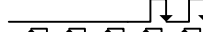



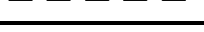

5.4.1.6 Parameter Setting of MITSUBISHI MR-E Servo Driver

Para. No.	Code	Function	Value	Description
0	*STY	Select control mode and regenerative fittings	X0X0	Bit 0, set 0: select position control mode. Bit 1, select motor series: 0: HC-KFE; 1:HC-SFE; Bit 3, select regenerative apparatus, set 0: not use. Bit 4, select motor power.
3	CMX	Electronic gear numerator	Need calculation	CMX/CDV=command unit × servo motor resolution × mechanical deceleration ratio / pitch. E.G., pitch 5 mm, encoder resolution 10000,deceleration ratio 1:1, pulse equivalent 0.001 mm, $CMX/CDV=10000 \times 0.001/5 = 2/1$; When pulse equivalent = 0.0005mm, $CMX/CDV = 1/1$. Electronic gear ratio range: 1/50 ~ 500
4	CDV	Electronic gear denominator	Need calculation	
18	*DMD	Status display selection	00XX	3: cumulative command pulses E: load inertia When the parameter is set [3], monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection to determine if there is electrical interference.
21	*OP3	Function selection 3 (command pulse format selection)	0001	Set pulse command input form: pulse train+ sign, negative logic
41	*DIA	Signal input SON-ON, LSP-ON and LSN-ON automatically selection	0110	Bit 0: Servo-ON selection. [0]: servo on by external input; [1]: servo on all the time inside. Bit 1: last signal of positive rotation range (LSP): [1]: auto servo on inside, without external wiring. Bit 3: last signal of negative rotation range (LSN): [1]: auto servo on inside and no need of external wiring.

5.4.1.7 Parameter Setting of FUJI FALDIC-β Servo Driver

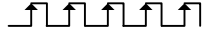Para. No.	Name	Value	Description
01	Command pulse numerator α	Need calculation 1~32767	Command pulse numerator and denominator are equal to those of the electronic gear ratio. $\alpha / \beta = \text{encoder resolution} \times \text{pulse equivalent} \times \text{mechanical deceleration ratio} / \text{screw pitch}$.
02	Command pulse denominator β	Need calculation 1~32767	Typical value: encoder resolution 65536, pitch 5mm, pulse equivalent 0.001, mechanical deceleration ratio 1, $\alpha / \beta = 65536 \times 0.001 / 5 = 8192 / 625$, So $\alpha = 8192$, $\beta = 625$.
03	Pulse string input form	0	Set the input mode of pulse string as: instruction + symbol, that is 'pulse + direction'.
04	Direction of rotation switch	0 or 1	Set 0: Positive direction: Forward rotation (CCW); Set 1: Positive direction: Reverse rotation (CW).
10	CONT1 signal distribution	1	CONT1 is distributed as RUN (i.e. SON); if not distributed, CONT1 will be auto ON if there is no alarming when powered.
11	CONT2 signal distribution	2	CONT2 is distributed as RST (i.e. servo alarming clearance CLR). When 12, 13, 14 are 0, that is CONT3, CONT4 and CONT5 can't be distributed as OT over-travel or EMG (external emergency stop).
15	OUT1 signal distribution	1	Set 1, OUT1 is distributed as a-contact point of alarming output; Set 2, OUT1 is distributed as b-contact point of alarming detection.
27	Parameter write-protection	0 or 1	Set 0, write-enable. Set 1, write-protected.

5.4.1.8 Parameter Setting of STONE GS Servo Driver

Para. No.	Para. Name	Value	Description																							
F0f	Electronic gear ratio numerator	2	Electronic gear ratio of position mode: $4 \times$ pulse frequency fed back by motor encoder = command pulse frequency \times F0f / F10; value of F0f / F10 must be within 1/100~100. (calculation with pitch as 10mm)																							
F10	Electronic gear ratio denominator	1																								
F00	Control mode selection	2	<p>0: External speed running mode; make sure the value and direction of motor speed according to the external analog -10V ~ +10V signal of CN2-16, 17;</p> <p>1: Internal speed running mode; make sure the value and direction of motor speed according to the setting of parameter F33, F35, F37, F39 and the port status of CN2-9, CN2-25;</p> <p>2: Position pulse running mode; accept the input of external position pulse and direction level signal;</p> <p>3: Jog mode; make sure the motor speed in terms of parameter setting of F3b, and control the rotation direction by the direction keystroke ▼ and ▲;</p> <p>4: Torque mode; make sure the value and direction of motor torque according to the external analog -10V ~ +10V signal of CN2-43, 1;</p> <p>5~10: Mixed mode; select mode according to the port input status of CN2-24:</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th rowspan="2">F00 Value</th> <th colspan="2">CN2-24 Interface Status</th> </tr> <tr> <th>OFF (Mode One)</th> <th>ON (Mode Two)</th> </tr> </thead> <tbody> <tr> <td>5</td> <td>Position Pulse Mode</td> <td>External Speed Running Mode</td> </tr> <tr> <td>6</td> <td>Position Pulse Mode</td> <td>Internal Speed Running Mode</td> </tr> <tr> <td>7</td> <td>Position Pulse Mode</td> <td>Torque Mode</td> </tr> <tr> <td>8</td> <td>Internal Speed Running Mode</td> <td>External Speed Running Mode</td> </tr> <tr> <td>9</td> <td>Internal Speed Running Mode</td> <td>Torque Mode</td> </tr> <tr> <td>10</td> <td>External Speed Running Mode</td> <td>Torque Mode</td> </tr> </tbody> </table>	F00 Value	CN2-24 Interface Status		OFF (Mode One)	ON (Mode Two)	5	Position Pulse Mode	External Speed Running Mode	6	Position Pulse Mode	Internal Speed Running Mode	7	Position Pulse Mode	Torque Mode	8	Internal Speed Running Mode	External Speed Running Mode	9	Internal Speed Running Mode	Torque Mode	10	External Speed Running Mode	Torque Mode
F00 Value	CN2-24 Interface Status																									
	OFF (Mode One)	ON (Mode Two)																								
5	Position Pulse Mode	External Speed Running Mode																								
6	Position Pulse Mode	Internal Speed Running Mode																								
7	Position Pulse Mode	Torque Mode																								
8	Internal Speed Running Mode	External Speed Running Mode																								
9	Internal Speed Running Mode	Torque Mode																								
10	External Speed Running Mode	Torque Mode																								
F2e	Pulse input mode selection	2	<p>Command pulse string mode selection of position mode:</p> <p>1 - Single pulse train positive logic Pulse 12 27  Direction 13 28 </p> <p>2 - Single pulse train negative logic Pulse 12 27  Direction 13 28 </p> <p>3 - Double pulse train positive logic CCW 12 27  CW 13 28 </p> <p>4 - Double pulse train negative logic CCW 12 27  CW 13 28 </p> <p>5 - Orthogonal pulse positive logic Phase A 12 27  Phase B 13 28 </p> <p>6 - Orthogonal pulse negative logic Phase A 12 27  Phase B 13 28 </p>																							



5.4.2 Lambda 4S/5S

5.4.2.1 Parameter Setting of WISE Servo Driver

Para. No.	Function	Value	Description
Pr528	LED initial status	6	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection in order to determine whether there is electrical interference.
Pr008	Command pulse No. per motor circle	0	When it is set to "0", parameters Pr009 and Pr010 are valid.
Pr009	1 st numerator of command pulse frequency division/multiplication	Need calculation	Range: 0~2 ³⁰ Typical value: pitch 5 mm, encoder resolution 10000, deceleration ratio 1:1, pulse equivalent 0.001 mm: Pr009=10000
Pr010	Denominator of command pulse frequency division/multiplication	Need calculation	Pr010=pitch 5mm/ pulse equivalent 0.001mm=5000 Pr009/Pr010=10000/5000=2/1
Pr011	Output pulse No. per motor circle	2500 (default)	Typical value: pulse equivalent 0.001mm, screw pitch 10mm without a reduction box, Pr011=2500; screw pitch 5mm, Pr011=1250.
Pr100	1st position loop gain	480 (default)	Unit: 0.1/s. Set it according to the actual situation.
Pr101	1st velocity loop gain	270 (default)	Unit: 0.1Hz. Set it according to the actual situation.
Pr102	1st velocity loop integrated time constant	210 (default)	Unit: 0.1ms. Set it according to the actual situation.
<p>When the value of Pr008 is not "0", it can be calculated in terms of the following formula:</p> $\text{Command pulse No. per motor circle} = \frac{\text{Screw pitch}}{\text{Pulse equivalent} \times \text{Mechanical deceleration ratio}} = \frac{5\text{mm}}{0.001\text{mm} / p} = 5000$ <p>When screw pitch is 5mm and pulse equivalent 0.001, the value of Pr008 is "5000".</p>			

◆ Attached list: the relationship among parameters Pr008, Pr009 and Pr010

Pr008	Pr009	Pr010	Description
0~2 ²⁰	— (no influence)	— (no influence)	

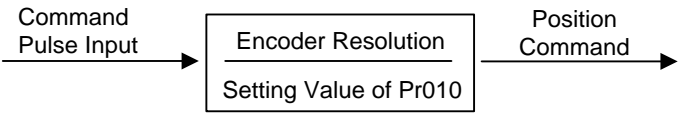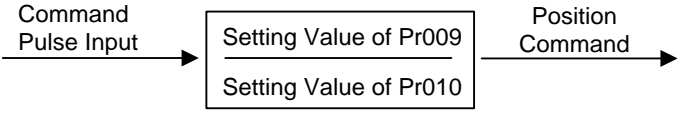Pr008	Pr009	Pr010	Description
			As shown above, the process is undergone in terms of the setting value of Pr008, not affected by the settings of Pr009 and Pr010.
0	0	0~2 ³⁰	 <p>When the values of Pr008 and Pr009 are both set to "0", as shown above, the process is undergone in terms of the setting value of Pr010.</p>
	0~2 ³⁰	0~2 ³⁰	 <p>When the value of Pr008 is "0", but the value of Pr009 is not "0", as shown above, the process is undergone in terms of the setting values of Pr009 and Pr010.</p>

5.4.2.2 Parameter Setting of YASKAWA Σ -II Servo Driver

Para. No.	Function	Value	Description
Fn010	Set password (to prevent arbitrary modification to parameters)	0000	Set [0000]: modification to user parameters [PnXXX] and part of auxiliary function parameters [FnXXX] permitted; Set [0001]: modification to user parameters [PnXXX] and part of auxiliary function parameters [FnXXX] prohibited.
Un00C	Surveillance mode	LXXXX (Hexa-decimal system)	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection in order to determine whether there is electrical interference.
Pn000	Direction selection Control mode selection	0010	Bit 0: Set 0, "CCW" is forward rotation (viewed from the load end of screw ball); Set 1, the rotation direction of the motor is reversed. Bit 1: Set 1, position control mode (calculate pulse instruction all the time).
Pn200	Select pulse instruction mode	0005	Bit 0: Set 5, select the instruction input mode as "pulse + direction", negative logic. Bit 3: Set 0, input differential signal into filter.
Pn50A	Selection function	8100	Bit 1: Set 0, Servo ON /S-ON, input from 40th pin; Set 7, Servo ON all the time. Bit 3: Set 8, positive rotation not used and signal input (P-OT) prohibited.
Pn50B	Selection function	6548	Bit 0: Set 8, reverse rotation not used and signal input (N-OT) prohibited.
Pn50F	Selection function	0300	Set it when servo motor with brakes. Bit 2: Set 3, brake interlock signal "/BK" is output from CN1-29, CN1-30 to control 24V relay for brake.
Pn50E	Selection function	0211	Set it when servo motor with brakes. To avoid of CN1-29 and CN1-30 being used for other function and leading to brake ineffective, "3" is not allowed to appear in the 4 digits.
Pn506	Servo off, time delay of brake when motor stops	Depended	Set it when motor with brakes. Default setting is "0", setting unit is 10ms.

Para. No.	Function	Value	Description
Pn201	PG dividing ratio	Need Calculation	Range: $16 \sim 2^{14}$, set according to the parameter setting of "Frequency Division Pulses of PG (X4)". Typical value: pulse equivalent 0.001, screw pitch 10mm without a reduction box, Pn201=2500; screw pitch 5mm, Pn201=1250.
Pn202	Electronic gear ratio (numerator)	Need Calculation	Pn202 = pulse No. of each encoder circle $\times 4 \times$ mechanical deceleration ratio. Pn203 = (screw pitch/ pulse equivalent). Typical value: pitch 5mm, encoder 17-bit, deceleration ratio 1:1, pulse equivalent 0.001mm, Pn202=16384; Pn203=625.
Pn203	Electronic gear ratio (denominator)	Need Calculation	Pitch 5mm, encoder 17-bit, deceleration ratio 1:1, pulse equivalent 0.0005mm, Pn202=8192; Pn203=625.

5.4.2.3 Parameter Setting of YASKAWA Σ -V / Σ -7 Servo Driver

Para. No.	Function	Value	Description
Fn010	Parameter input prohibition setting	0000	Set [0000]: modification to user parameters [PnXXX] and part of auxiliary function parameters [FnXXX] permitted; Set [0001]: modification to user parameters [PnXXX] and part of auxiliary function parameters [FnXXX] prohibited.
Pn000	Function selection basic switch 0	0010	Bit 0: Set 0, positive rotation at positive rotation command. Bit 1: Set 1, position control mode (pulse sequence command).
Pn200	Format selection switch of position control command	0005	Bit 0: Set 5, select the instruction mode as “pulse + direction”, negative logic.
Pn50A	Input signal selection 1	8100	Bit 1: Set 0, Servo ON /S-ON, input from the 40th pin; Set 7, Servo ON all the time. Bit 3: Set 8, positive rotation not used and signal input (P-OT) prohibited.
Pn50B	Input signal selection 2	6548	Bit 0: Set 8, negative rotation not used and signal input (N-OT) prohibited.
Pn50F	Output signal selection 2	0300	Set it when servo motor with brakes. Bit 2: Set 3, brake interlock signal “/BK” is output from CN1-29, CN1-30 to control 24V relay used for brake.
Pn50E	Output signal selection 1	0211	Set it when servo motor with brakes To avoid of CN1-29 and CN1-30 being used for other function and leading to brake ineffective, 3 is not allowed to appear in the 4 digits.
Pn506	Brake instruction- servo OFF and time delay	Depended	Set it when motor with brakes. Default setting is “0”, setting unit is ms.
Pn20E	Electronic gear ratio (numerator)	Need Calculation	$\frac{Pn20E}{Pn210} = \frac{\text{Encoder resolution} \times \text{Pulse equivalent} \times \text{Deceleration ratio}}{\text{Screw pitch}}$ For example, screw pitch 5mm, 20-bit encoder, deceleration ratio 1:1, pulse equivalent 0.001mm,
Pn210	Electronic gear ratio (denominator)	Need Calculation	$\frac{Pn20E}{Pn210} = \frac{2^{20} \times 0.001}{5} = \frac{1048576}{5000} = \frac{131072}{625}$ When screw pitch is 10mm, $\frac{Pn20E}{Pn210} = \frac{1048576}{10000} = \frac{65536}{625}$ For a rotary axis with 13-bit encoder and deceleration

Para. No.	Function	Value	Description
			ratio as 60, $\frac{Pn20E}{Pn210} = \frac{2^{13} \times 0.001 \times 60}{360} = \frac{8192}{6000} = \frac{512}{375}$
Pn212	Encoder output pulses	Need Calculation	Range: 16~2 ³⁰ , set according to the parameter setting of "Frequency Division Pulses of PG (X4)". Typical value: pulse equivalent 0.001, screw pitch 10mm without a reduction box, Pn212=2500; screw pitch 5mm, Pn212=1250.

5.4.2.4 Parameter Setting of Panasonic MINAS A4 Servo Driver

Para. No.	Function	Value	Description
Pr01	LED initial status	12	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection in order to determine whether there is electrical interference.
Pr02	Select control mode	0	0: position mode 1: velocity mode 2: torque mode
Pr40	Selection of command pulse input	1	1: input by differential exclusive circuit
Pr42	Select command pulse input mode	3	Set command pulse input mode: command pulse + command direction, negative logic
Pr44	Numerator of pulse output division/multiplication	Need calculation	Range: 1~32767, set according to the parameter setting of "Frequency Division Pulses of PG (X4)". Typical value: pulse equivalent 0.001, screw pitch 10mm without a reduction box, Pr44 =2500; screw pitch 5mm, Pr44=1250.
Pr48	1st numerator of command pulse frequency multiplication	Need calculation Range: 1~10000	Typical value: pitch 5 mm, encoder resolution 10000, deceleration 1:1, pulse equivalent 0.001mm: Pr48=10000
Pr4B	Denominator of command pulse frequency multiplication	Need calculation Range: 1~10000	Pr4B = pitch 5mm / pulse equivalent 0.001mm=5000 Pr48/Pr4B=10000/5000=2/1

5.4.2.5 Parameter Setting of Panasonic MINAS A5 Servo Driver

Para. No.	Function	Value	Description
Pr5.28	LED initial status	6	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection in order to determine whether there is electrical interference.
Pr0.01	Select control mode	0	0: position mode 1: velocity mode 2: torque mode
Pr0.05	Selection of command pulse input	XX	0: Photo-coupler input (PULS1, PULS2, SIGN1, SIGN2) 1: Exclusive input for line driver (PULSH1, PULSH2, SIGNH1, SIGNH2) Note: generally, "1" is selected for this parameter.
Pr0.07	Command pulse input mode setup	3	Set command pulse input mode: command pulse + command direction, negative logic.
Pr0.08	Command pulse No. per motor circle	0	When it is set as "0", parameters Pr0.09 and Pr0.10 are valid.
Pr0.09	1st numerator of command pulse frequency multiplication	Need calculation Range: 0~2 ³⁰	Typical value: pitch 5 mm, encoder resolution 10000, deceleration ratio 1:1, pulse equivalent 0.001 mm: Pr0.09=10000 Pr0.10=pitch 5mm/ pulse equivalent 0.001mm=5000 Pr0.09/Pr0.10=10000/5000=2/1
Pr0.10	Denominator of command pulse frequency multiplication	Need calculation Range: 0~2 ³⁰	
Pr0.11	Output pulse No. per motor circle	2500	Range: 1~262144, set according to the parameter setting of "Frequency Division Pulses of PG (X4)". Typical value: pulse equivalent 0.001, screw pitch 10mm without a reduction box, Pr0.11=2500; screw pitch 5mm, Pr0.11=1250.
When the value of Pr0.08 is not "0", it can be calculated in terms of the following formula: $\text{Command pulse No. per motor circle} = \frac{\text{Screw pitch}}{\text{Pulse equivalent} \times \text{Mechanical deceleration ratio}} = \frac{5\text{mm}}{0.001\text{mm} / p} = 5000$ When screw pitch is 5mm and pulse equivalent 0.001, the value of Pr0.08 is "5000".			

◆ Attached List: relationship among parameters Pr0.08, Pr0.09 and Pr0.10

Pr0.08	Pr0.09	Pr0.10	Description
0~2 ²⁰	— (no influence)	— (no influence)	<p>As shown above, the process is undergone in terms of the setting value of Pr0.08, not affected by the settings of Pr0.09 and Pr0.10.</p>
0	0	0~2 ³⁰	<p>When the values of Pr0.08 and Pr0.09 are both set as “0”, as shown above, the process is undergone in terms of the setting value of Pr0.10.</p>
	0~2 ³⁰	0~2 ³⁰	<p>When the value of Pr0.08 is “0”, but the value of Pr0.09 is not “0”, as shown above, the process is undergone in terms of the setting values of Pr0.09 and Pr0.10.</p>

5.4.2.6 Parameter Setting of MITSUBISHI MR-JE Servo Driver

Para. No.	Code	Function	Value	description
PA01	*STY	Operation mode	XXX0	__ _x: select position control mode.
PD24	MBR	Output assignation to CN1-23 pin	XX05	_ _ xx: select MBR (electromagnetic brake interlock).
PA06	CMX	Electronic gear numerator	Need calculation	CMX/CDV=command unit × servo motor resolution × mechanical deceleration ratio / pitch of screw. E.G., pitch 5 mm, encoder resolution 10000, deceleration ratio 1:1, pulse equivalent 0.001 mm, CMX/CDV=10000×0.001/5 = 2/1; When pulse equivalent = 0.0005mm, CMX/CDV = 1/1. Electronic gear ratio range: 1/50 ~ 500
PA07	CDV	Electronic gear denominator	Need calculation	
PC36	*DMD	Status display selection	00XX	__ _xx: status display selection at power-on. This is used to select a status display shown at power-on. 00: cumulative feedback pulses 01: servo motor speed 02: droop pulses 03: cumulative command pulses 04: command pulse frequency
PA13	*PLSS	Command pulse input form	0011	Set command pulse input form: pulse train+ sign, negative logic.
PA15	*ENR	Encoder output pulses	Need calculation	Range: 1~65535, set according to the parameter setting of "Frequency Division Pulses of PG (X4)". Typical value: pulse equivalent 0.001, screw pitch 10mm without a reduction box, PA15=2500; screw pitch 5mm, PA15=1250.
PD03	*DI1L	Input assignation to CN1-15 pin	XX02	_ _xx: select SON under position control mode.

5.4.2.7 Parameter Setting of MITSUBISHI MR-E Servo Driver

Para. No.	Code	Function	Value	Description
0	*STY	Select control mode and regenerative fittings	X0X0	Bit 0: set 0: select position control mode. Bit 1, select motor series: 0: HC-KFE; 1:HC-SFE; Bit 3, select regenerative apparatus, set 0: not use. Bit 4, select motor power.
1	MBR	Function selection 1	001X	Bit 0: input signal filter. If external input signal causes chattering due to noises, etc., input filter is used to suppress it. Bit 1: CN1-12 function selection, set "1": electromagnetic brake interlock (MBR); set "0": zero speed detection signal.
3	CMX	Electronic gear numerator	Need calculation	CMX/CDV=command unit x servo motor resolution x mechanical deceleration ratio / screw pitch. E.G., pitch 5 mm, encoder resolution 10000, deceleration ratio 1:1, pulse equivalent 0.001 mm, CMX/CDV=10000x0.001/5 = 2/1; When pulse equivalent = 0.0005mm, CMX/CDV = 1/1. Electronic gear ratio range: 1/50 ~ 500.
4	CDV	Electronic gear denominator	Need calculation	
18	*DMD	Status display selection	00XX	3: cumulative command pulses E: load inertia When the parameter is set [3], monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection to determine if there is electrical interference.
21	*OP3	Function selection 3 (command pulse format selection)	0001	Set pulse command input form: pulse train+ sign, negative logic
27	*ENR	Encoder output pulses	Need calculation	Range: 1~65535, set according to the parameter setting of "Frequency Division Pulses of PG (X4)". Typical value: pulse equivalent 0.001, screw pitch 10mm without a reduction box, the value is 2500; screw pitch 5mm, the value is 1250.
41	*DIA	Signal input SON-ON, LSP-ON and LSN-ON automatically selection	0110	Bit 0: Servo-ON selection. [0]: servo on by external input; [1]: servo on all the time inside. Bit 1: last signal of positive rotation range (LSP), [1]: auto servo on inside, without external wiring. Bit 3: last signal of negative rotation range (LSN): [1]: auto servo on inside and no need of external wiring.

5.4.2.8 Parameter Setting of DELTA ASDA-A Servo Driver

Para. No.	Function	Format & Range	Value	Description
P0-02	Driver status display		02	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection to determine if there is electrical interference.
P1-00	External pulse input type	ZYX	102	X=2: pulse + direction; Z=1: negative logic
P1-01	Control mode setup	ZYX1X0	0000	Z=0: during control mode switching, DIO is maintaining the set value. Since switching control mode is not used, Z=0 Y=0: forward rotation (CCW) (in terms of load); Y=1: the rotation direction is reversed. X1X0=00: position control mode.
P1-32	Motor stop mode selection	YX	00	Y=0: when there is no servo enabled, motor dynamic brake occurs; Y=1: motor is free. X=0: motor stops instantly, X=1: motor stops with deceleration.
P1-44	Electronic Gear Ratio (Numerator)(N1)	1~32767	Need calculation	$N1/M = \text{encoder pulses} \times 4 \times \text{pulse equivalent} \times \text{mechanical deceleration ratio} / \text{pitch}$
P1-45	Electronic Gear Ratio (Denominator) (M)	1~32767	Need calculation	Representative value: encoder pulses=2500, pitch=5mm, pulse equivalent=0.001, deceleration ratio=1, calculation as below: $N1/M = 2500 \times 4 \times 0.001 / 5 = 2 / 1$, N1=2, M=1; When the multi-electronic gear ratio is not used, P2-60~ P2-62 are not required.
P2-10	Digital input pin DI1	X2X1X0	101	X1X0=01: digital input (DI1=SON) corresponds to 9th pin of CN1. X2 = 1: set DI1 input as NO (normally open) a-contact point.
P2-15	Digital input pin DI6	X2X1X0	100	Default factory setting of DI6 and DI7 are NC (normally closed) limit signal input pins; driver can't run without being connected to pin 32 and pin 31 of CN1. X2=1: set DI6 and DI7 inputs as NO (normally open) a-contact points; X1X0=00,
P2-16	Digital input pin DI7	X2X1X0	100	

Para. No.	Function	Format & Range	Value	Description
				limit signal input of the driver is not used.
P2-17	Function setting for digital input pin DI8	X2X1X0	100	External EMG stop input is not used.
P2-21	Function setting for digital output pin DO4	X2X1X0	108	DO4 corresponds to pin 1 & pin 26, used as clamping-position brake signal of Z-axis; X2=1: set DO4 output as NO (normally open) a-contact point; X2=0: set DO4 output as NC (normally closed) b-contact point; X1X0=08: set pin 1 and pin 26 as BK+ and BK- respectively.
P2-22	Function setting for digital output pin DO5	X2X1X0	007	DO5 corresponds to pin 28 & pin 27, used as servo alarm signal. X2=0: set DO5 output as NC (normally closed) b-contact point. X1X0=07: set pin 28 and pin 27 as ALRM+ and ALRM- respectively.
P2-51	Servo ON (SON) setup		0	0: Servo ON must be triggered by numerical input signal. 1: when servo is powered, if there is no alarm signal, servo will be automatically on. Set 1 when there is no SON signal wire.

5.4.2.9 Parameter Setting of DELTA ASDA-A2 Servo Driver

Para. No.	Function	Format & Range	Value	Description
P0-02	Driver status display		02	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection in order to determine whether there is electrical interference.
P1-00	External pulse train input type	ZYX	102	X=2: pulse + direction; Z=1: negative logic
P1-01	Set control mode	ZYX1X0	0000	Z=0: during control mode switching, DIO is maintaining the set value. Since switching control mode is not used, Z=0; Y=0: forward rotation (CCW) (from the view of load); Y=1: the rotation direction is reversed. X1X0=00: position control mode
P1-44	Electronic Gear Ratio (Numerator)(N1)	1~32767	Need calculation	$\frac{P1-44}{P1-45} = \frac{\text{Encoder resolution} \times \text{Pulse equivalent} \times \text{Deceleration ratio}}{\text{Screw pitch}}$
P1-45	Electronic Gear Ratio (Denominator)(M)	1~32767	Need calculation	When encoder resolution is 1280000, screw pitch 5mm, pulse equivalent 0.001, and deceleration ratio 1:1, $\frac{P1-44}{P1-45} = \frac{1280000 \times 0.001}{5} = \frac{256}{1}$ When the multi-electronic gear ratio is not used, P2-60 ~P2-62 are not required.
P1-46	Encoder output pulse number	20~320000	Need calculation	Set according to the parameter setting of "Frequency Division Pulses of PG (X4)". Typical value: pulse equivalent 0.001, screw pitch 10mm without a reduction box, P1-46=10000; screw pitch 5mm, P1-46=5000.
P2-10	Function setting for digital input pin DI1	X2X1X0	101	X1X0=01: digital input (DI1 = SON) corresponds to 9th pin of CN1. X2=1: set DI1 input as NO (normally open) a-contact point.

Para. No.	Function	Format & Range	Value	Description
P2-15	Function setting for digital input pin DI6	X2X1X0	100	Default factory setting of DI6 and DI7 is NC (normally closed) limit signal input; driver can't run without being connected to pin 32 and pin 31 of CN1. X2=1: set DI6 and DI7 inputs as NO a-contact point. X1X0=00, limit input of driver is not used.
P2-16	Function setting for digital input pin DI7	X2X1X0	100	
P2-17	Function setting for digital input pin DI8	X2X1X0	100	External EMG stop input is not used.
P2-21	Function setting for digital output pin DO4	X2X1X0	108	DO4 corresponds to pin 1 & pin 26, used as clamping-position brake signal of Z-axis; X2=1: set DO4 output as NO (normally open) a-contact point; X2=0: set DO4 output as NC (normally closed) b-contact point; X1X0=08: set pin 1 and pin 26 as BK+ and BK- respectively.
P2-22	Function setting for digital output pin DO5	X2X1X0	007	DO5 corresponds to pin 28 & pin 27, used as servo alarm signal. X2=0: set DO5 output as NC b-contact point. X1X0=07: set pin 28 and pin 27 as ALRM+ and ALRM- respectively.

5.4.2.10 Parameter Setting of DELTA ASDA-B Servo Driver

Para. No.	Function	Format & Range	Value	Description
P0-02	Driver status display		02	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection in order to determine whether there is electrical interference.
P1-00	External pulse train input type	ZYX	102	X=2: pulse + direction; Z=1: negative logic
P1-01	Set control mode	YX1X0	000	Y=0: forward rotation (CCW) (from the view of load); Y=1: the rotation direction is reversed. X1X0=00: position control mode
P1-32	Motor stop mode	YX	00	Y=0: when there is no servo enabled, motor dynamic brake occurs; Y=1: motor is free. X=0: motor stops instantly, X=1: motor stops with deceleration.
P1-44	Electronic Gear Ratio (Numerator)(N1)	1~32767	Need calculation	N1/M= mechanical deceleration ratio \times 4 \times encoder pulses \times pulse equivalent / pitch. Representative value: encoder pulses=2500, pitch =5mm, pulse equivalent=0.001 mm/p, deceleration ratio = 1, calculation as below: $N1 / M = 2500 \times 4 \times 0.001 / 5 = 2 / 1$, N1=2, M=1; When the multi-electronic gear ratio is not used, P2-60 ~P2-62 are not required.
P1-45	Electronic Gear Ratio (Denominator)(M)	1~32767	Need calculation	
P2-10	Function setting for digital input pin 1 (DI1)	X2X1X0	101	X1X0=01: digital input (DI1 = SON) corresponds to 17th pin of CN1. X2=1: set DI1 input as NO (normally open) a-contact point.
P2-15	Function setting for digital input pin DI6	X2X1X0	100	Default factory setting of DI6 is NC (normally closed) limit signal input; driver can't run without being connected to pin 32 and pin 31 of CN1. X2=1: set DI6 input as NO a-contact point. X1X0=00, limit input of the driver is not used.

Para. No.	Function	Format & Range	Value	Description
P2-18	Function setting for digital output pin DO1	X2X1X0	108	DO1 corresponds to 16th pin, as clamping-position brake signal of Z-axis; X2=1: set DO1 output as NO a-contact point; X2=0: set DO1 output as NC b-contact point; X1X0=08: set 16th pin as BK+.
P2-20	Function setting for digital output pin DO3	X2X1X0	007	DO3 corresponds to pin 1, used as servo alarm signal. X2=0: set DO3 output as NC b-contact point. X1X0=07: set pin 1 as ALRM+.

5.4.2.11 Parameter Setting of DELTA ASDA-B2 Servo Driver

Para. No.	Function	Format & Range	Value	Description
P0-02	Driver status display		02	Monitor if the number of sent and received pulses is correct by setting this parameter. In Weihong control system, the correct quantity of pulses sent by control card is detected by pulse inspection in order to determine whether there is electrical interference.
P1-00	External pulse train input type	ZYX	102	X=2: pulse + direction; Z=1: negative logic
P1-01	Set control mode	ZYX1X0	0000	Z=0: during control mode switching, DIO is maintaining the set value. Since switching control mode is not used, Z=0; Y=0: forward rotation (CCW) (from the view of load); Y=1: the rotation direction is reversed. X1X0=00: position control mode
P1-44	Electronic Gear Ratio (Numerator)(N1)	1~32767	Need calculation	N1/M= mechanical deceleration ratio × 4 × encoder pulses× pulse equivalent / pitch. Representative value: encoder pulses=40000, pitch =5mm, pulse equivalent=0.001, deceleration ratio = 1, calculation as below:
P1-45	Electronic Gear Ratio (Denominator) (M)	1~32767	Need calculation	N1 / M = 40000×4×0.001/5 = 32/1, N1=32, M=1; When the multi-electronic gear ratio is not used, P2-60 ~P2-62 are not required.
P1-46	Encoder output pulse number	20~40000	Need calculation	Set according to the parameter setting of "Frequency Division Pulses of PG (X4)". Typical value: pulse equivalent 0.001, screw pitch 10mm without a reduction box, P1-46=10000; screw pitch 5mm, P1-46=5000.
P2-10	Digital Input Pin DI1	X2X1X0	101	X1X0=01: digital input (DI1 = SON) corresponds to 9th pin of CN1. X2=1: set DI1 input as NO (normally open) a-contact point.

Para. No.	Function	Format & Range	Value	Description
P2-15	Function setting for digital input pin DI6	X2X1X0	000	Default factory setting of DI6 and DI7 is NC (normally closed) limit signal input; driver can't run without being connected to pin 32 and pin 31 of CN1.
P2-16	Function setting for digital input pin DI7	X2X1X0	000	X2=0: set DI6 and DI7 inputs as NC b-contact point. X1X0=00, limit input of driver is not used.
P2-17	Function setting for digital input pin DI8	X2X1X0	000	External EMG stop input is not used.
P2-18	Function setting for digital output pin DO1	X2X1X0	108	DO1 corresponds to pin 6 & pin 7, used as clamping-position brake signal of Z-axis; X2=1: set DO1 output as NO (normally open) a-contact point; X2=0: set DO1 output as NC (normally closed) b-contact point; X1X0=08: set pin 6 and pin 7 as BK- and BK+ respectively.
P2-22	Function setting for digital output pin DO5	X2X1X0	007	DO5 corresponds to pin 28 & pin 27, used as servo alarm signal. X2=0: set DO5 output as NC b-contact point. X1X0=07: set pin 28 and pin 27 as ALRM+ and ALRM- respectively.

5.4.2.12 Parameter Setting of SANYO PY Servo Driver

Para. No.	Abbr.	Name	Standard Value	Setting Range	Unit	Remark
1-2	EGER	Electronic gear ratio	4/1	1/32767 to 32767/1		Depend on the specific encoder resolution. The formula of electronic gear ratio of servo driver is as below: Electronic gear ratio numerator = mechanical deceleration ratio × 4 × pulse No. per encoder circle; Electronic gear ratio denominator = (screw pitch / pulse equivalent) E.G. In Weihong system, the default pulse equivalent is 0.001mm/p, screw pitch is 5mm, pulse number per encoder circle is 2000 and deceleration ratio is 1:1; so the numerator of the electronic gear ratio is 8, and the denominator is 5. (Select an incremental type encoder)
1-16	MENP	Pulse amount of the motor encoder 1. Set the pulse amount of the motor encoder; 2. Standard configuration of the encoder pulse No. is as below. Incremental encoder omitting wiring: --2000P/R Absolute encoder:--2048P/R		500 to 65535	P/R	
2-0	PMOD	Pulse format of position command: Our system uses: direction + pulse format, the parameters are shown as following:				

Para. No.	Abbr.	Name	Standard Value	Setting Range	Unit	Remark																																																	
		<p>PMOD</p> <table border="1" style="display: inline-table; margin-right: 20px;"> <tr><td>7</td><td>6</td><td>5</td><td>4</td><td>3</td><td>2</td><td>1</td><td>0</td></tr> </table> <div style="display: flex; justify-content: space-between;"> <div style="width: 45%;"> <table border="1" style="margin-bottom: 10px;"> <tr><th>Bit 1</th><th>Bit 0</th><th>Command Pulse Input Digital Filter Min. Pulse Width</th></tr> <tr><td>0</td><td>0</td><td>0.8μs</td></tr> <tr><td>0</td><td>1</td><td>0.2μs</td></tr> <tr><td>1</td><td>0</td><td>0.4μs</td></tr> <tr><td>1</td><td>1</td><td>1.6μs</td></tr> </table> <table border="1" style="margin-bottom: 10px;"> <tr><th>Bit 1</th><th>Bit 0</th><th>Command Pulse Input Digital Filter Min. Pulse Width</th></tr> <tr><td>0</td><td>0</td><td>3.2μs</td></tr> <tr><td>0</td><td>1</td><td>0.8μs</td></tr> <tr><td>1</td><td>0</td><td>1.6μs</td></tr> <tr><td>1</td><td>1</td><td>6.4μs</td></tr> </table> <table border="1" style="margin-bottom: 10px;"> <tr><th>Bit6</th><th>Bit5</th><th>Command Pulse Format</th></tr> <tr><td>1</td><td>0</td><td>Direction + Pulse</td></tr> </table> <table border="1"> <tr><th colspan="2">Switch of Digital Filter</th></tr> <tr><td>0</td><td>High Speed</td></tr> <tr><td>1</td><td>Low Speed (1/4)</td></tr> </table> </div> <div style="width: 50%;"> <p>When bit 7=0</p> <p>When bit 7=1</p> </div> </div>	7	6	5	4	3	2	1	0	Bit 1	Bit 0	Command Pulse Input Digital Filter Min. Pulse Width	0	0	0.8μs	0	1	0.2μs	1	0	0.4μs	1	1	1.6μs	Bit 1	Bit 0	Command Pulse Input Digital Filter Min. Pulse Width	0	0	3.2μs	0	1	0.8μs	1	0	1.6μs	1	1	6.4μs	Bit6	Bit5	Command Pulse Format	1	0	Direction + Pulse	Switch of Digital Filter		0	High Speed	1	Low Speed (1/4)			
7	6	5	4	3	2	1	0																																																
Bit 1	Bit 0	Command Pulse Input Digital Filter Min. Pulse Width																																																					
0	0	0.8μs																																																					
0	1	0.2μs																																																					
1	0	0.4μs																																																					
1	1	1.6μs																																																					
Bit 1	Bit 0	Command Pulse Input Digital Filter Min. Pulse Width																																																					
0	0	3.2μs																																																					
0	1	0.8μs																																																					
1	0	1.6μs																																																					
1	1	6.4μs																																																					
Bit6	Bit5	Command Pulse Format																																																					
1	0	Direction + Pulse																																																					
Switch of Digital Filter																																																							
0	High Speed																																																						
1	Low Speed (1/4)																																																						
4-3	TYPE	<p>Control mode: *Select one control mode from position, velocity, and torque modes.</p> <table border="1" style="width: 100%; text-align: center;"> <thead> <tr> <th>Selection Item</th> <th>Content</th> </tr> </thead> <tbody> <tr><td>Position</td><td>Position control mode</td></tr> <tr><td>Velocity</td><td>Velocity control mode</td></tr> <tr><td>Torque</td><td>Torque control mode</td></tr> <tr><td>Velo ↔ Torq</td><td>Velocity ↔ Torque switch mode</td></tr> <tr><td>Posi ↔ Torq</td><td>Position ↔ Torque switch mode</td></tr> <tr><td>Posi ↔ Velo</td><td>Position ↔ Velocity switch mode</td></tr> </tbody> </table> <p>Referring to the switch type, the requisite control mode can be selected from pin 36 or 35 of the CN1. Func3, set Bit7 as 0: pin 36 is enabled. set Bit7 as 1: pin 35 is enabled.</p> <p>\$\$\$: standard value varies with the reset setup (leave factory setting).</p>	Selection Item	Content	Position	Position control mode	Velocity	Velocity control mode	Torque	Torque control mode	Velo ↔ Torq	Velocity ↔ Torque switch mode	Posi ↔ Torq	Position ↔ Torque switch mode	Posi ↔ Velo	Position ↔ Velocity switch mode			6 types	Our system selects position control mode.																																			
Selection Item	Content																																																						
Position	Position control mode																																																						
Velocity	Velocity control mode																																																						
Torque	Torque control mode																																																						
Velo ↔ Torq	Velocity ↔ Torque switch mode																																																						
Posi ↔ Torq	Position ↔ Torque switch mode																																																						
Posi ↔ Velo	Position ↔ Velocity switch mode																																																						

5.4.2.13 Parameter Setting of SANYO R Servo Driver

Para. No.	Parameter Name	Set Value	Remarks
Group 0, parameter setting of tuning mode			
00	Setting of the tuning mode	00	Set as auto tuning mode
Group 8, setting of the control parameters			
00	Polarity of position input	00	Position command mode: positive rotation effective
11	Input command mode	02	Pulse + negative logic
15	Setting of electronic gear	8/5	It depends on the resolution of the specific encoder. E.G.: incremental encoder 2000, the motor needs 2000 \times 4=8000 pulses per circle. When pulse equivalent of Weihong CNC system is 0.001mm/p, it needs 1000 pulses to move 1mm along line; in other words, if the screw pitch is 5, so, to move 5mm along line needs 5000 pulses, so $F=8000/5000=8/5$.
Group 9, setting of function effective			
05	Servo ON selection	02	Select servo ON state.
02	Servo alarm elimination	10	Make the function of servo alarm effective.
Setting of the system parameters			
02	Encoder selection	00	Standard incremental encoder. The parameter depends on the specific situation, what we list is only the representative one.
03	Encoder resolution	2000	500—65535, set the encoder resolution manually.
08	Control mode selection	02	Select position control mode.

5.4.2.14 Parameter Setting of SANYO Q Servo Driver

Para. No.	Parameter Name	Set Value	Remarks
Group 1			
GER1	Electronic gear ratio 1	1/1	Set electronic gear ratio for position command pulse. E.G., incremental encoder 2000, the motor needs 2000×4=8000 pulses per circle. When pulse equivalent of Weihong CNC system is 0.001mm/p, it needs 1000 pulses to move 1mm along line, in other words, if the screw pitch is 5, to move 5mm along line needs 5000 pulses, so $F=8000/5000=8/5$.
GER2	Electronic gear ratio 2	1/1	This setting is the same as that of electronic gear ratio 1 and activated during electronic gear switching.
Group 4			
PA400	Command pulse selection	00H	Set position command pulse as "pulse + direction".
Group 8			
S-ON	Servo ON	02H	Select servo ON state.
AL-RST	Alarm reset	10H	Make the function of servo alarm effective.
Setting of the system parameters			
01	Encoder selection	00	Standard incremental encoder. The parameter depends on the specific situation, what we list is only the representative one.
03	Incremental encoder resolution	2000	500—65535, set the encoder resolution manually.
08	Control mode selection	02	Select position control mode.

5.4.2.15 Parameter Setting of KT270 Servo Driver

Para. No.	Parameter Name	Value	Description
PA4	Control mode selection	0	The control mode of the driver can be set through this parameter: 0: position control mode; 1: speed control mode; 2: trial run control mode; 3: JOG control mode.
PA12	Numerator of position command pulse ratio	2	Set the ratio of the position command pulse (electronic gear). Under position control mode, with the setting of the PA12 and PA13, it is convenient to match with pulse source of each type, which can reach users' perfect control resolution (that is angle/pulse). Expression: $P \times G = N \times C \times 4$ P: pulse amount of the input command; G: electronic gear ratio, G=ratio numerator / ratio denominator. N: circle number that the motor rotates; C: each circle line number of photo electricity encoder, C of our system =2500. E.G.: input command pulse with number of 6000 to make the servo motor rotate one circle, $G = \frac{N \times C \times 4}{P} = \frac{1 \times 2500 \times 4}{6000} = \frac{5}{3}$ So set PA12 as 5 and PA13 as 3. We recommend the range of electronic gear ratio as: $\frac{1}{50} \leq G \leq 50$
PA13	Denominator of the position command pulse ratio	1	Refer to parameter PA12.
PA14	Input mode of the position command pulse	0	Set the input mode of the position command pulse; there are following three modes which can be selected by setting the parameter: 0: pulse + symbol; 1: positive rotation pulse / negative rotation pulse; 2: two orthogonal pulses inputs

Para. No.	Parameter Name	Value	Description
PA20	Invalid input on the end of the stroke	1	<p>0: Valid stroke end of LSP, LSN positive rotation, negative rotation. When switch LSP is connected, driving of the positive rotation is allowed; When switch LSP is disconnected, driving of the positive rotation is prohibited (torque of the positive direction is 0). LSN is the same as LSP. If LSP and LSN are both disconnected, the abnormal alarming of driving prohibited will occur (NO.7).</p> <p>1: Invalid stroke end of LSP, LSN positive rotation, negative rotation. No matter which state of the switch LSP and LSN is in, driving of positive rotation and negative rotation are both allowed. Simultaneously, even if LSP and LSN are both disconnected, abnormal alarming of driving prohibited will not occur (NO.7).</p> <p>2: Invalid stroke end of LSP, LSN positive rotation, negative rotation, and SON is forced to be effective. (Note: SON forcedly effective is only used for motor debugging. In normal use, we suggest controlling the state of SON by input port.)</p> <p>3: Valid stroke end of LSP, LSN positive rotation, negative rotation. When switch LSP is connected, driving of the positive rotation is allowed; When switch LSP is disconnected, driving of the positive rotation is prohibited (the speed of positive direction is 0, but the torque is not 0). LSN is the same as LSP. When LSP and LSN are both disconnected, abnormal alarming of driving prohibited will not occur (NO.7).</p>

5.4.2.16 Parameter Setting of FUJI FALDIC-β Servo Driver


Para. No.	Name	Value	Description
01	Command pulse numerator α	Need calculation 1~32767	Command pulse numerator and denominator are also equal to those of the electronic gear ratio. $\alpha / \beta = \text{encoder resolution} \times \text{pulse equivalent} \times \text{mechanical deceleration ratio} / \text{screw pitch}$.
02	Command pulse denominator β	Need calculation 1~32767	Typical value: encoder resolution 65536, pitch 5mm, pulse equivalent 0.001, mechanical deceleration ratio 1, $\alpha / \beta = 65536 \times 0.001 / 5 = 8192 / 625$, So $\alpha = 8192$, $\beta = 625$.
03	Pulse string input form	0	Set the input mode of pulse string as: instruction + symbol, that is 'pulse + direction'.
04	Direction of rotation switch	0 or 1	Set 0: Positive direction: Forward rotation (CCW); Set 1: Positive direction: Reverse rotation (CW).
10	CONT1 signal distribution	1	CONT1 is distributed as RUN (i.e. SON); if not distributed, CONT1 will be auto ON if there is no alarming when powered.
11	CONT2 signal distribution	2	CONT2 is distributed as RST (i.e. servo alarming clearance CLR). When 12, 13, 14 are 0, that is CONT3, CONT4 and CONT5 can't be distributed as OT over-travel or EMG (external emergency stop).
15	OUT1 signal distribution	1	Set 1, OUT1 is distributed as a-contact point of alarming output; Set 2, OUT1 is distributed as b-contact point of alarming detection.
27	Parameter write-protection	0 or 1	Set 0, write-enable. Set 1, write-protected.
74	CONT Always ON 1	1	Its initial value is 0, and it is set "1" here to enable servo (RUN).

5.4.2.17 Parameter Setting of Stone GS Servo Driver

Para. No.	Para. Name	Value	Description																							
F0f	Electronic gear ratio numerator	2	Electronic gear ratio of position mode: $4 \times \text{pulse frequency fed back by servo encoder} = \text{command pulse frequency} \times F0f / F10$; value of $F0f / F10$ must be within $1/100 \sim 100$. (calculation with pitch as 10mm)																							
F10	Electronic gear ratio denominator	1																								
F00	Control mode selection	2	<p>0: External speed running mode; make sure the value and direction of motor speed according to the external analog $-10V \sim +10V$ signal of CN2-16, 17;</p> <p>1: Internal speed running mode; make sure the value and direction of motor speed according to the setting of parameter F33, F35, F37, F39 and the port status of CN2-9, CN2-25;</p> <p>2: Position pulse running mode; accept the input of external position pulse and direction level signal;</p> <p>3: Jog mode; make sure the motor speed in terms of parameter setting of F3b, and control the rotation direction by the direction keystroke ▼ and ▲;</p> <p>4: Torque mode; make sure the value and direction of motor torque according to the external analog $-10V \sim +10V$ signal of CN2-43, 1;</p> <p>5~10: Mixed mode; select mode according to the port input status of CN2-24:</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th rowspan="2">F00 Value</th> <th colspan="2">CN2-24 Interface Status</th> </tr> <tr> <th>OFF (Mode One)</th> <th>ON (Mode Two)</th> </tr> </thead> <tbody> <tr> <td>5</td> <td>Position Pulse Mode</td> <td>External Speed Running Mode</td> </tr> <tr> <td>6</td> <td>Position Pulse Mode</td> <td>Internal Speed Running Mode</td> </tr> <tr> <td>7</td> <td>Position Pulse Mode</td> <td>Torque Mode</td> </tr> <tr> <td>8</td> <td>Internal Speed Running Mode</td> <td>External Speed Running Mode</td> </tr> <tr> <td>9</td> <td>Internal Speed Running Mode</td> <td>Torque Mode</td> </tr> <tr> <td>10</td> <td>External Speed Running Mode</td> <td>Torque Mode</td> </tr> </tbody> </table>	F00 Value	CN2-24 Interface Status		OFF (Mode One)	ON (Mode Two)	5	Position Pulse Mode	External Speed Running Mode	6	Position Pulse Mode	Internal Speed Running Mode	7	Position Pulse Mode	Torque Mode	8	Internal Speed Running Mode	External Speed Running Mode	9	Internal Speed Running Mode	Torque Mode	10	External Speed Running Mode	Torque Mode
F00 Value	CN2-24 Interface Status																									
	OFF (Mode One)	ON (Mode Two)																								
5	Position Pulse Mode	External Speed Running Mode																								
6	Position Pulse Mode	Internal Speed Running Mode																								
7	Position Pulse Mode	Torque Mode																								
8	Internal Speed Running Mode	External Speed Running Mode																								
9	Internal Speed Running Mode	Torque Mode																								
10	External Speed Running Mode	Torque Mode																								
F2e	Pulse input mode selection	2	<p>Command pulse string mode selection of position mode:</p> <p>1 - Single pulse train positive logic Pulse 12 27 Direction 13 28 </p> <p>2 - Single pulse train negative logic Pulse 12 27 Direction 13 28 </p> <p>3 - Double pulse train positive logic CCW 12 27 CW 13 28 </p> <p>4 - Double pulse train negative logic CCW 12 27 CW 13 28 </p> <p>5 - Orthogonal pulse positive logic Phase A 12 27 Phase B 13 28 </p> <p>6 - Orthogonal pulse negative logic Phase A 12 27 Phase B 13 28 </p>																							

5.4.2.18 Parameter Setting of TECO TSDA Servo Driver

Para. No.	Function	Value	Description		
Pn010-1	Set control mode	1	Value	Control mode	
				CN1 Pin12 open circuit	CN1 Pin12 closed circuit
			0	Speed control	Speed control
			1	Position control	Position control
			2	Torque control	Torque control
			3	Speed control	Speed control
			4	Position control	Position control
Pn010-2	Set the pulse input format under position control mode	0	Value	The format of pulse input	
				0	Pulse + direction
			1	Dipulse	
			2	A/B phase difference	
Pn010-3	Set rotation direction of motor	1	Value	Function	
				0	Motor rotates CCW with input of positive order.
			1	Motor rotates CW with input of positive order.	
Pn021	Electronic gear ratio numerator	5	The input pulse amount will be multiplied by this number before output. Ratio range of parameter 21 to 22: $1/127 < \text{parameter 21} / \text{parameter 22} < 127$		
Pn022	Electronic gear ratio denominator	1			
Pn011-4	Set the function of Pin20 of CN1	1	Value	Function	
				0	Output of "0" speed signal
			1	Output of brake signal	
Pn013-1	Set the max. pulse frequency received by the driver under position control mode	7	It can correct the phenomenon of unauthorized over-travel. Received frequency is divided into 8 segments from 500Kpps to 200Kpps. "0" indicates 500Kpps while "7" 200Kpps.		

 


For the parameter setting of driver of various brands, refer to the specific driver manual.

5.5 Wiring Diagram of Controller and Driver


5.5.1 Lambda 3S/3L Series

5.5.1.1 Wiring with Stepping Driver with Common Port

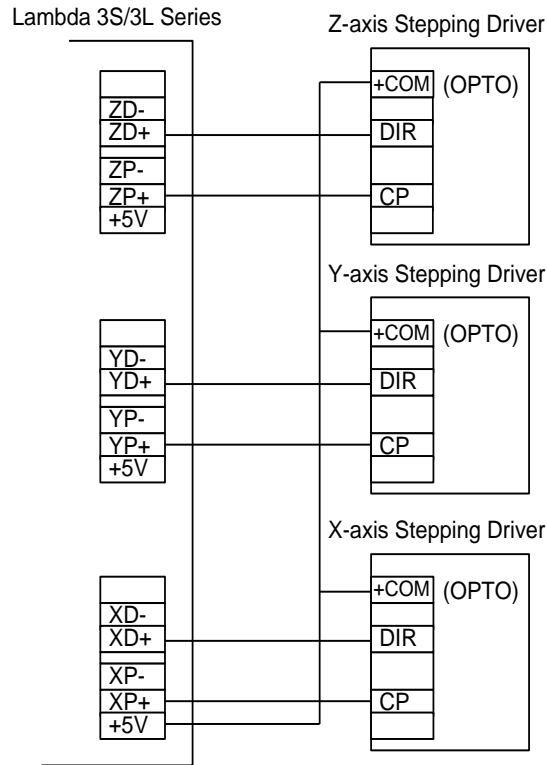


5.5.1.2 Wiring With Differential Input Stepping Driver

It is strongly recommended to connect Lambda 3S/3L series with differential input stepping driver following the connection method below, for this connection method can reduce interference effectively.

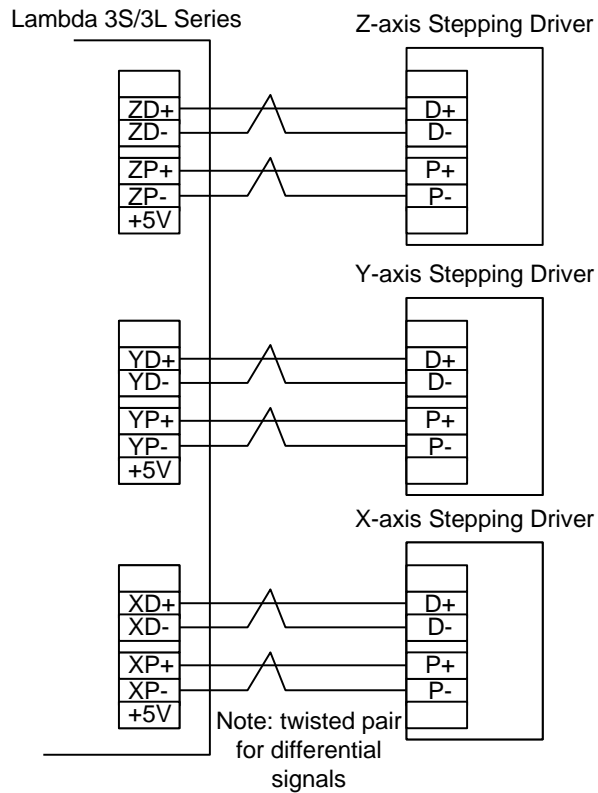

5.5.1.3 Wiring with WISE Servo Driver

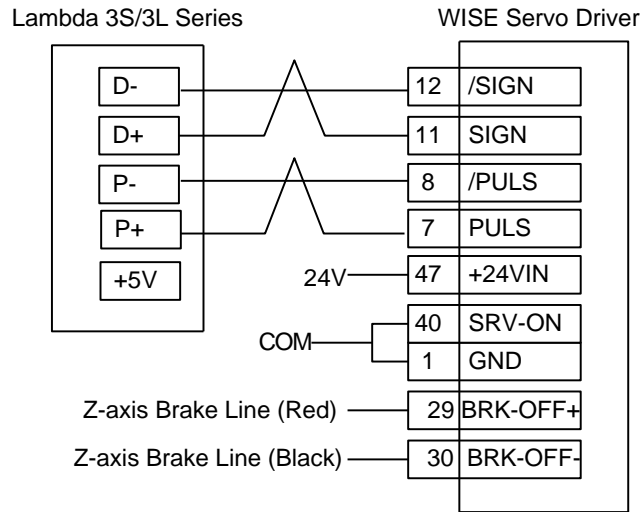


Note: twisted pair for differential signals





Wirings of X axis, Y axis, and Z axis are the same. Only Z axis has two brake signal lines which can be connected to relay to control brake.

5.5.1.4 Wiring with YASKAWA Σ -II Servo Driver

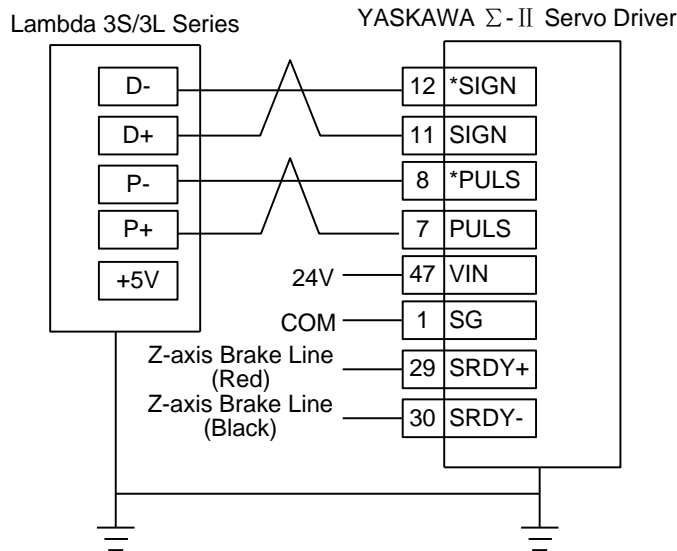


Wirings of X axis, Y axis, and Z axis are the same. Only Z axis has two brake signal lines which can be connected to relay to control brake.

5.5.1.5 Wiring with DELTA ASDA-A/AB Servo Driver

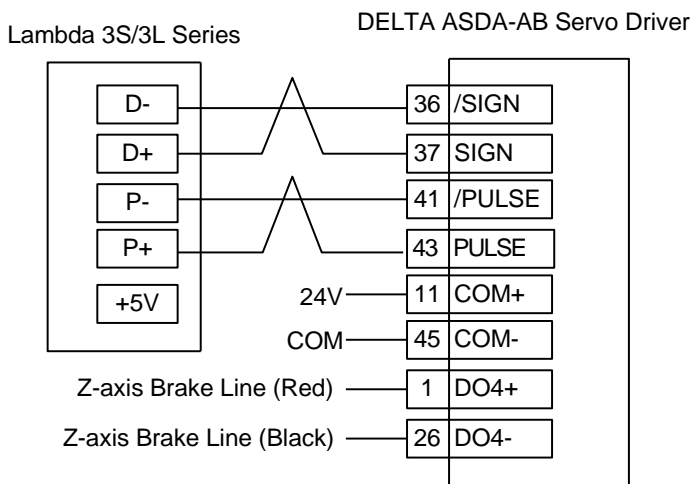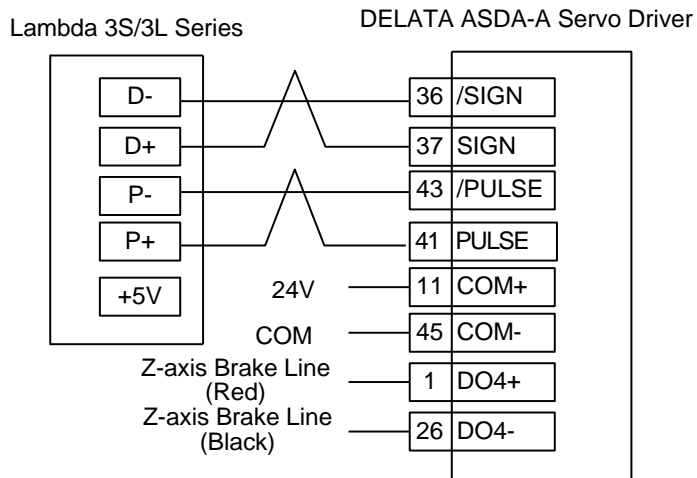


Wirings of X axis, Y axis, and Z axis are the same. Only Z axis has two brake signal lines which can be connected to relay to control brake.

5.5.1.6 Wiring with PANASONIC MINAS A4 Servo Driver

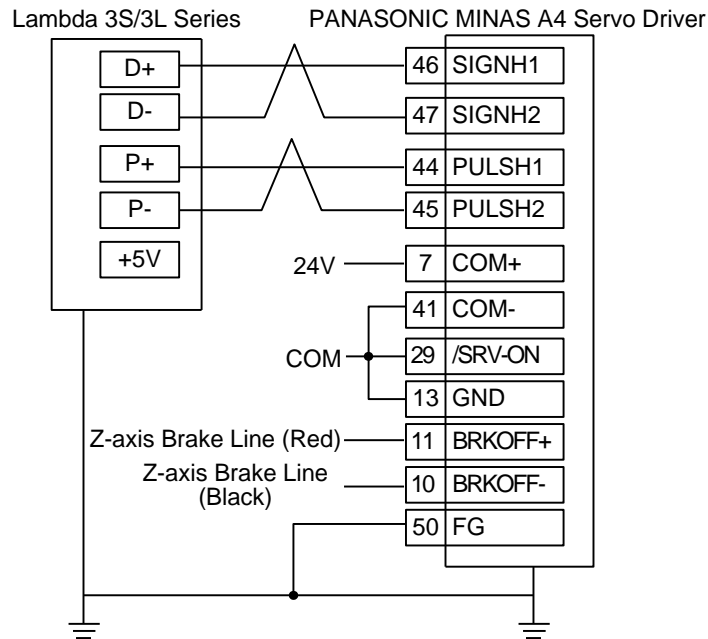


Wirings of X axis, Y axis, and Z axis are the same. Only Z axis has two brake signal lines which can be connected to relay to control brake.

5.5.1.7 Wiring with MITSUBISHI MR-E Servo Driver


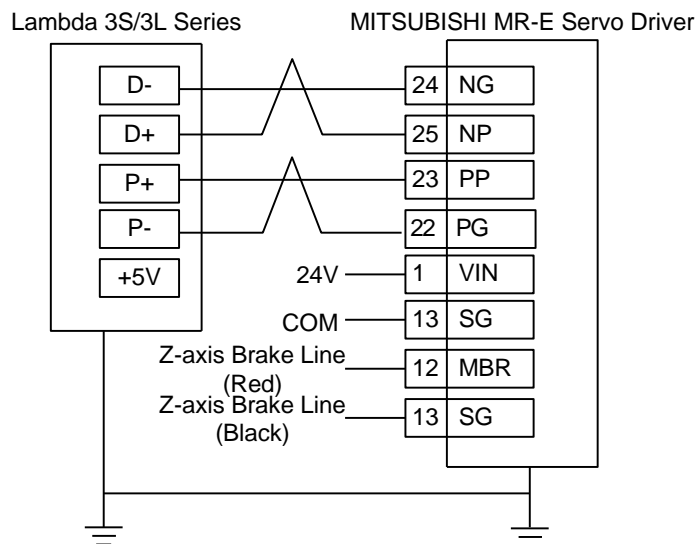


Wirings of X axis, Y axis, and Z axis are the same. Only Z axis has two brake signal lines which can be connected to relay to control brake.

5.5.1.8 Wiring with FUJI FALDIC-β Servo Driver

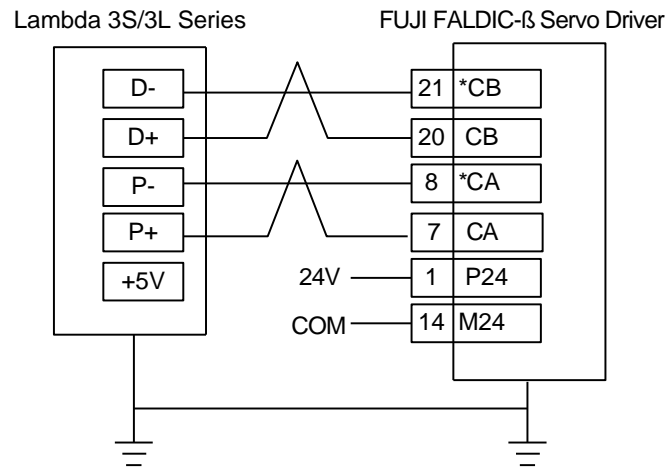

 5.5.1.9 Wiring with STONE GS Servo Driver

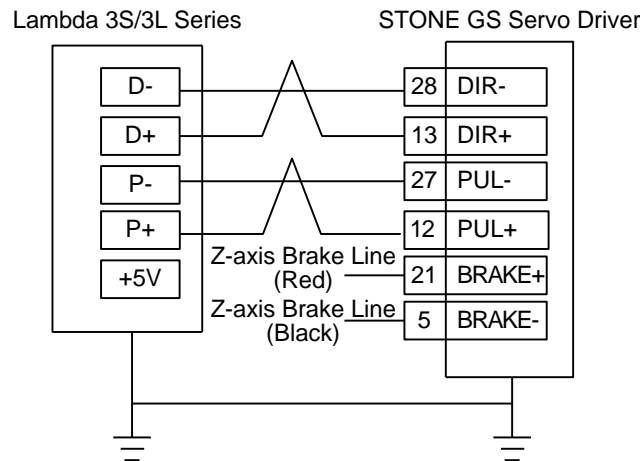


Wirings of X axis, Y axis, and Z axis are the same. Only Z axis has two brake signal lines which can be connected to relay to control brake.


5.5.2 Lambda 4S/5S Series

Wiring diagrams in this part are the wiring diagrams of control system-axes control-driver motion. When users want to use one axis of the control system to control the motion of two drivers, the wiring diagram is as shown in Figure 2 in chapter 5.5.2.2 and Figure 4 in chapter 5.5.2.6 (take YASKAWA driver and DELTA driver as an example; for YASKAWA server, its alarm signal wiring is NC type, while for DELTA server, its alarm signal wiring is NO type).

5.5.2.1 Wiring Diagram with WISE Servo Driver


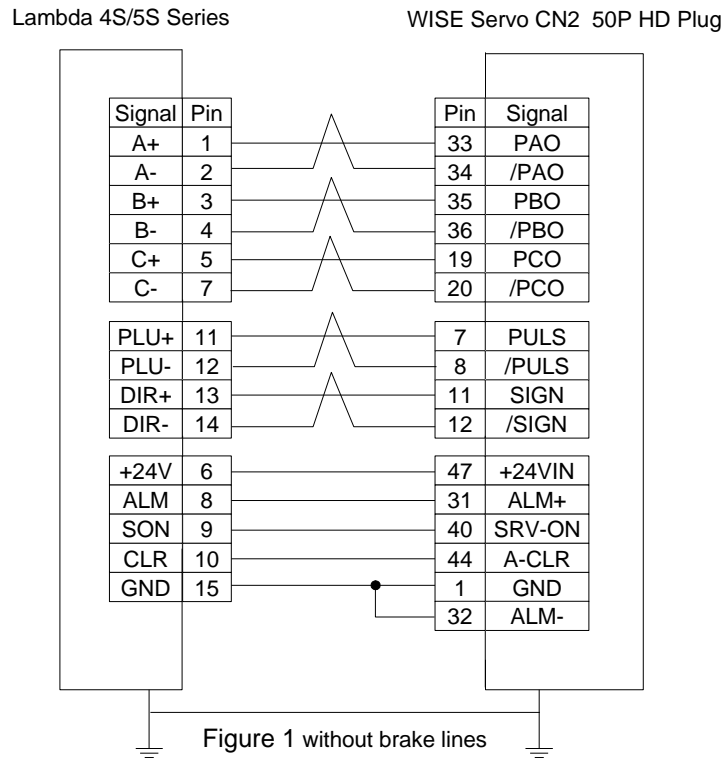


Note: twisted pair for differential signals.

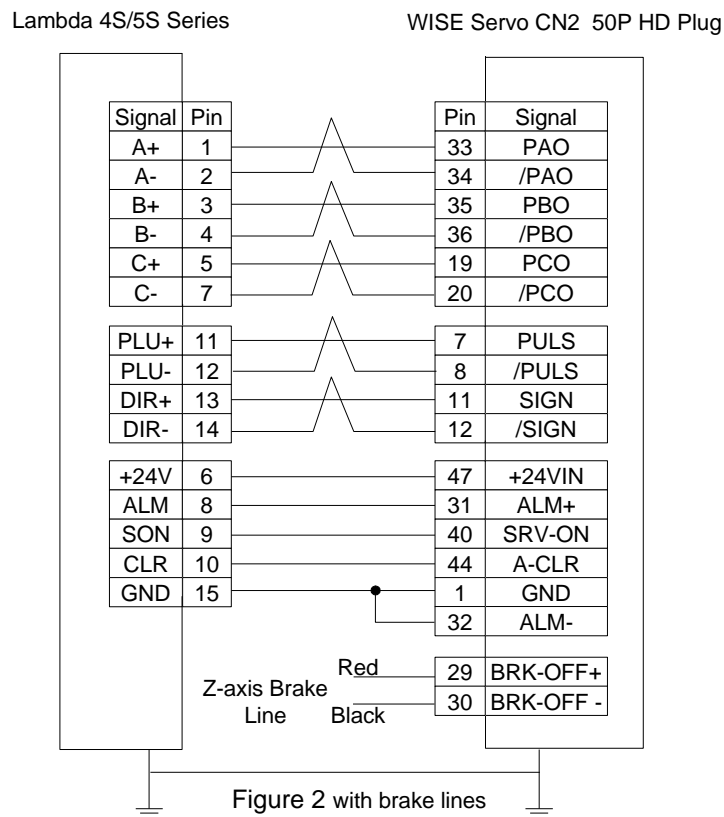


Note: twisted pair for differential signals.


5.5.2.2 Wiring Diagram with YASKAWA AC Servo Driver

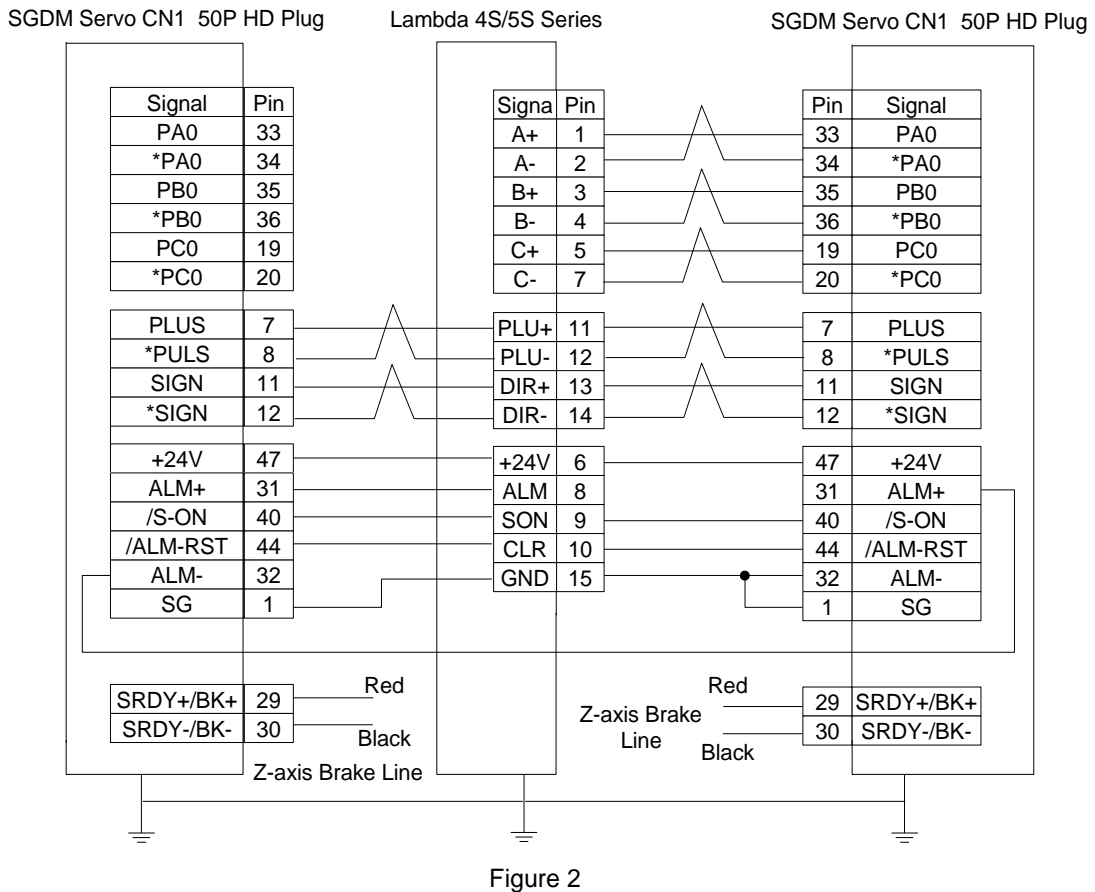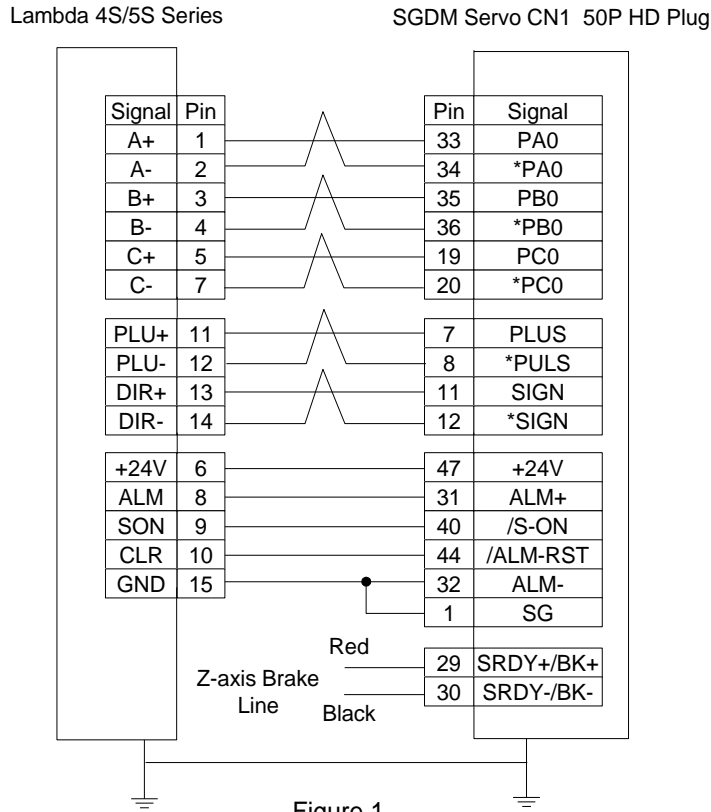


5.5.2.3 Wiring Diagram with PANASONIC AC Servo Driver

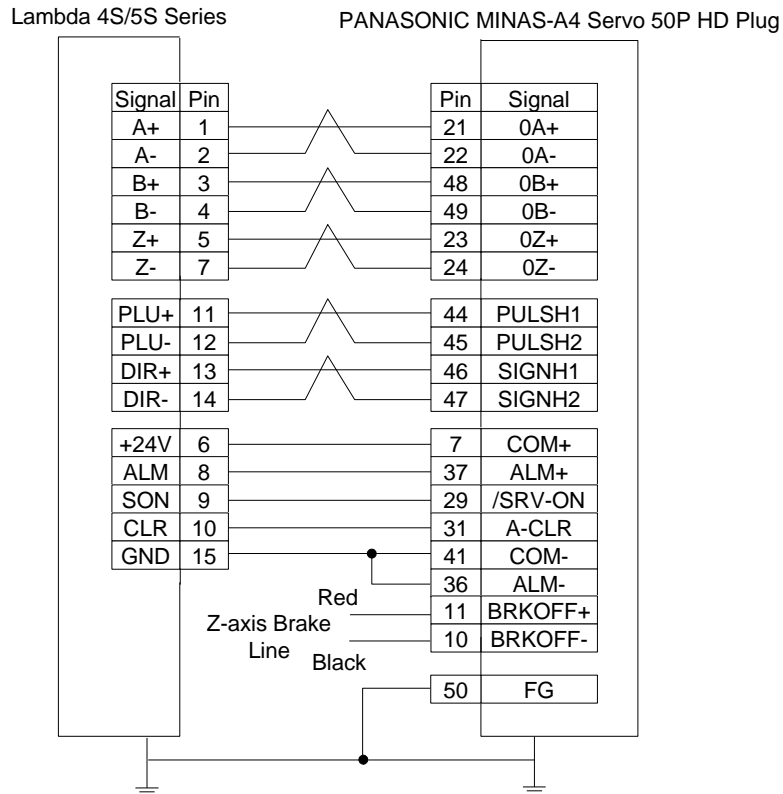

5.5.2.4 Wiring Diagram with MITSUBISHI MR-JE Servo Driver

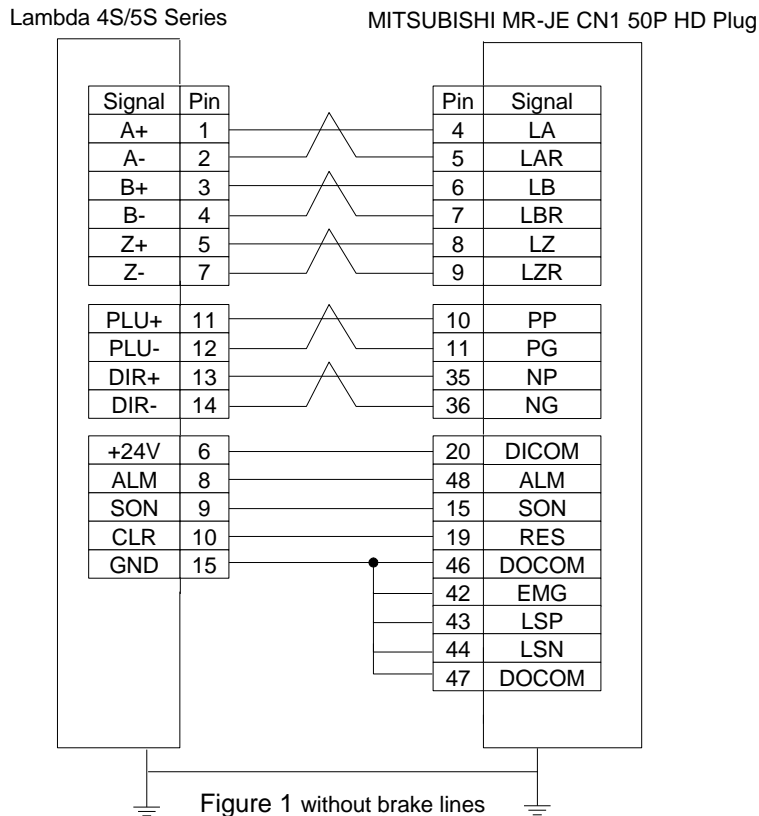


Note: twisted pair for differential signals.

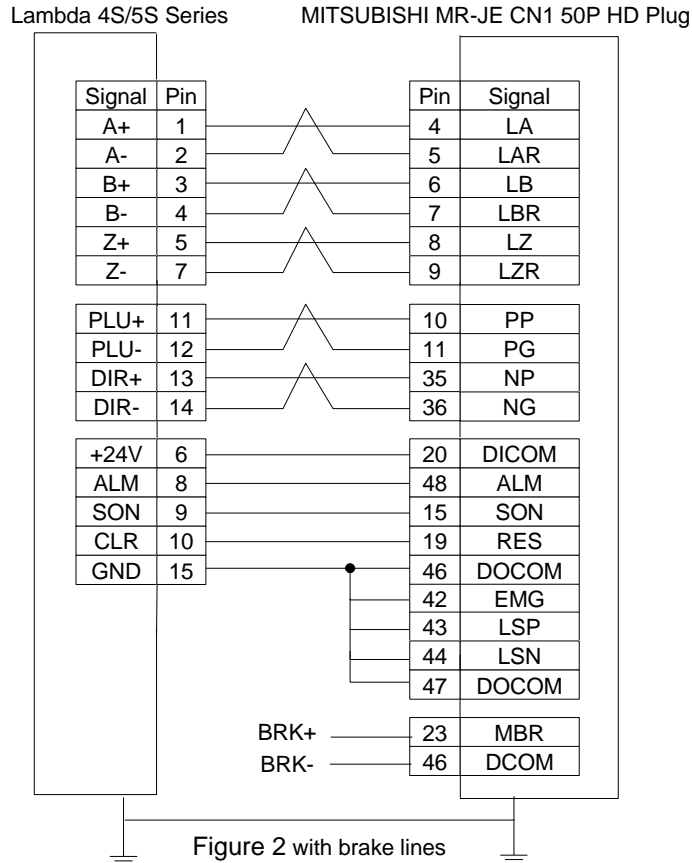



Note: twisted pair for differential signals.

5.5.2.5 Wiring Diagram with MITSUBISHI MR-E Servo Driver

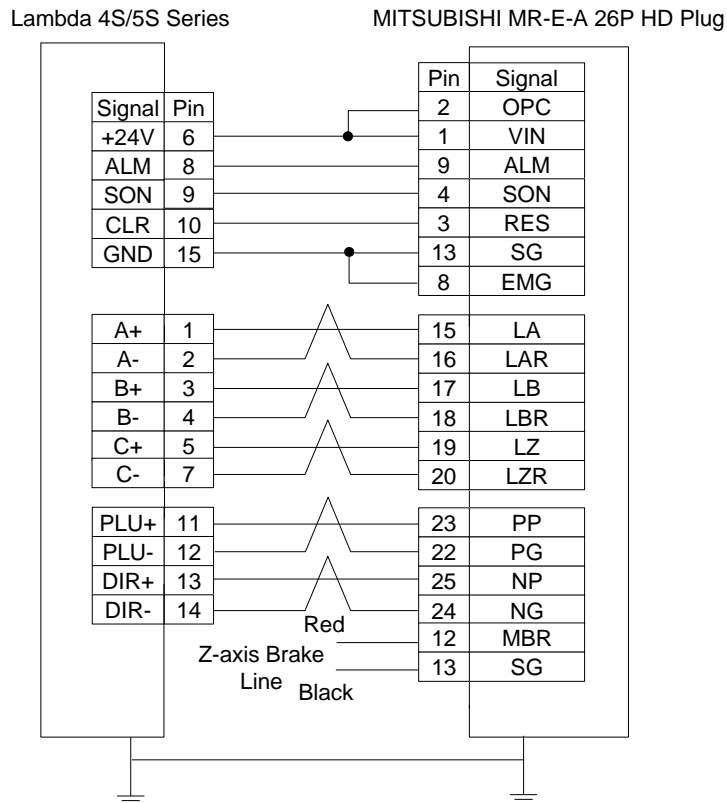

5.5.2.6 Wiring Diagram with DELTA Servo Driver

DELTA ASDA-A, ASDA-A2 and ASDA-AB use the same cable. Among them, the wiring pins of ASDA-A2 and ASDA-AB are totally the same. As for ASDA-A, with PULSE as 41 and /PULSE as 43, its pulse signal pins are opposite to those of ASDA-A2 and ASDA-AB, but the other wiring pins are totally the same. For the detailed parameters settings, see chapter 5.4.2.8 and chapter 5.4.2.9.

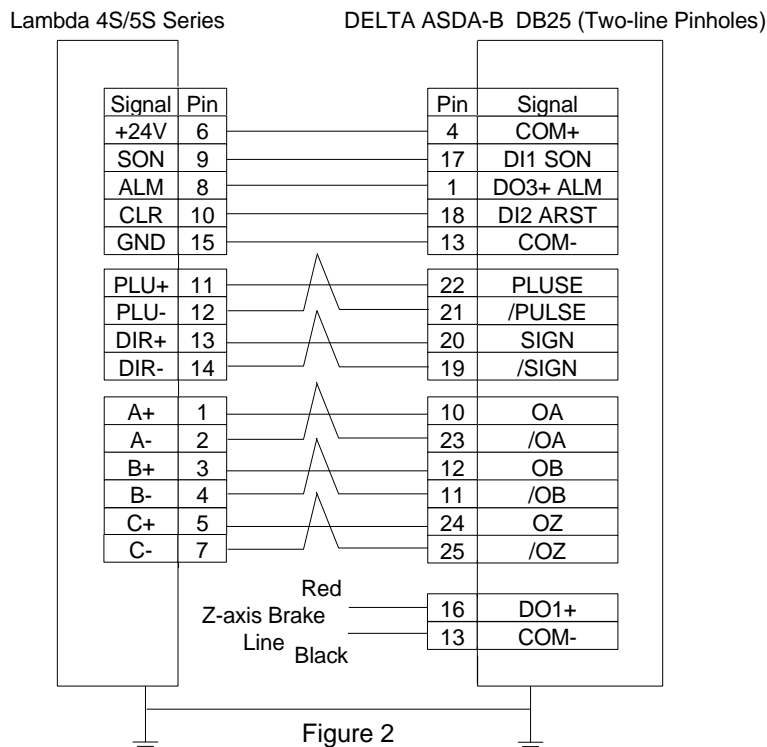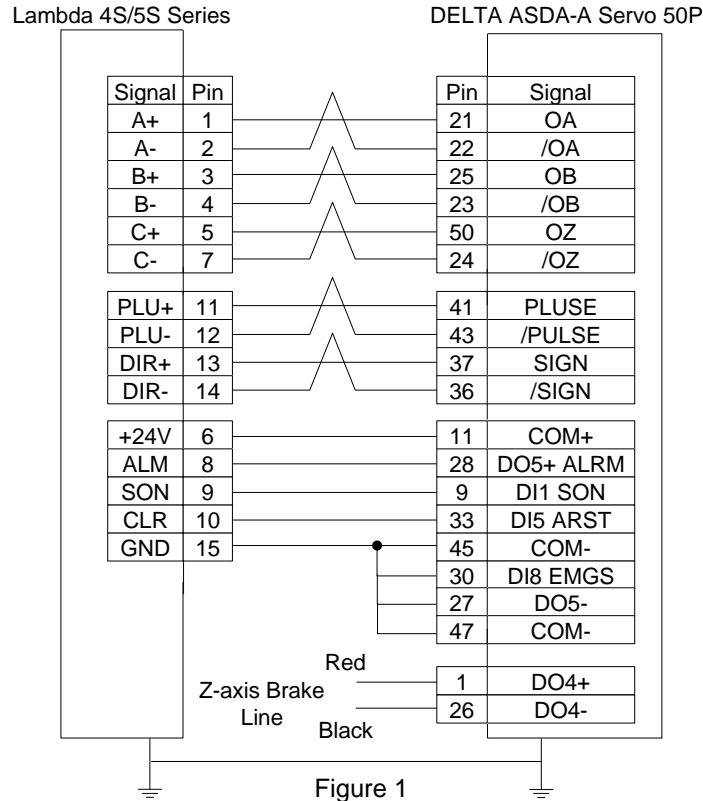

Lambda 4S/5S Series

DELTA ASDA-B2 DB25 (Two-line Pinholes)

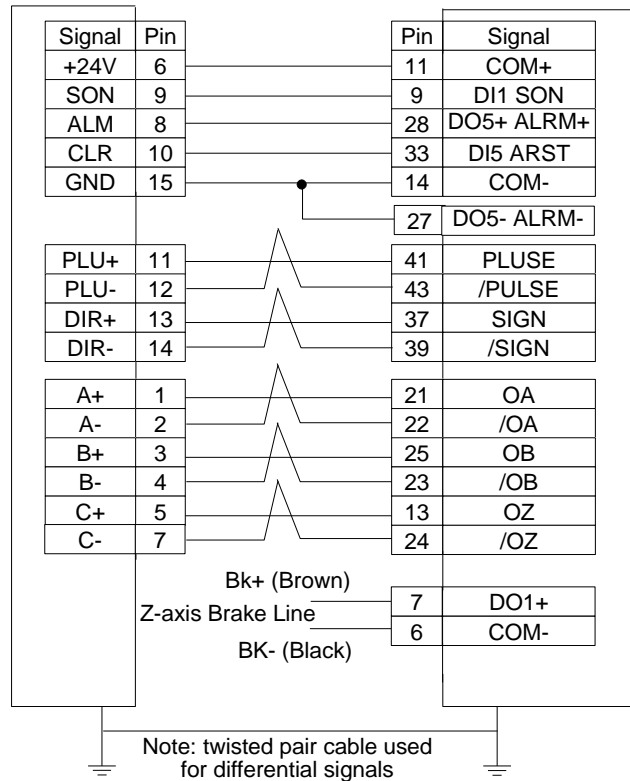


Figure 3

DELTA ASDA-B DB25 (Two-line Pinholes)

Lambda 4S/5S Series

DELTA ASDA-B DB25 (Two-line Pinholes)



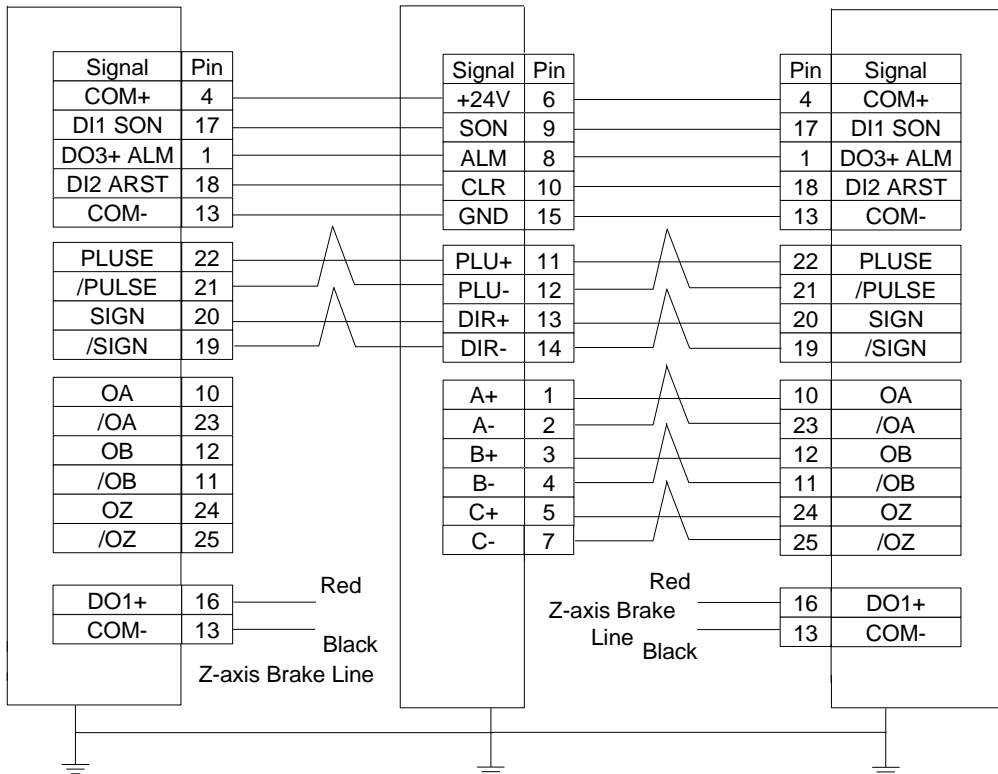


Figure 4


5.5.2.7 Wiring Diagram with FUJI Servo Driver

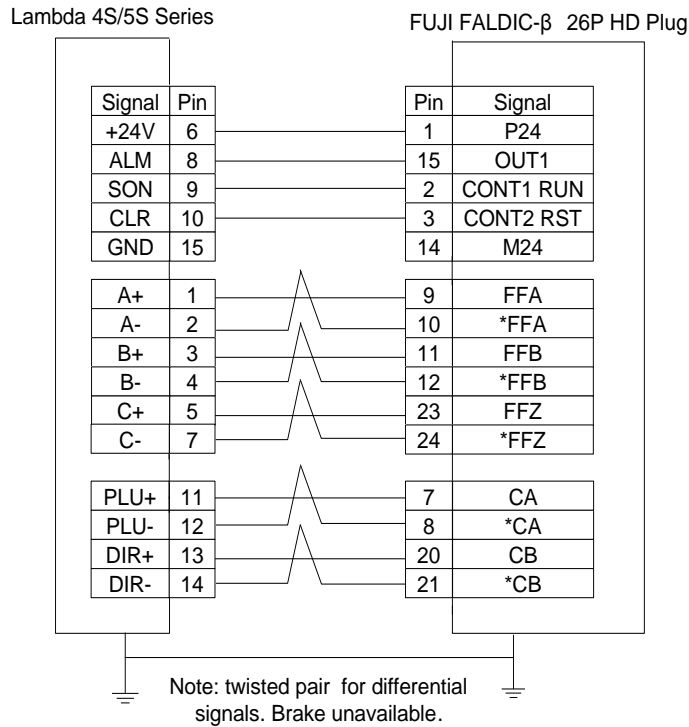


5.5.2.8 Wiring Diagram with HITACHI Servo Driver

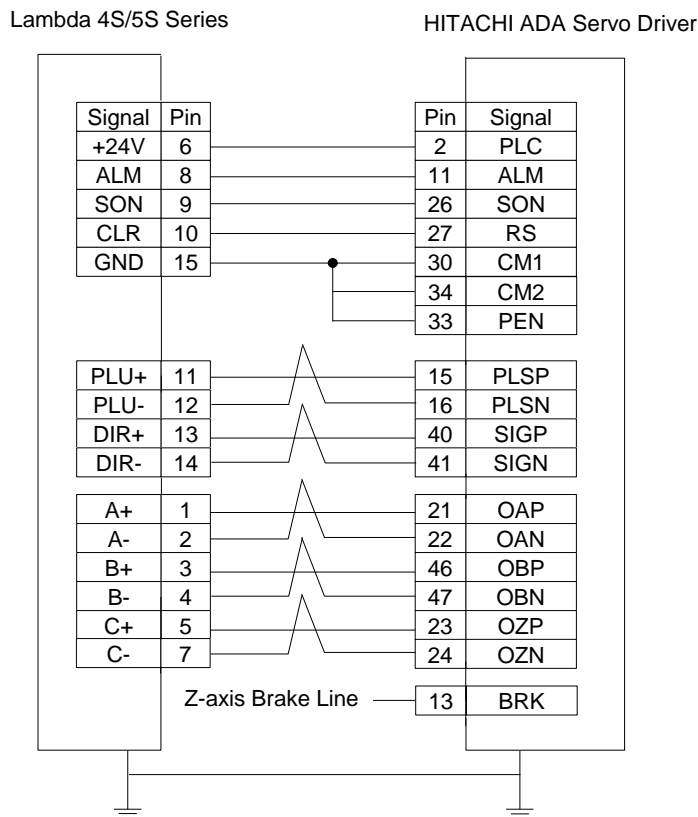


5.5.2.9 Wiring Diagram with SANYO PY Servo Driver

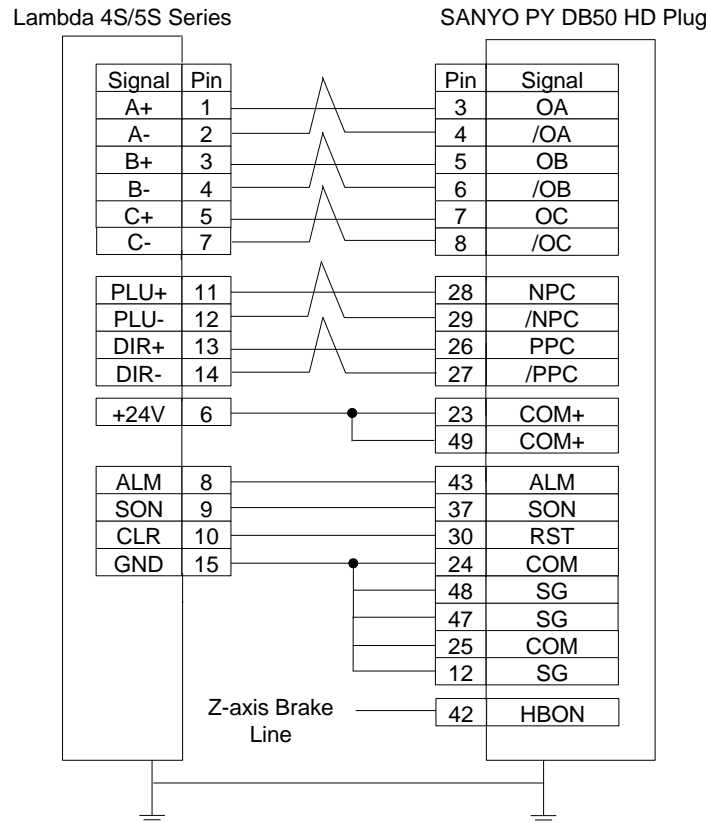


5.5.2.10 Wiring Diagram with SANYO R Servo Driver

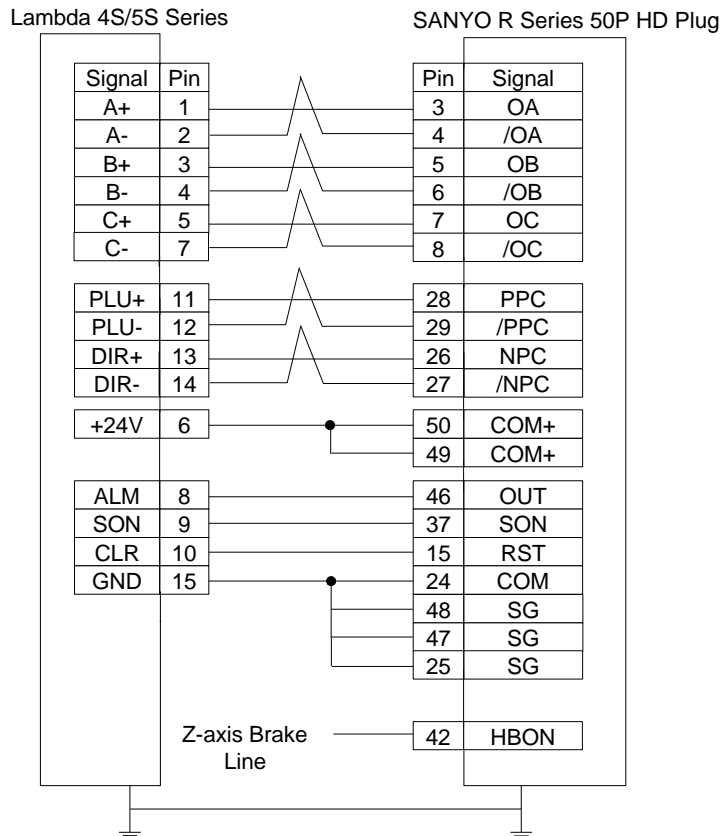


5.5.2.11 Wiring Diagram with KT270 Servo Driver

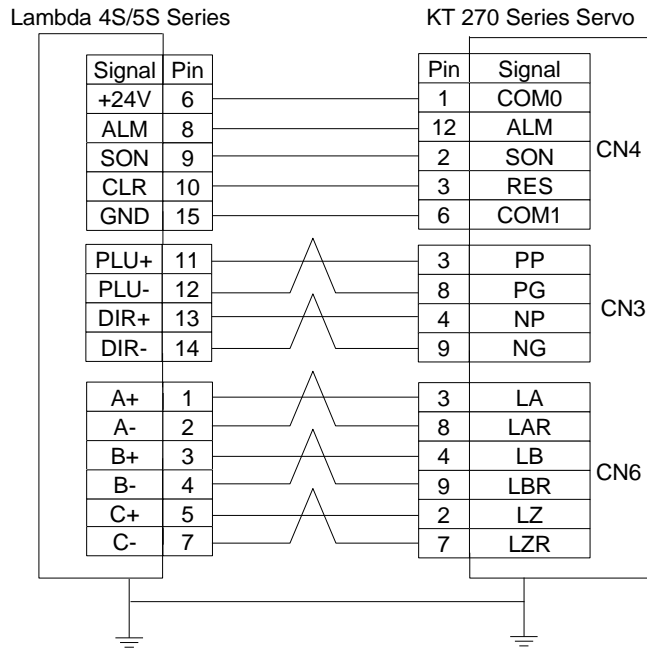


5.5.2.12 Wiring Diagram with STONE GS Servo Driver

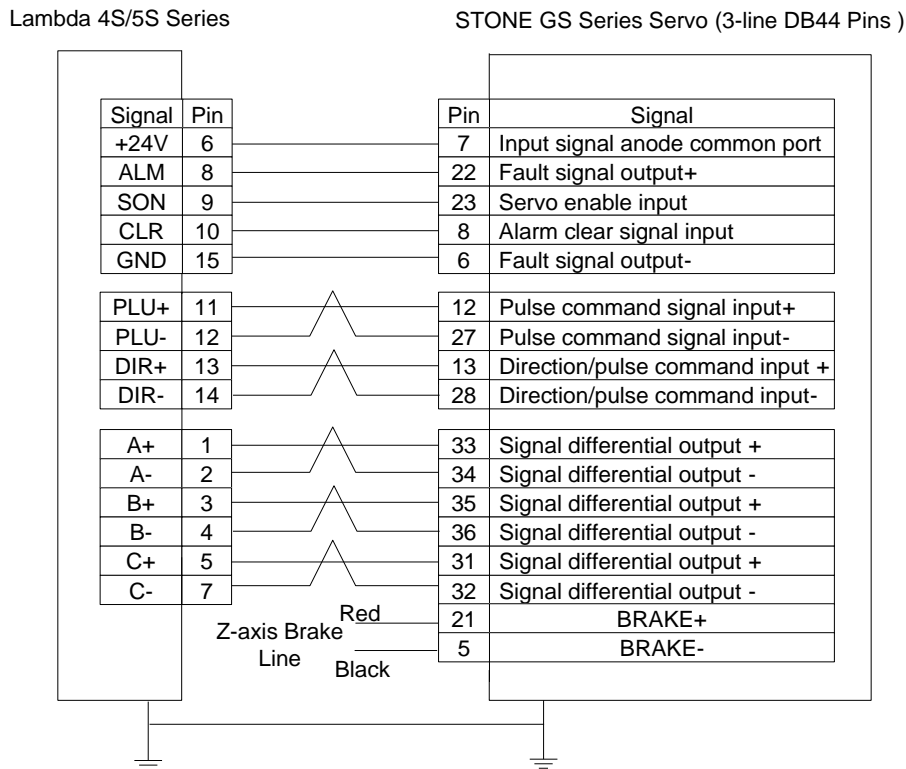

5.5.2.13 Wiring Diagram with TECO TSDA Servo Driver

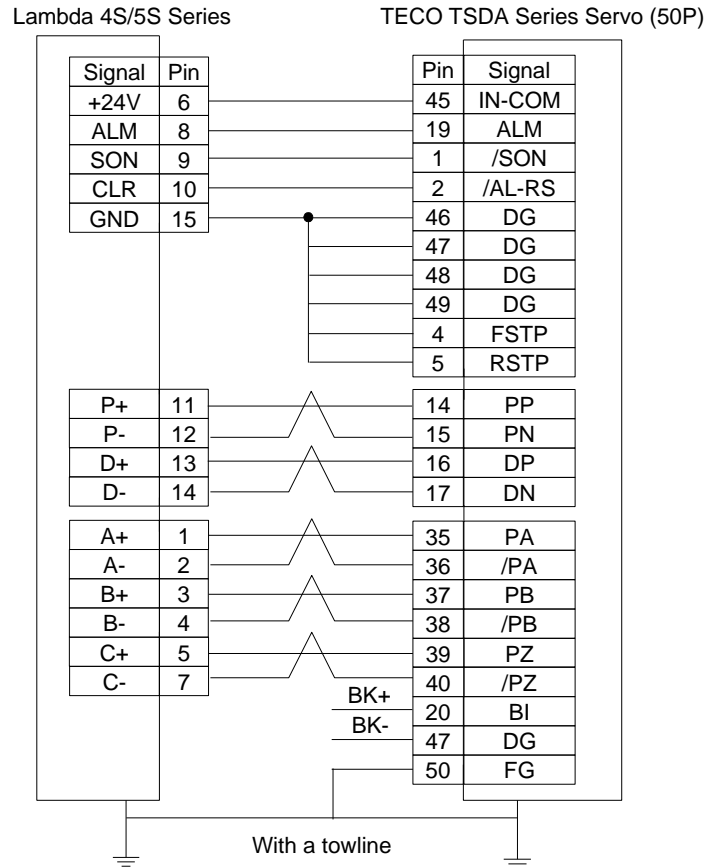

5.5.2.14 Wiring Diagram with TECO ESDA Servo Driver

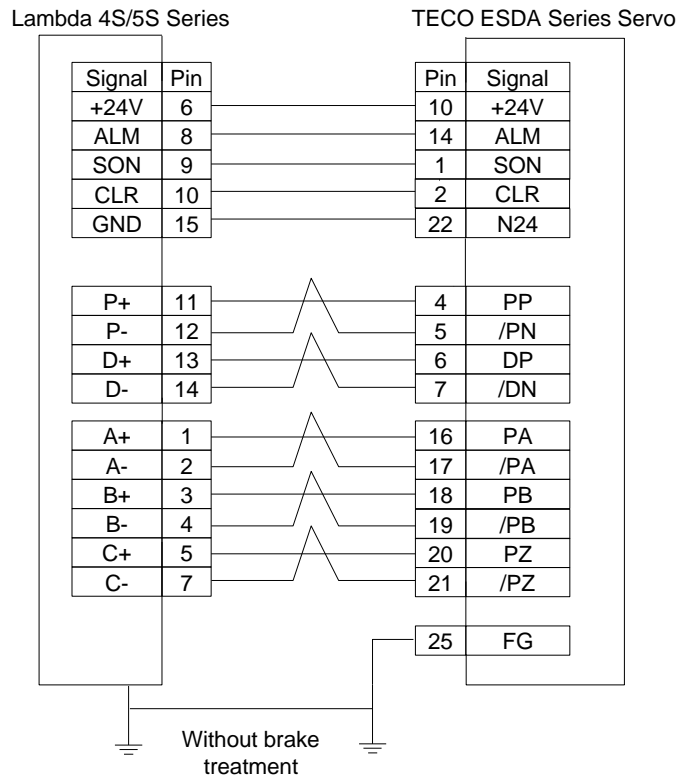

6 Software License Agreement

Important—Read Carefully before Using This Product:

The term “Software Product” includes all copies of the licensed software and its documentation. This license agreement is a legal agreement between You (either an individual, a legal entity or any affiliated companies or other entities) and Weihong Electronic Technology Co., Ltd. (hereinafter referred to as Weihong Company). By installing, copying, or otherwise using the Software Product, you agree to be bound by the terms and conditions of this license. Unless otherwise stated in this agreement, you shall not use, copy, revise, rent, or transfer the Software product or any part of the Software Product for any other purposes.

Description of Further Rights and Restrictions:

1. You may install for use one copy of the Software Product on a single machine;
2. You may make a copy of the Software Product for archive or backup purposes and the copy is to be used on this machine only;
3. You may transfer the Software Product and the license agreement to a third party, provided that the third party accepts the terms and conditions stated in this agreement, with prior express permission from Weihong Company;
4. When transfer confirmed, you shall transfer all the copies of the original documents and the supplementary documents to the third party or destroy all the copies un-transferred.
5. You can use the Software Product on a network server or intranet server only if it is stipulated in explicit terms that you are allowed to use the Software Product on a network server or intranet server, or you have purchased license for each node and terminal using the Software Product;
6. You may NOT sublicense, assign or transfer the license agreement;
7. You may NOT or direct any third party to reverse engineer, decompile or disassemble the Software Product;
8. You may NOT copy or transfer the Software Product or any part of the Software Product unless otherwise expressly stated in this agreement;
9. The license agreement shall be terminated automatically upon you transfer the Software Product or copies of all or part of the Software Product to a third party.

Intellectual Property Rights Notice:

The Software Product and all intellectual property rights therein (including but not limited to any all copyrights, patents, trademarks, and publicity rights) are owned by Weihong Company. The Software Product is protected for Weihong Company on the basis of copyright law and international treaty provisions as well as on the basis of other laws and agreements regarding intellectual property. You are

not allowed to remove the copyright statement made in the Software Product, and guarantee that you shall copy the copyright statement in all copies of the Software Product or of any part of the Software Product. You are obliged to stop any form of illegal copying of the Software Product and accompanying materials.

After-sales Guarantee:

Weihong Company guarantees that for 90 days from the date of shipment the software carrier will be free from defects in materials and workmanship. When such a defect has been confirmed, our only responsibility is to replace the software carrier. This remedy is your exclusive remedy. This after-sales guarantee is invalid for any carrier defect caused by accidents, abuses or maloperation. The replaced software carrier enjoys the remaining guarantee time of the original software carrier or of a 30-day guarantee time, whichever is longer.

Except as the after-sales guarantee made above, the Software Product does not enjoy any other form of after-sale guarantee.

Limitation of Liability:

The above guarantee, whether made explicitly or by implication, constitutes the entire contents of the guarantee, including guarantee for the commerciality and applicability of special application aim. Whether you follow other terms in this agreement or not, Weihong Company, as well as its agents and sales staff, will not be responsible for any profits loss, availability loss, business break-off or any forms of indirect, special, accidental or inevitable damage or claim made by any third party, generated from the using of the Software Product, even if Weihong Company has been informed of the possible occurrence of such events in advance.

Termination:

This license may be terminated by Weihong Company at any time once you violate any terms or conditions made in this agreement. Once the license is terminated, you are obliged to destroy all the copies of the Software Product or return them to Weihong Company.

Applicable Law:

Copyright Law, Regulations for the Protection of Computer Software, Patent Law and other relevant laws and regulations.

Now, we affirm that you have already read through this agreement and understood it thoroughly and agreed to comply with all of the terms and conditions of this agreement strictly.

Weihong Electronic Technology Co., Ltd.